TEST REPORT

REPORT NO.:	T71379.01-01 Rev B
NTS JOB NO.:	T71379.01
CLIENT P.O. NO.:	TA-037
CONTRACT:	N/A
TOTAL PAGES:	445
DATE:	June 20, 2014

Original Release: April 28, 2014
Revision A: May 29, 2014
Revision B: June 20, 2014

**NATIONAL CERTIFICATION TEST REPORT
FOR
CERTIFICATION TESTING
OF THE
ELECTION SYSTEMS & SOFTWARE
EVS 5.2.0.0 VOTING SYSTEM**

EAC CERTIFICATION NUMBER - ESSEVS5200

For

Election Systems & Software, LLC
11208 John Galt Blvd.
Omaha, NE 68137-2364

STATE OF ALABAMA
COUNTY OF MADISON }

Robert D. Hardy, Department Manager, being duly sworn, deposes and says:
The information contained in this report is the result of complete and carefully conducted testing
and is to the best of his knowledge true and correct in all respects.

[signature]

SEAL'

SUBSCRIBED and sworn to before me this 20 day of June ,20 14
[signature] Sandra A. xDaniel
Notary Public in and for the State of Alabama at Large

My Commission expires June 2, 2015

PREPARED BY:	*[signature]* Stephen Han, Project Engineer	6/20/14 Date
APPROVED BY:	*[signature]* Frank Padilla, Voting Systems Manager	6/20/14 Date
NTS Q. A.:	*[signature]* Brenda Moss For Rick Davis, Q. A. Manager	6/00/14 Date

NVLAP
NVLAP LAB CODE 200771-0

VSTL
EAC Lab Code 0704

		REVISION:	Revision B

NTS
WE ENGINEER SUCCESS
HUNTSVILLE OPERATIONS

		REPORT NO.	T71379.01-01 Rev B
		DATE:	June 20, 2014

| REV	DATE	PAGE OR PARAGRAPH AFFECTED	DESCRIPTION OF CHANGES
---	4-28-14	Entire Document	Original Document Release
A	5-29-14	1.1	Added more description to ExpressVote
A	5-29-14	1.3	Reworded 1st bullet
A	5-29-14	1.3	Corrected 4th bullet
A	5-29-14	2.1.1	Reworded DS200 paragraph
A	5-29-14	2.1.1	Added additional information for AutoMARK
A	5-29-14	2.1.2	Reworded ElectionWare description
A	5-29-14	2.1.2	Corrected (ELS)
A	5-29-14	2.4	Corrected determined
A	5-29-14	2.5	Removed the s on operation
A	5-29-14	3.1	Reworded the 2nd paragraph
A	5-29-14	3.3	Corrected capital L in Global
A	5-29-14	4.2	Reworded 1st paragraph
A	5-29-14	4.3	Removed space between 2005 VVSG
A	5-29-14	4.3	Reworded 1st paragraph on page 30
A	5-29-14	4.4	Reworded 1st paragraph
A	5-29-14	4.4.2	Reworded 1st paragraph
A	5-29-14	4.4.3	Reworded 1st paragraph
A	5-29-14	4.5	Reworded 1st and 2nd paragraphs
A	5-29-14	4.5.1	Added additional information in table 4-5
A	5-29-14	4.5.1	Corrected Election names on table 4-6
A	5-29-14	4.5.3	Reworded 1st paragraph
A	5-29-14	4.5.4	Reworded 2nd paragraph
A	5-29-14	4.5.7	Corrections made in 1st and 2nd paragraphs
A	5-29-14	4.5.7	Correction made in Voting and Post-Voting paragraphs
A	5-29-14	4.6	Reworded 1st paragraph
A	5-29-14	4.6	Corrected repeated sentences for Anomaly 3
A	5-29-14	4.6	Corrected repeated sentences for Anomaly 4
A	5-29-14	4.7	Reworded 1st paragraph
A	5-29-14	Appendix L	Added Security Test Matrix
B	6-20-14	2.1.2	Removed the 'U' in (UELS) changed to (ELS)
B	6-20-14	4.5.1	Added additional information in table 4-5
B	6-20-14	4.5.3	Added additional information to Summary Findings
B	6-20-14	Cover page	Added Certification Number

TABLE OF CONTENTS

Page No.

TABLE OF CONTENTS (Continued)

Page No.

APPENDICES

1.0 INTRODUCTION

EVS 5.2.0.0 was submitted for 2005 Voluntary Voting System Guidelines Standards Version 1.0 (2005 VVSG) certification. The modifications submitted were tested to the latest voting system standards, the 2005 Voluntary Voting System Guidelines (2005 VVSG), based on the requirements set forth in section 4.4.2.3 of the EAC Testing and Certification Program Manual.

1.1 Testing Scope

This report presents the procedures followed and the results obtained during certification testing of the Election Systems & Software (ES&S) EVS 5.2.0.0 Voting System. A previous version of this system, EVS 5.0.0.0, was granted certification under EAC Certification Number ESSEVS5000. Since that time, ES&S has incorporated modifications resulting in the release of EVS 5.2.0.0.

The primary purpose of certification testing was to determine whether the system complied with the requirements of the Election Assistance Commission (EAC) 2005 Voluntary Voting System Guidelines (VVSG). The primary purpose of this modification was to introduce the ExpressVote Universal Vote Capture Device and the DS200 1.3 & 1.2.3 hardware versions into the previously certified EVS 5.0.0.0 voting system. In addition, ES&S submitted software changes to the DS200, DS850, AutoMARK, ElectionWare, and Election Reporting Manager (ERM).

The system changes submitted to the EAC in the Application for Certification (ESS1303) include functional and hardware modifications to the EMS, DS850, and DS200. Functional upgrades were made throughout this modification including software fixes, conformance with new RFIs released before application submission, software to enhance usability, replacement of hardware parts nearing end of life, and integration with the EVS suite to enhance usability and performance. These modifications are presented in their entirety in Appendix A.

1.2 Objective

The objective of this system modification test program was to ensure that EVS 5.2.0.0 complied with the hardware and software requirements of the EAC 2005 VVSG. The scope and detail of the requirements tested in the certification were selected to correspond to the scope of the system detailed in the application submitted by ES&S. An in-depth examination of the system further confirmed the applicable requirements selected for compliance testing. This included the inspection and evaluation of system documentation and the execution of functional tests to verify system performance and function under normal/abnormal conditions.

1.3 Test Report Overview

This test report consists of four main sections and appendices:

- 1.0 Introduction – Provides: the architecture of the National Certification Test Report (hereafter referred to as Test Report), a brief overview of the testing scope of the Test Report, customer information, and references applicable to the voting system hardware, software, and this test report.

1.0 INTRODUCTION (Continued)

1.3 Test Report Overview (Continued)

- 2.0 System Identification – Provides information about the system tested that includes the system name and major subsystems, test support hardware, and specific documentation provided by the vendor used to support testing.

- 3.0 Test Background – Contains information about the certification test process and a list of terms and nomenclature pertinent to the Test Report and system tested.

- 4.0 Test Findings and Recommendations – Provides a summary of the results of the testing process.

- Appendices– Information supporting reviews and testing of the voting system.

1.4 Customer

Election Systems & Software, LLC
11208 John Galt Blvd.
Omaha, NE 68137-2364

1.5 References

The documents listed were utilized to perform testing.

- Election Assistance Commission 2005 Voluntary Voting System Guidelines, Volume I, Version 1.0, "Voting System Performance Guidelines," and Volume II, Version 1.0, "National Certification Testing Guidelines", dated December 2005

- Election Assistance Commission Testing and Certification Program Manual, Version 1.0, effective date June 1, 2011

- Election Assistance Commission Voting System Test laboratory Program Manual, Version 1.0, expires November 2014

- National Voluntary Laboratory Accreditation Program NIST Handbook 150, 2006 Edition, "NVLAP Procedures and General Requirements (NIST Handbook 150)," dated February 2006

- National Voluntary Laboratory Accreditation Program NIST Handbook 150-22, 2008 Edition, "Voting System Testing (NIST Handbook 150-22)," dated May 2008

- United States 107th Congress Help America Vote Act (HAVA) of 2002 (Public Law 107-252), dated October 2002

- Test Guidelines Documents: EMI-001A, Test Guidelines for Performing Electromagnetic Interference (EMI) Testing," and EMI-002A, "Test Procedure for Testing and Documentation of Radiated and Conducted Emissions Performed on Commercial Products"

- Quality Assurance Program Manual, Revision 5

- ANSI/NCSL Z540-1, "Calibration Laboratories and Measuring and Test Equipment, General Requirements"

- ISO 10012-1, "Quality Assurance Requirements for Measuring Equipment"

- EAC Requests for Interpretation and Notices of Clarification (listed on www.eac.gov)

1.0   INTRODUCTION (Continued)

1.5   References (Continued)

- EAC Quality Monitoring Program residing on:

    http://www.eac.gov/testing_and_certification/quality_monitoring_program.aspx

- Wyle Test Report No. T71013.02-01 – Hardware Compliance Testing of Election Systems and Software FL EVS 4.5.0.0 ExpressVote Hardware Version 1.0

- Wyle Test Report No. T71013.01-01 – Hardware Compliance Testing of Election Systems and Software FL EVS 4.5.0.0 DS200 Hardware Version 1.3

- Wyle Test Report No. T59087.01-01 Rev A – National Certification Test Report of Election Systems and Software EVS 5.0.0.0

2.0   SYSTEM IDENTIFICATION AND OVERVIEW

2.1   System Overview

The ES&S EVS 5.2.0.0 Voting System is a paper-based, digital scan voting system. The EVS 5.2.0.0 Voting System hardware consists of six major components:

1. Election Management System (EMS) Server

2. Election Management System (EMS) client (desktop and/or laptop) with Election Reporting Manager (ERM)

3. Polling Place American Disability Act (ADA) and Universal Vote Capture Device – ExpressVote

4. Polling Place Scanner – DS200

5. Polling Place American Disability Act (ADA) Devices – AutoMARK A100, AutoMARK A200, and AutoMARK A300

6. Central Count Digital Scanner – DS850

The following paragraphs describe the design and structure of the EVS 5.2.0.0 Voting System as taken from the ES&S Technical Documentation.

(The remainder of this page intentionally left blank)
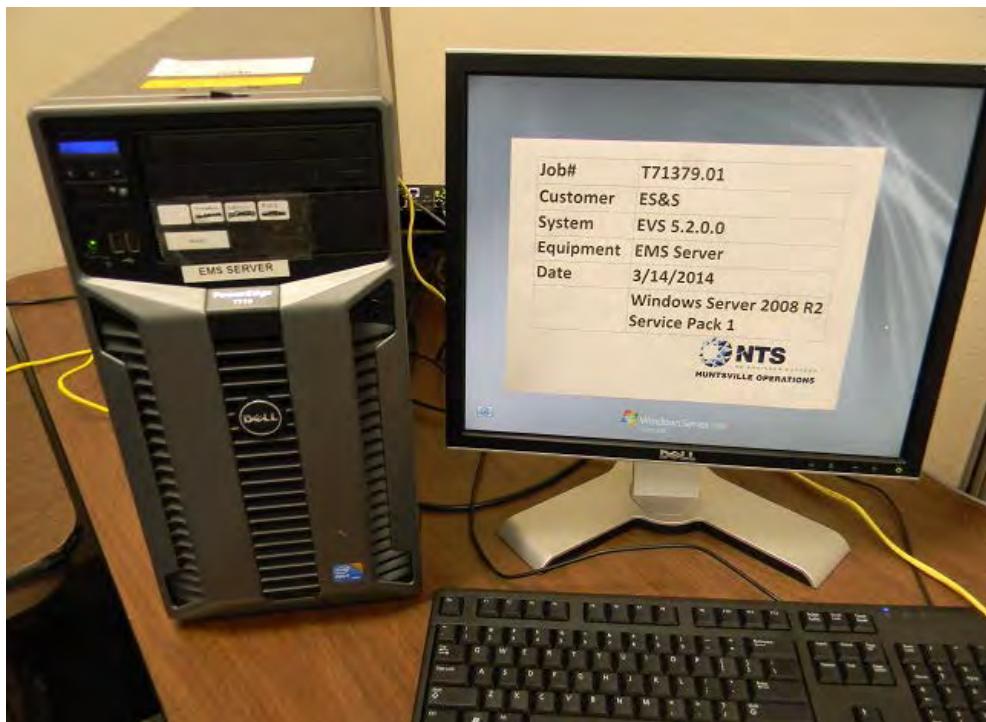
2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.1   System Overview (Continued)

2.1.1   System Hardware

EMS Client Server Configuration

EVS 5.2.0.0 Voting System Election Management System (EMS) was configured with a Server running Windows Server 2008 R2 with Service Pack 1 (SP1), and a combination of a client laptop and a client desktop running Windows 7 Professional SP1.
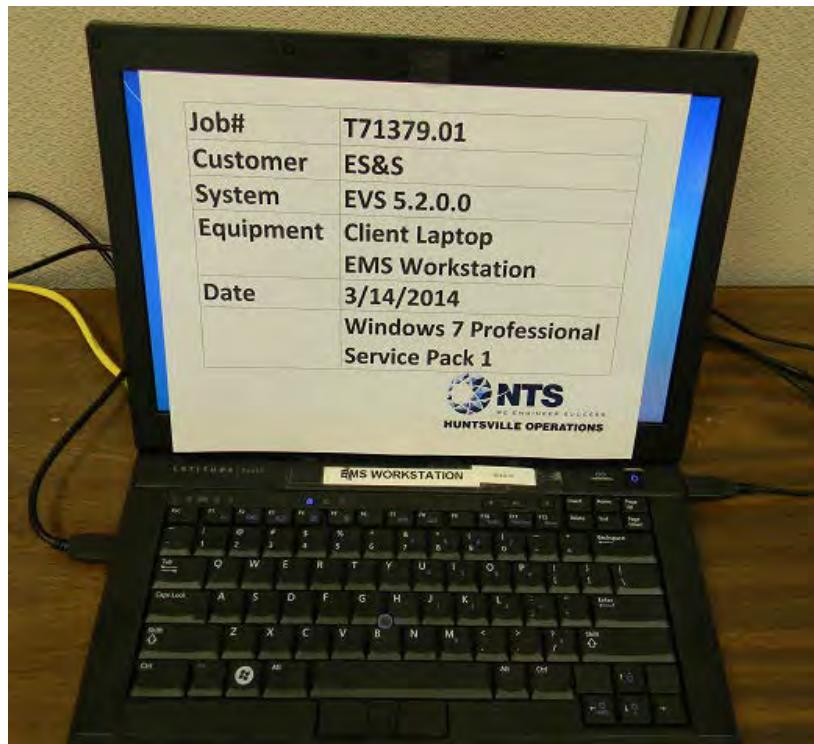
Photograph No. 1: EMS Server

(The remainder of this page intentionally left blank)
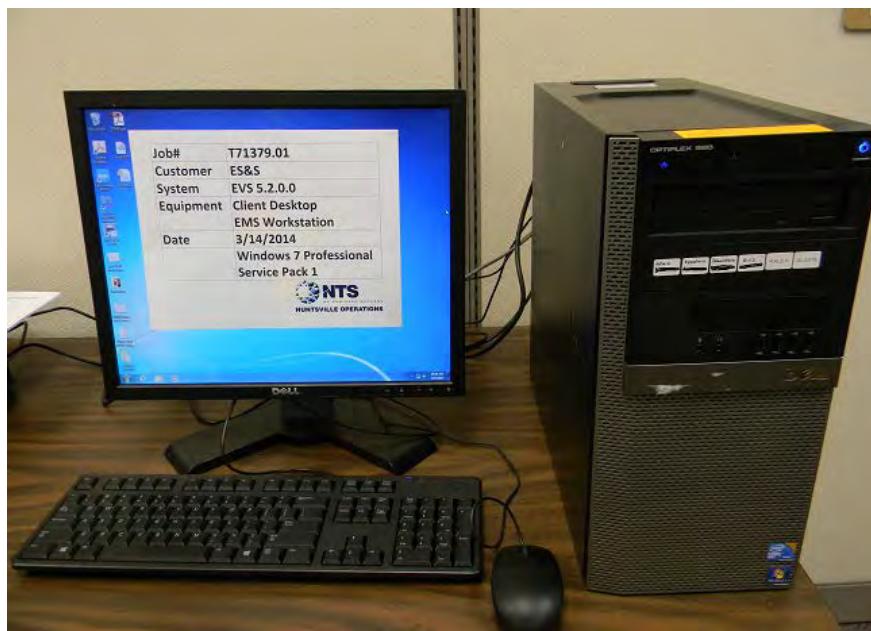
2.0 SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.1 System Overview (Continued)

2.1.1 System Hardware (Continued)

Photograph No. 2: EMS Client Laptop

Photograph No. 3: EMS Client Desktop

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.1   System Overview (Continued)

2.1.1   System Hardware (Continued)

ExpressVote Vote Capture Device

The ExpressVote is a universal vote capture device with an independent voter-verifiable paper record that is digitally scanned for tabulation by the DS200 or the DS850. This system combines paper-based voting with touch screen technology. The ExpressVote includes a mandatory vote summary screen that requires voters to confirm or revise selections prior to printing the summary of ballot selections using the internal thermal printer. Once printed, ES&S ballot scanners process the vote summary card. The ExpressVote can serve all voters, including those with special needs, allowing voters to cast ballots autonomously. ES&S has fully integrated the ExpressVote with the existing suite of ES&S voting system products.

Photograph No. 4: ExpressVote

(The remainder of this page intentionally left blank)

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.1   System Overview (Continued)

2.1.1   System Hardware (Continued)

Precinct Ballot Tabulator: DS200

The precinct ballot tabulator component is the DS200. The DS200 is a digital scan paper ballot tabulator designed for use at the polling place. After the voter marks a paper ballot, their ballot is inserted into the unit and immediately tabulated. The tabulator uses a high-resolution image-scanning device to image the front and back of the ballot simultaneously. The resulting ballot images are then processed by a proprietary mark recognition engine.

The system includes a 12-inch touch screen display providing voter feedback and poll worker messaging. Once a ballot is tabulated and the system creates cast vote records, the ballot is dropped into an integrated ballot box. The DS200 includes an internal thermal printer for the printing of the zero reports, log reports, and polling place totals upon the official closing of the polls.

**Photograph No. 5: DS200 (on plastic ballot box)**

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.1   System Overview (Continued)

2.1.1   System Hardware (Continued)

Photograph No. 6: DS200 (on metal ballot box)

(The remainder of this page intentionally left blank)

2.0 SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.1 System Overview (Continued)

2.1.1 System Hardware (Continued)

<u>Electronic Ballot Marking Device: AutoMARK Voter Assist Terminal (VAT)</u>

The electronic ballot marking device component is the ES&S AutoMARK Voter Assist Terminal (VAT). The AutoMARK VAT assists voters with disabilities by marking optical scan ballots.

The AutoMARK VAT includes two user interfaces to accommodate voters who are visually or physically impaired or voters who are more comfortable reading or hearing instructions and choices in an alternative language. The AutoMARK is equipped with a touch-screen and keypad. The touch-screen interface includes various colors and effects to prompt and guide the voter through the ballot marking process. Each key has both Braille and printed text labels designed to indicate function and a related shape to help the voter determine its use.

Regardless whether the voter uses the touch-screen or the audio interface, changes can be made throughout the voting process by navigating back to the appropriate screen and selecting the change or altering selections at the mandatory vote summary screen that closes the ballot-marking session.

The A100 (hardware version 1.0), A200 (hardware versions 1.1 and 1.3) and A300 (hardware version 1.3) all operate the same and have the same features. The difference between the models is the location of two printed circuit boards and related wiring harness and cables. In the A200, the Printer Engine Board and Power Supply Board were moved from under the machine to the top. The A300 has a different lock and label. Since the functionality is not different between the A100, A200, and A300 equipment, the A200 was the only one used in system integration testing. Therefore, the A100, A200, and A300 are all included in the recommendation for certification.

Photograph No. 7: AutoMARK A100 VAT

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.1   System Overview (Continued)

2.1.1   System Hardware (Continued)

Photograph No. 8: AutoMARK A200 VAT

(The remainder of this page intentionally left blank)

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.1   System Overview (Continued)

2.1.1   System Hardware (Continued)

<u>Tabulator: DS850</u>

The DS850 is a high-speed, digital scan central ballot counter. During scanning, the DS850 prints a continuous audit log to a dedicated audit log printer and can print results directly from the scanner to a second connected printer. The scanner saves results internally and to results collection media that officials can use to format and print results from a PC running Election Reporting Manager. The DS850 has an optimum throughput rate of 300 ballots per minute and uses cameras and imaging algorithms to image the front and back of a ballot, evaluate the results and sort ballots into discrete bins to maintain continuous scanning.

Photograph No. 9: DS850

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.1   System Overview (Continued)

2.1.2   System Software

The EVS 5.2.0.0 Voting System EMS is an application suite comprised of six components: Election Reporting Manager (ERM), ElectionWare, ES&S Event Logging Service (ELS), ExpressVote Previewer, Removable Media Service (RMS), and VAT Previewer.

Election Reporting Manager (ERM)

Election Reporting Manager (ERM) generates paper and electronic reports for election workers, candidates, and the media. Jurisdictions can use a separate ERM installation to display updated election totals on a monitor as ballot data is tabulated, and send the results' reports directly to the media outlets.

ERM supports accumulation and combination of ballot results data from all ES&S tabulators. Precinct and accumulated total reports provide a means to accommodate candidate and media requests for totals and are available upon demand. High-speed printers are configured as part of the system accumulation/reporting stations PC and related software.

ElectionWare

ElectionWare is the election management software that provides end-to-end election management activities through a powerful and intuitive user interface. Its efficient and flexible design enables jurisdictions of all sizes to effectively manage their elections. ElectionWare delivers everything needed to run an election, from creating the ballots to reporting the voting results.

ES&S Event Logging Service (ELS)

ES&S Event Logging Service leverages the Windows Event Viewer, included with a standard Windows installation, to audit user interactions with the ES&S Election Management System.

ExpressVote Previewer

The ExpressVote Previewer is an application within the EMS program that allows the user to preview audio text and screen layout prior to burning Election Day media for the ExpressVote.

Removable Media Service (RMS)

Removable Media Service (RMS) is an application that runs in the background of the EMS client workstation and supports the insertion and removal of election and results USB media.

VAT Previewer

The VAT Previewer is an application within the EMS program that allows the user to preview audio text and screen layout prior to burning Election Day media for the AutoMARK.

2.0 SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.1 System Overview (Continued)

2.1.3 System Operational Concept

The operational flow and low-level system interfaces for the EVS 5.2.0.0 Voting System is illustrated in Figure 1-1.
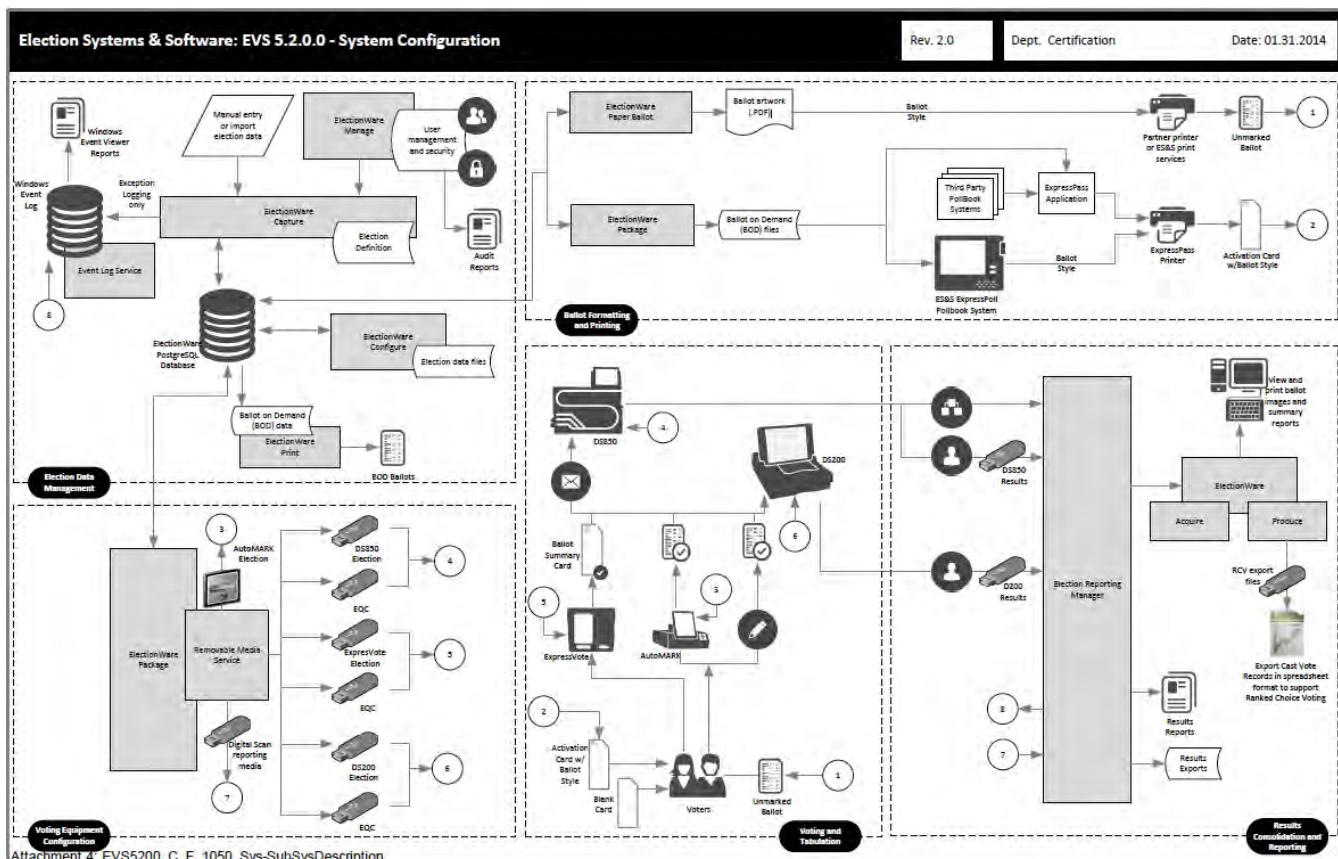
Figure 1-1 System Overview Diagram

(The remainder of this page intentionally left blank)

2.0 SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.2 Software

This section defines the two types of software required for testing: software used for the testing of hardware, software, security and system integration; and supporting software required for the test environment (operating systems, compliers, assemblers, database managers, and any other supporting software). All COTS third-party software was downloaded or retrieved by NTS Huntsville qualified personnel. These products were verified not to have been modified and were built into the EVS 5.2.0.0 for the entire test campaign. NTS Huntsville believes these components to have proven performance in other commercial applications. Both COTS and non-COTS software components are listed in this section.

Table 2-1 EVS 5.2.0.0 EMS Software Platform Component Descriptions

Software Required For Testing	Software Version
ElectionWare	4.6.0.0
Election Reporting Manager (ERM)	8.11.0.0
ES&S Event Logging Service (ELS)	1.5.5.0
ExpressVote Previewer	1.4.0.0
ExpressPass Application*	1.1.0.0
Removable Media Service (RMS)	1.4.5.0
VAT Previewer	1.8.6.0

*ExpressPass Application software is not in the scope of certification, but NTS reviewed the source code for 2005 VVSG compliance.

Table 2-2 EVS 5.2.0.0 EMS COTS Software Platform Component Descriptions

Software Required For Testing	Description
Windows 7 Professional, with SP1	Original Disk
Windows Server 2008 R2, with SP1	Original Disk
Adobe Acrobat Standard version XI	Original Disk
RM/Cobol	12.06
Cerberus FTP	6.0.7.1
Symantec Endpoint Protection Small Business Edition 2013	12.1.4

(The remainder of this page intentionally left blank)

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.3   Hardware

The system submitted by ES&S for certification testing consisted of the following hardware, firmware, and software source code components.

Table 2-3 EVS 5.2.0.0 Voting System EMS Description

Equipment	Manufacturer	Version/Model	Specifications	Serial Number
EMS Client Laptop	Dell	Latitude E6410	Intel Core i5 CPU M580 @ 2.67GHz 4.00 GB Installed RAM HD Capacity 250 GB	2FD65Q1
EMS Server	Dell	T710	Intel Xeon CPU E5645 @ 2.40GHz (2 processors), 12.0 GB Installed RAM HD Capacity 300 GB	JPZ6VR1
EMS Client Desktop	Dell	OptiPlex 980	Intel Core i5 CPU 650 @ 3.20 GHz 4.0 GB Installed RAM HD Capacity 320 GB	3TZJFQ1

Table 2-4 EVS 5.2.0.0 Build Machine Description

Equipment	Manufacturer	Version/Model	Serial Number	COTS/Non-COTS
Build 1	Dell OptiPlex 760	Processor: Intel Duo Core E8400 Wolfdale Memory: 4x 1GB, 800 MHz Ram Hard Drive Capacity: 80 GB	6D7DJG1	COTS
Build 2	Dell OptiPlex 760	Processor: Intel Duo Core E8400 Wolfdale Memory: 4x 1GB, 800 MHz Ram Hard Drive Capacity: 80 GB	6DCKJG1	COTS
Build 3	Dell Precision T3500	Processor: Intel X5650 2.66/6.4 12MB Xeon Westmere Memory: 1x 2GB, 1333 MHz Ram Hard Drive Capacity: 160 GB	15TMMN1	COTS
Build 4	Dell Precision T3500	Processor: Intel X5650 2.66/6.4 12MB Xeon Westmere Memory: 1x 2GB, 1333 MHz Ram Hard Drive Capacity: 160 GB	15TNMN1	COTS

(The remainder of this page intentionally left blank)

2.0 SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.3 Hardware

Table 2-5 EVS 5.2.0.0 Voting System Equipment

Equipment	Description	Serial Numbers
ExpressVote Hardware Version 1.0	Vote Capture Device	EV0113350021, EV0113350022 EV0113350025, EV0113350037 EV0113350052, EV0113350033, EV0113350049
DS200 Hardware Version 1.2.1	Precinct Count Digital Scanner	ES0108340026, DS0113340087
DS200 Hardware Version 1.2.3	Precinct Count Digital Scanner	DS0113360186
DS200 Hardware Version 1.3	Precinct Count Digital Scanner	DS0313350002, DS0313350010
AutoMARK A100 Hardware Version 1.0	Accessible Voting Station	AM0106431607
AutoMARK A200 Hardware Version 1.1	Accessible Voting Station	AM0308421809
DS850 Hardware Version 1.0	Central Count Digital Scanner	DS850: DS8511090075 Cart: 549037-01 Laser Printer Oki B430dn: AL03021036A0 UPS APC-RS 1500: JB1103003923 Dot Matrix Printer Oki 420: AE72011853C0
Ballot Box Hardware v. 1.2 and 1.3	Plastic Ballot Box	Box1; Box 2; Box 3; Box 4; Box 5; Box 01; Box 02; E089; E099
Ballot Box Hardware v. 1.0, 1.1, & 1.2	Metal Box with Diverter	Box 12
Report Printer	OKI B6300	USQX074394
Headphones	Avid FV 60	HP-57936-1- 9
ExpressPass Printer*	Thermal Bar Code Printer	Model 4200 S/N: 01901042505
Quick Response (QR) Code Scanner	Motorola QR Code Scanner	Model DS9208 S/N: 14014000502091
Transport Media (USB Flash Drives)	Delkin 1GB Delkin 2 GB Delkin 4GB Delkin 8GB	NTS-assigned: TM-XXX
Compact Flash	Delkin Devices 1 GB Compact Flash	NTS-assigned: CF-XXX

*This equipment is not in the scope of certification. This equipment was tested to ensure that it functions as stated in the TDP. No other testing was performed on this equipment.

(The remainder of this page intentionally left blank)

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.4   Test Tools/Materials

This subsection enumerates any and all test materials needed to perform voter system testing. The scope of testing determined the quantity of a specific material required.

The following test materials are required to support the EVS 5.2.0.0 certification testing:

Table 2-6 Test Support Materials

Test Material	Quantity	Make	Model
Ballot on Demand Printer	1	OKI Data	C9650
ExpressPass Printer	1	Microcom	4200
QR Code Scanner	1	Motorola	DS9208
8 ½" X 11" Paper in Speed Loading Box (2700 Sheets)	4	Dot Matrix	951027
Security Seals	5000	Intab	800-0038R
Security Locks	20	E. J. Brooks	86022
	25	E. J. Brooks	6024
	50	American Casting Corp.	00561-03
ES&S Pens	20	BIC	Grip Roller
Ethernet Switch	1	Dell	HNC67M1
Security Sleeves	7	ES&S	PS-S7-936
CF Card Reader	1	SanDisk	018-6305
Magnifier	3	---	---
Blue Security Ballot Storage/Transport Box	2	---	---
Headphone Covers	30	---	---
Paddles (yes/no)	3	---	---

2.5   Vendor Technical Data Package

The Technical Data Package (TDP) contains information about requirements, design, configuration management, quality assurance, and system operations. The EAC 2005 VVSG requirements state that, at a minimum, the TDP shall contain the following documentation: system configuration overview; system functionality description; system hardware specifications; software design and specifications; system test and verification specifications; system security specifications; user/system operation procedures; system maintenance procedures; personnel deployment and training requirements; configuration management plan; quality assurance program; and system change notes.

The documents listed in Table 2-7 comprise the EVS 5.2.0.0 Voting System TDP:

(The remainder of this page intentionally left blank)

2.0 SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.5 Vendor Technical Data Package (Continued)

Table 2-7 EVS 5.2.0.0 Voting System TDP

EVS 5.2.0.0 TDP Documents	Version	Doc No.	Document Code
System Overview			
Voting System Overview	9.0	01-01	EVS5200_C_D_0100_SysOvr
System Functionality Description			
System Functionality Description – Voting System	6.0	02-01	EVS5200_C_D_0200_SFD
System Hardware Specification			
System Hardware Specification – DS200 Hardware Revision 1.2	3.0	03-01	DS200HW_M_SPC_0312_HWSpec
System Hardware Specification – DS200 Hardware Revision 1.3	4.0	03-02	DS200HW_M_SPC_0313_HWSpec
System Hardware Specification – DS850	1.1	03-03	DS850HW_M_SPC_0310_HWSpec
ExpressVote Hardware Specification	3.0	03-04	ExpressVoteHW_M_SPC_0310_HWSpec
AutoMARK System Hardware Overview	3.0	03-05-01	AutoMARK_ESS_System_Hardware_Overview_AQS-18-5002-000-S
AutoMARK System Hardware Specification	3.0	03-05-02	AutoMARK_ESS_System_Hardware_Specification_AQS-18-5000-001-F
Software Design and Specification			
Software Design and Specification – ES&S Event Log Service	1.0	04-01	EVS5200_SDS00_ELS
Software Design and Specification - ElectionWare	2.0	04-02	EVS5200_SDS00_ElectionWare
Software Design and Specification – ERM	2.0	04-03	EVS5200_SDS00_ERM
ES&S Software Design Specifications ERM Appendices	2.0	04-03-01	EVS5200_SDS00_ERM01_Appendices
Software Design and Specification – DS850	2.0	04-04	EVS5200_SDS00_DS850
DS200 Software Design and Specification	4.0	04-05	EVS5200_D_SDS00_DS200
ExpressVote Software Design and Specification	3.0	04-06	EVS5200_D_SDS00_ExpressVote
Software Design and Specification – AutoMARK	1.8	04-07	AutoMARK ESS Software Design Specifications Overview
AutoMARK Operating Software Design Specifications	5.0	04-07-01	AQS-18-5001-002-R
AutoMARK Ballot processing Specifications	3.0	04-07-01	AQS-18-5002-003-S
AutoMARK Software Design Specifications	5.0	04-07-01	AQS-18-5001-004-S
AutoMARK Software Development Environment	5.0	04-07-01	AQS-18-5001-006-R
AutoMARK Graphical User Interface Specifications	6.0	04-07-01	AQS-18-5001-005-R
AutoMARK Software Diagnostics Specifications	5.0	04-07-01	AQS-18-5000-004-F
AutoMARK Embedded Database Interface Specifications	5.0	04-07-01	AQS-18-5002-005-S
AutoMARK Ballot Scanning and Printing Specifications	5.0	04-07-01	AQS-18-5002-007-S
AutoMARK Driver API Specifications	5.0	04-07-01	AQS-18-5000-002-F
AutoMARK Programming Specifications Details	5.0	04-07-01	AQS-18-5001-011-R
AutoMARK ESS Software Standards Specification	5.0	04-07-01	AQS-18-4000-000-S
AutoMARK ESS Operations and Diagnostic Log Specs	5.0	04-07-01	AQS-18-5002-004-S
ES&S System Development Program	2.0	04-08	ESSSYS_SG_P_0400_SystemDevProgram
Coding Standards	3.0	04-09	ESSSYS_D_P_0400_CodingStandards

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.5   Vendor Technical Data Package (Continued)

Table 2-7 EVS 5.2.0.0 Voting System TDP (Continued)

EVS 5.2.0.0 TDP Documents	Version	Doc No.	Document Code
System Test/Verification Specification			
Voting System Test Plan ES&S Voting System 5.2.0.0	2.0	05-01	EVS5200_QA_D_0500_SysTestPlan
CIF Usability Test Reports – ExpressVote	1.0	05-02-01	ExpressVoteHW_P_D_0509_ CIFRptExpressVote
CIF Usability Test Reports – AutoMARK	1.x	05-02-02	AMVATHW_P_D_0510_CIFRptAMVAT
CIF Usability Test Reports – DS200	1.2.1	05-02-03	DS200HW_P_D_0512_CIFRptDS200
System Security Specification			
Voting System Security Specification	4.0	06-01	EVS5200_CM_SPC00_SysSecuritySpec
Hardening Procedures for the Election System	1.2	06-02	EVS5200_CM_SPC01_ HardeningProcedures
Security Script Description	1.1	06-03	EVS5200_CM_SPC02_SecScriptDesc
AutoMARK System Security Specifications	6.0	06-04	AutoMARK ESS System Security Specification AQS-18-5002-001-S
System Operations Procedure			
Network Setup Guide	1.2	07-01	EVS5200_CM_SOP_ NetworkConfigGuide
AutoMARK System Operator's Guide	4.0	07-02	EVS5200_DOC_SOP_AMVAT
DS200 Operator's Guide	6.00	07-03	EVS5200_DOC_SOP_DS200
DS850 Operator's Guide	4.0	07-04	EVS5200_DOC_SOP_DS850
EVS Event Logging Service	3.0	07-05	EVS5200_DOC_SOP_ELS
Election Reporting Manager User's Guide	7.0	07-06	EVS5200_DOC_SOP_ERM
ElectionWare Volume I: Administrator's Guide	4.0	07-07	EVS5200_DOC_SOP_EW01Admin
ElectionWare Volume II: Define User's Guide	5.0	07-08	EVS5200_DOC_SOP_EW02Define
ElectionWare Volume III: Design User's Guide	3.0	07-09	EVS5200_DOC_SOP_EW03Design
ElectionWare Volume IV: Deliver User's Guide	4.0	07-10	EVS5200_DOC_SOP_EW04Deliver
ElectionWare Volume V: Results User's Guide	3.0	07-11	EVS5200_DOC_SOP_EW05Results
ExpressPass Operator's Guide	4.0	07-12	EVS5200_DOC_SOP_ExpressPass
ExpressVote Operator's Guide	4.0	07-13	EVS5200_DOC_SOP_ExpressVote
System Maintenance Manuals			
AutoMARK System Maintenance Manual	2.1	08-01	EVS5200_DOC_SMM_AMVAT
DS200 Maintenance Guide	2.0	08-02	EVS5200_DOC_SMM_DS200
DS850 Maintenance Guide	3.0	08-03	EVS5200_DOC_SMM_DS850
ExpressVote Maintenance Guide	2.3	08-04	EVS5200_DOC_SMM_ExpressVote
Personnel Deployment and Training			
Personnel Deployment and Training Program	3.0	09-01	ESSSYS_T_D_0900_TrainingProgram
Configuration Management Plan			
Configuration Management Plan	2.0	10-1	ESSSYS_CM_P_1000_CMProgram
ES&S Technical Documentation Program	5.0	10-2	ESSSYS_DOC_P_1000_TDProgram

(The remainder of this page intentionally left blank)

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.5   Vendor Technical Data Package (Continued)

Table 2-7 EVS 5.2.0.0 Voting System TDP (Continued)

EVS 5.2.0.0 TDP Documents	Version	Doc No.	Document Code
QA Program			
Manufacturing Quality Assurance Plan	2.0	11-01	ESSSYS_M_P_1100_MNFQuality AssurancePlan
ES&S 1.3 Hardware DS200 Acceptance Checklist	A	11-01-01	1 3 Hardware DS200_AccptChklst_001RevA
DS850 Acceptance checklist	D	11-01-01	850_AccptChklst_revD
DS850 Onsite Acceptance Checklist	B	11-01-01	850_OAccptChklst_revB
Acceptance Checklist AutoMARK Voter Assist Terminal	A	11-01-01	AutoMARK_AccptChklst_001_Rev.A
AutoMARK QC Checklist	A	11-01-01	AutoMARK_QC_Chklst_001Rev.A
ES&S DS200 Acceptance Checklist	D	11-01-01	DS200_AccptChklst_001RevD
ES&S ExpressVote Acceptance Checklist	B	11-01-01	ExpressVote_AccptChcklst_001Rev B
Software Quality Assurance Program	2.0	11-02	ESSSYS_QA_P_1100_SoftwareQuality AssuranceProgram
ES&S Software/Firmware Acceptance	2.0	11-02-01	ESSSYS_QA_L_1100_SoftwareFirmware Acceptance
System Change Notes			
System Change Notes	10.0	12-01	EVS5200_DOC_D_1200_ChangeNotes
Other TDP Documents			
ES&S Ballot Production Guide	2.1	13-01	EVS5200_DOC_SOP_11_BPG

(The remainder of this page intentionally left blank)

2.0 SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.6 Deliverable Materials

The materials listed on Table 2-8 are identified by ES&S to be delivered as part of the EVS 5.2.0.0 Voting System to the end users.

Table 2-8 EVS 5.2.0.0 Voting System Deliverables

Deliverable Material	Version	Description
ExpressVote	Firmware 1.4.0.0; Hardware 1.0	Vote Capture Device
DS200	Firmware 2.12.0.0; Hardware 1.2.1 or 1.2.3 or 1.3	Precinct Ballot Scanner
AutoMARK A100 or A200 or A300	Firmware 1.8.6.0; Hardware 1.0 or 1.1 or 1.3	Voter Assist Terminal
DS850	Firmware 2.10.0.0; Hardware 1.0	Central Ballot Scanner
OKI Printer	B430dn or B431dn	Laser Report Printer
OKI Printer	Microline 420	Dot Matrix Printer
Headphones	Avid FV 60	Stereo Headphones
QR Code Scanner	Motorola Model DS9208	Bar code scanner
ElectionWare	4.6.0.0	EMS
ERM	8.11.0.0	EMS
ES&S Event Log Service	1.5.5.0	EMS
Removable Media Services	1.4.5.0	EMS
VAT Previewer	1.8.6.0	EMS
ExpressVote Previewer	1.4.0.0	EMS
EVS 5.2.0.0 Voting System Overview	9.0	TDP Document
EVS 5.2.0.0 System Functionality Description	6.0	TDP Document
ES&S ElectionWare Volume I: Administrator's Guide	3.0	TDP Document
ES&S ElectionWare Volume II: Define User's Guide	4.0	TDP Document
ES&S ElectionWare Volume III: Design User's Guide	2.0	TDP Document
ES&S ElectionWare Volume IV: Deliver User's Guide	4.0	TDP Document
ES&S ElectionWare Volume V: Results User's Guide	2.0	TDP Document
Election Reporting Manager User's Guide	7.0	TDP Document
ExpressVote Operator's Guide	4.0	TDP Document
DS200 Operator's Guide	6.0	TDP Document
DS850 Operator's Guide	4.0	TDP Document
AutoMARK System Operator's Guide	4.0	TDP Document
EVS 5.2.0.0 Network Setup Guide	1.1	TDP Document
ES&S EVS Event Logging Service User's Guide	3.0	TDP Document
EVS 5.2.0.0 Voting System Security Specification	4.0	TDP Document
EVS 5.2.0.0 Hardening Procedures for the Election System	1.2	TDP Document

3.0   TEST BACKGROUND

NTS Huntsville is an independent testing laboratory for systems and components under harsh environments, including dynamic and climatic extremes as well as the testing of electronic voting systems. NTS Huntsville holds the following accreditations:

- ISO-9001:2000
- NVLAP Accredited ISO 17025:2005
- EAC Accredited VSTL, NIST 150,150-22
- A2LA Accredited (Certification No.'s 845.01, 845.02, and 845.03)
- FCC Approved Contractor Test Site (Part 15, 18)

3.1   General Information

All testing performed as part of this test effort was performed at the NTS Huntsville, AL facility. Qualification/Certification testing was limited to the ES&S EVS 5.2.0.0 Voting System components previously identified in this report.

All hardware used during testing for this test campaign was configured in early voting or election-day setup for voting. Each precinct tabulator was placed on a ballot box and loaded with the proper firmware. The central count components were loaded with the proper firmware. The AutoMARK ADA device and ExpressVote vote capture device were placed on the accessible voting table or within the ES&S ADA booth with peripherals and loaded with the proper firmware. The EVS 5.2.0.0 EMS suite was configured on COTS PCs. All media used during testing was loaded from these PCs. All hardware used to build the applicable software and firmware for this test campaign was configured by NTS Huntsville personnel.

3.2   Certification Testing Scope

To evaluate the system test requirements and the scope of the test campaign, each section of the EAC 2005 VVSG was analyzed to determine the applicable tests. The EAC 2005 VVSG Volume I Sections, along with the strategy for evaluation, are described below:

- **Section 2: Functional Requirements** – The requirements in this section were tested during the FCA and System Integration test utilizing the "NTS Huntsville Baseline Test Cases" along with test cases specially designed for the ES&S EVS 5.2.0.0.

- **Section 3: Usability and Accessibility** –   The requirements in this section were tested during the Usability Test, FCA, and System Integration test utilizing a combination of the "NTS Huntsville Baseline Test Cases" and the "NTS Huntsville Baseline Usability Test Cases."

- **Section 4: Hardware Requirements** – The requirements in this section were tested during the FL EVS 4.5.0.0 test campaign with the exception of Electrical Supply and Maintainability. The FL EVS 4.5.0.0 test campaign tested the ExpressVote and hardware modifications to the DS200. The FL EVS 4.5.0.0 Hardware Test Report Number T71013.01-01 and T71013.01-02 are presented in Appendix C as part of the approved Test Plan and request for reuse during this testing campaign. The requirements in this section were tested by trained NTS Huntsville personnel per sections 4.5 of this report.

- **Section 5: Software Requirements** – The requirements in this section were tested during source code review, TDP review, and FCA. A combination of review and functional testing was performed to ensure these requirements were met.

3.0 TEST BACKGROUND (Continued)

3.2 Certification Testing Scope (Continued)

- **Section 6: Telecommunication** – The requirements in this section were not tested during this test campaign.

- **Section 7: Security Requirements** – The requirements in this section were tested during source code review, FCA, System Integration, and Security Tests.

- **Section 8: Quality Assurance (QA) Requirements** – The QA requirements were spot checked and limited to only the changes included within this modification. The following documents were utilized during the limited review process:
  - ○ ESSSYS_M_P_1100_MNFQualityAssurancePlan
  - ○ ESSSYS_QA_P_1100_SoftwareQualityAssurance Program

- **Section 9: Configuration Management (CM) Requirements** – The CM requirements were spot checked and limited to only the changes included within this modification. The following documents were utilized during the limited review process:
  - ○ ESSSYS_CM_P_1000_CMProgram
  - ○ ESSSYS_DOC_P_1000_TDPProgram

The ES&S EVS 5.2.0.0 Voting System is a paper based precinct counting system. Therefore, all EAC 2005 VVSG requirements intended for DRE were excluded from this test campaign, as well as the following:

- Volume I Section 6 (Telecommunication Requirements)

- Volume I Section 7.5.2-7.5.4 (Telecommunications and Data Transmission)

- Volume I Section 7.6 (Use of Public Communication Networks)

- Volume I Section 7.7 (Wireless Communications)

- Volume I Section 7.9 (Voter Verifiable Paper Audit Trail Requirements)

The rationale for not evaluating the EVS 5.2.0.0 Voting System to the requirements contained in the indicated sections of the EAC 2005 VVSG is described in Table 3-1.

(The remainder of this page intentionally left blank)

3.0   TEST BACKGROUND (Continued)

3.2   Certification Testing Scope (Continued)

Table 3-1 Not Applicable Requirements

EAC 2005 VVSG Volume I Section	Rationale for 'Not Applicable'
6, 7.5.2-7.5.4	These requirements are written for use on public networks. The ES&S EVS 5.2.0.0 Voting System does not use public networks.
7.6	This section pertains to "Voting systems that transmit data over public telecommunications…" The ES&S EVS 5.2.0.0 Voting System as configured for this certification does not permit transmission over public networks.
7.7	No wireless technology is present in ES&S EVS 5.2.0.0 Voting System.
7.9	The ES&S EVS 5.2.0.0 Voting System is a paper based system.

3.3   Quality Assurance

All work performed on this test program was completed in accordance with NTS' Quality Program.

The NTS, Huntsville Facility, Quality Management System is registered in compliance with the ISO-9001:2008 International Quality Standard. Registration has been completed by SAI Global, a Division of Canadian Standards Association (CSA).

3.4   Test Equipment and Instrumentation

All instrumentation, measuring, and test equipment used in the performance of this test program was calibrated in accordance with NTS Huntsville Quality Assurance Program, which complies with the requirements of ANSI/NCSL 2540-1, ISO 10012-1, and ISO/IEC 17025. Standards used in performing all calibrations are traceable to the National Institute of Standards and Technology (NIST) by report number and date. When no national standards exist, the standards are traceable to international standards, or the basis for calibration is otherwise documented.

(The remainder of this page intentionally left blank)

3.0   TEST BACKGROUND (Continued)

3.5   Terms and Abbreviations

This subsection defines all terms and abbreviations applicable to the development of the Test Report.

Table 3-2 Terms and Abbreviations

Term	Abbreviation	Definition
Americans with Disabilities Act of 1990	ADA	ADA is a wide-ranging civil rights law that prohibits, under certain circumstances, discrimination based on disability.
Configuration Management	CM	---
Commercial Off the Shelf	COTS	Commercial, readily available hardware or Software.
United States Election Assistance Commission	EAC	Commission created per the Help America Vote Act of 2002, assigned the responsibility for setting voting system standards and providing for the voluntary testing and certification of voting systems.
ES&S Event Logging Service	ELS	---
Election Management System	EMS	Within the EVS 5.2.0.0 Voting System, the EMS is comprised of seven components: ElectionWare, ERM, ES&S Event Logging Service, ExpressVote Previewer, RMS, and VAT Previewer.
Election Reporting Manager	ERM	EVS EMS reporting component.
Election Systems and Software	ES&S	---
Equipment Under Test	EUT	Refers to the individual system component or multiple piece of the same component.
ES&S Voting System	EVS	---
Functional Configuration Audit	FCA	Verification of system functions and combination of functions cited in the manufacturer's documentation.
Help America Vote Act	HAVA	Act created by United States Congress in 2002.
Intelligent Mark Recognition	IMR	Visible light scanning technology to detect completed ballot targets.
Physical Configuration Audit	PCA	Review by accredited test laboratory to compare voting system components submitted for certification testing to the manufacturer's technical documentation, and confirmation the documentation meets national certification requirements.
Quality Assurance	QA	--
Regression Testing	---	The process of examining and testing to verify that all functional and firmware modifications made during the test campaign did not introduce new errors or non-conformities into the voting system.
Removable Media Service	RMS	Application that runs in the background of the EMS client workstation.

3.2 TEST BACKGROUND (Continued)

3.5 Terms and Abbreviations (Continued)

Table 3-2 Terms and Abbreviations (Continued)

Term	Abbreviation	Definition
System Under Test	SUT	Refers to the system as a whole (all components).
Secure File Transfer Protocol	SFTP	A network protocol that provides file access, files transfer, and file management functionality over any reliable data stream.
Technical Data Package	TDP	Manufacturer documentation related to the voting system required to be submitted as a precondition of certification testing.
Trusted Build	---	Final build of source code performed by a trusted source and overseen by the manufacturer which is delivered to the EAC designated repository; also referred to as a "Witness Build".
Uninterruptible Power Supply	UPS	---
Voter Assist Terminal	VAT	The electronic ballot marking device component is the ES&S AutoMARK.
Voluntary Voting System Guidelines	EAC 2005 VVSG	Published by the EAC, the third iteration of national level voting system standards.
National Technical Systems	NTS	---
Operating Procedure	OP	Test Method or Test Procedure.
Voting System Test Laboratory	VSTL	NTS Huntsville.
Voluntary Voting System Guidelines	VVSG	EAC Voluntary Voting System Guidelines Version 1.0.
Quick Response Code	QR Code	Two-dimensional barcode

(The remainder of this page intentionally left blank)

4.0   TEST FINDINGS AND RECOMMENDATIONS

The ES&S EVS 5.2.0.0 Voting System, as identified in Section 2 of this report, was subjected to the tests summarized in the following paragraphs.

4.1   Source Code Review

As part of testing activities, the ES&S EVS 5.2.0.0 Voting System received a 100% manual review on all modified source code not written in Java for the EMS, DS200, AutoMARK, DS850, and ExpressVote. The source code was reviewed to the EAC 2005 VVSG coding standards and the manufacturer supplied coding standards. The manufacturer supplied coding standards (ESSSYS_D_P_0400_Coding Standards) can be found within the vendor provided TDP. The review was conducted per the guideline described in the following paragraph.

As the updated source code was received, a SHA256 hash value was created for each source code file. The source code team conducted a visual scan of every line of modified source code not written in Java. The source code team then conducted automated source code reviews using Eclipse and Checkstyle on the ElectionWare portion of source code written in Java. In addition to the automated source code review, NTS also performed a 10% manual review of the headers and quality of comments. This was done to identify any violation of EAC 2005 VVSG coding standards or manufacturer supplied coding standards. The COTS tools utilized by the source code group were Beyond Compare and Crimson Editor. Each identified violation was then recorded by making notes of the standards violation along with directory name, file name, and line number.

Summary Findings

Other than the coding standards noted in the technical summary reports, no other deficiencies or significant problems were found during the source code review. A technical summary report of all identified standards violations was sent to ES&S for resolution. ES&S then corrected all standards violations and re-submitted the source code for re-review. Notice of Anomaly (NOA) No. 4, documenting these discrepancies, is found in Appendix F of this report. During the source code review a total of 69 discrepancies were notated. Tables 4-1 and 4-2 below provide the discrepancies and count identified during the entire review process:

Table 4-1 Source Code Discrepancies by type

Units Called	26
Header Return	2
Non Enumerated Constant	6
Header File References	1
Over 6 Levels Of Indenting	2
Line Too Long	3
Header or File Missing	5
Header Revision History	10
In-Line Comments	1
Header Return	2
Header Inputs and Outputs	4
Header Parameter	2
Object/Datatype/Variable Comment	5
Total:	69

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.1 Source Code Review (Continued)

Table 4-2 Source Code Review Breakdown

Source Code Component and Utilities	*Number of Reviews	*Number of Discrepancies
ElectionWare	5	0
ERM	2	1
Event Log Service	1	0
ExpressVote	5	48
Removable Media Service	1	0
DS200	4	14
AutoMARK	4	2
DS850	5	4
ExpressPass Application**	3	0

*The number of reviews includes both initial submissions and subsequent reviews which may include clean versions of code where no discrepancies were identified.
**ExpressPass Application software is not in the scope of certification, but NTS reviewed the source code for 2005 VVSG compliance.

4.2 Trusted Build

A Trusted Build of the software was created using ES&S trusted build documents. The Trusted Build was performed by completing the following tasks in the order listed:

- Clear hard drive of existing data
- Retrieve the compliant source code
- Retrieve the installation media for OS, compilers, and build software
- Construct the build environment
- Create disk image of the build environment
- Load the compliant source code into the build environment
- Create a disk image of the pre-build environment
- Create a digital signature of the pre build environment
- Build executable code
- Create a disk image of the post-build environment
- Create a digital signature of executable code
- Build installation media
- Create a digital signature of the installation media
- Install executable code onto the system and validate the software/firmware
- Deliver source code with digital signature, disk image of pre-build environment with digital signatures, disk image of post-build environment with digital signatures, executable code with digital signatures, and installation media to the EAC Repository.

(The remainder of this page intentionally left blank)

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.2 Trusted Build (Continued)

The Trusted Build for the ES&S EVS 5.2.0.0 includes source code, data, and script files, in clear text form. The build also includes COTS software on commercially available media, COTS software downloaded by the VSTL, COTS software verified by SHA256 from the software supplier, and picture and sound files in binary format provided by ES&S. The first step of the process was to clean the hard drives by writing data to every spot on the hard drive, so the drive is cleared of existing data. Microsoft Windows 7 Professional operating systems were then loaded and the applications from the VSTL reviewed source along with the VSTL verified COTS software was built. The final step was installing the applications on the hardware.

Summary Findings

NTS Huntsville performed a Trusted Build for each software component of the ES&S EVS 5.2.0.0 on April 14-16, 2014. ES&S Technical Representative for the Trusted Build was Dave Herrera. The products from the Trusted Build shall be supplied to the EAC as part of the certification effort.

4.3 Technical Data Package Review

The ES&S EVS 5.2.0.0 Technical Data Package (TDP) was reviewed to the 2005 VVSG. This review was performed as part of the testing activities. The TDP review included only the documents that support the scope of certification for this testing campaign.

The TDP contains information about requirements, design, configuration management, quality assurance, and system operations. The EAC requirements state that, at a minimum, the TDP shall contain the following documentation: system configuration overview; system functionality description; system hardware specifications; software design and specifications; system test and verification specifications; system security specifications; user/system operations procedures; system maintenance procedures; personnel deployment and training requirements; configuration management plan; quality assurance program; and system change notes.

The TDP documents were reviewed for accuracy, completeness, and compliance to the VVSG. The TDP documentation served as the basis for design and development of the functional tests.

(The remainder of this page intentionally left blank)

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.3   Technical Data Package Review (Continued)

Summary Findings

The review results were recorded in a worksheet that provided the pass/fail compliance to each applicable VVSG requirement. There were 47 discrepancies reported to ES&S and internally tracked by NTS Huntsville as test exceptions until verified that the applicable documents had been corrected. ES&S corrected nonconformance observations and resubmitted the associated documents for review. This process continued until the TDP complied with the applicable TDP standards in the EAC 2005 VVSG.

A summary of the TDP issues encountered is provided below:

- Some descriptive information included was inconsistent with descriptions in other TDP documents.

- Some documents included functionality that was not supported in the voting system.

- Some of the individual user guides included information which conflicted with the actual information encountered when verified during the testing process.

All noted TDP issues were resolved prior to the conclusion of the review process. The Technical Data Package Review Report that summarizes the 47 discrepancies noted is included in Appendix E of this report. The Notice of Anomaly (NOA) No.3 documenting that TDP discrepancies were found is included in Appendix F of this report.

(The remainder of this page intentionally left blank)

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4 Hardware Testing

EVS 5.2.0.0 is comprised of four proprietary pieces of hardware; DS200, AutoMARK, DS850, and ExpressVote. There were no hardware changes to the AutoMARK or DS850, so these components were excluded from hardware testing during this campaign. The DS200 hardware versions 1.2.3, 1.3 and the ExpressVote were incorporated into the EVS system during this campaign. NTS Huntsville performed hardware testing on the DS200 1.3 version and the ExpressVote as part of the FL EVS 4.5.0.0 campaign and the accepted tests are listed in table 4-3. NTS Huntsville performed Electrical Supply and Maintainability hardware testing on the DS200 version 1.3 and ExpressVote during the EVS 5.2.0.0 test campaign. NTS Huntsville also performed Acoustic testing on the ExpressVote as part of the EVS 5.2.0.0 campaign. NTS Huntsville determined the EMS computers that consist of COTS PCs and laptops are not subject to hardware testing per the EAC 2005 VVSG. The provided PCs and laptops documented in Section 2 Materials Required For Testing all contained CE, UL, and FCC labeling.

Table 4-3 Hardware Test Examination Results

Test/EAC 2005 VVSG Section	Procedure/Description	EVS 5.2.0.0 DS200 HW 1.3 & ExpressVote HW 1.0
Electromagnetic Radiation/4.1.2.9	FCC Part 15 Class B for both radiated and conducted emissions	Accept FL EVS 4.5.0.0
Low Temperature/4.1.2.14	MIL-STD-810D minimum temperature shall be -4°F	Accept FL EVS 4.5.0.0
Vibration/4.1.2.14	MIL-STD-810D, Method 514.3 physical shock and vibration during handling and transport	Accept FL EVS 4.5.0.0
Lightning Surge/4.1.2.7	IEC 61000-4-5 (1995-02)	Accept FL EVS 4.5.0.0
High Temperature/4.1.2.14	MIL-STD-810D, Method 501.2 maximum temperature shall be 140°F	Accept FL EVS 4.5.0.0
Bench Handling	MIL-STD-810D, Method 516.3 Procedure VI six 4" drops on each edge totaling 24 drops	Accept FL EVS 4.5.0.0
Electrical Fast Transient/4.1.2.6	IEC 61000-4-4 (2004)	Accept FL EVS 4.5.0.0
Humidity Test/4.1.2.14	MIL-STD-810D, Method 501.2 ten 24 hour humidity cycles	Accept FL EVS 4.5.0.0
Electrostatic Disruption/4.1.2.8	IEC 61000-4-2 (1995-01) 15kV air discharge and 8kV contact discharge	Accept FL EVS 4.5.0.0
Electromagnetic Susceptibility/4.1.2.10	IEC 61000-4-3 (2006) electromagnetic field of 10V/m modulated by a 1kHZ, 80% AM modulation at 80MHz to 1000MHz frequency	Accept FL EVS 4.5.0.0
Conducted RF Immunity/4.1.2.11	IEC 61000-4-6 (1996-04) conducted radio frequency energy	Accept FL EVS 4.5.0.0
Magnetic Fields Immunity/4.1.2.12	IEC 61000-4-8 (1993-06) AC magnetic fields of 30 A/m at 60Hz	Accept FL EVS 4.5.0.0
Electrical Power Disturbance/4.1.2.5	IEC 61000-4-11 (1994-06) power surges and dips	Accept FL EVS 4.5.0.0
Temperature/Power Variation/4.1.2.13	MIL-STD-810D, Method 502.2 and Method 501.2 163 hours at 50°F to 95°F	Accept FL EVS 4.5.0.0
Safety/4.3.8	UL 60950-1 product safety review	Accept FL EVS 4.5.0.0

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4.1 Acoustic Noise Level Test

The ExpressVote was subjected to an Acoustic Noise Level Test to satisfy the following requirements of Sections 3.17.1 and 3.2.2.2 (c) of Volume I of the 2005 VVSG:

Summary Findings

During the Acoustic Noise Level Test, there was one discrepancy recorded. Refer to Notice of Anomaly (NOA) No. 2 presented in Appendix F for further details. The test was repeated and the ExpressVote successfully met the requirements of the Acoustic Noise Level Test.

4.4.2 Electrical Supply Testing

Electrical Supply Testing was performed in accordance with Section 4.1.2.4 of Volume I of the VVSG. The test was performed to ensure the DS200 hardware version 1.3 and ExpressVote continue to allow for any voter voting at the time of a failure of the main power supply, which is external to the voting system, to complete the casting of a ballot. Additionally, it is required that the voting system perform a successful shutdown without loss or degradation of the voting and audit data, and allow voters to resume voting once the voting system has reverted to back-up power.

To perform the test, the EUT was configured as for normal operation. The EUT was then operated as designed for fifteen minutes prior to the removal of the AC input power. Once AC power was interrupted, the DS200 and ExpressVote were continuously operated for a minimum period of two hours until backup power was exhausted. Following the exhaustion of backup power, the AC power was restored and the system was operated for an additional fifteen minutes.

Summary Findings

The DS200 hardware version 1.3 and the ExpressVote successfully completed the requirements of the Electrical Supply Test.

4.4.3 Maintainability

Maintainability Testing was performed in accordance with Section 4.7.2 of Volume II of the VVSG. This test was performed to evaluate the ease with which preventive and corrective maintenance actions can be performed. This test factored in design characteristics of equipment; software; processes the vendor and election officials have in place for preventing failures; and procedures for addressing failures. It includes the ability of equipment and software to self-diagnose problems and make non-technical election workers aware of a problem and addresses all scheduled and unscheduled events which are performed to determine operational status and make component adjustments or repairs.

The DS200 hardware version 1.3 and ExpressVote were evaluated with the appropriate vendor documentation, and maintainability was determined based on the presence of specific physical attributes that aid system maintenance activities, and the ease with which system maintenance tasks were able to be performed.

Summary Findings

The DS200 hardware version 1.3 and the ExpressVote successfully completed the requirements of the Maintainability Test.

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5 System Level Testing

The ES&S stated system limits for EVS 5200; the tested limit values; and the tests performed to verify each limit are compiled in Table 4-4.

System Level Testing was performed to evaluate the integrated operation of the voting system hardware and software. The suite of tests that comprise the System level Testing includes: Volume and Stress Test, System Integration Test, Security Test, Usability and Accessibility Tests, Data Accuracy, as well as the Physical and Functional Configuration Audits.

Table 4-4 EVS 5.2.0.0 System Limits

Limit (Maximum Number of)	Declared Value	Tested Value	Test Performed
Precincts in Election	9,900	9,900	Volume and Stress
Candidates/Counters in Election	21,000	21,000	Volume and Stress
Candidates/Counters in Precinct	1,000	1,000	Volume and Stress
Candidates/Counters in Tabulator	65,535	65,535	Volume and Stress
Maximum Precinct Element	500,000	500,000	Volume and Stress
Ballot Styles in Election	9,900	9,900	Volume and Stress
Contests in a Ballot Style	200	200	Volume and Stress
Candidates in a Contests	175	175	Volume and Stress
Ballot Styles in a Precinct	40	40	Volume and Stress
Number of Parties	Gen-=75, Prim=20	Gen=75, Prim=20	Volume and Stress
Vote For in Contest	98	98	Volume and Stress
Supported Languages per Election	5*	Verified Possible	System Integration (3)

* "Verified Possible" means that the limit was tested during the FCA, but could not be verified in an election environment because of dependencies in the ballot layout configuration. The stated limits in the "Test Performed" column were tested in an election environment.

(The remainder of this page intentionally left blank)

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   System Level Testing (Continued)

4.5.1   Volume and Stress Test

The EVS 5.2.0.0 Voting System was subjected to a Volume and Stress Test in accordance with the requirements of Section 6.2.3 of Volume II of the VVSG. The purpose of the test was to investigate the system's response to conditions that tend to overload the system's capacity to process, store, and report data. The Volume Test parameters were dependent upon the maximum number of active voting positions and the maximum number of ballot styles that the TDP claims the system can support. Testing was performed by exercising election definitions developed specifically to test for volume and stress (Election Definitions: Elections A, C, D, and E contained in Table 4-5 of this document). Elections B and F were excluded from this campaign based on no changes within the ERM limits from the previously certified EVS 5.0.0.0 system. All ExpressVote cards were cast and tabulated utilizing the DS200. All totals were verified within ERM against the expected results matrix to verify accuracy and the system's ability to handle the TDP stated limits.

Table 4-5 EVS 5.2.0.0 Volume and Stress

Voting Pattern	"Test Decks" were created for each election definition: **Election A**: **Limits Tested:** 　　　■　Maximum Precincts in an election (9900)* 　　　■　Maximum Ballot Styles in an Election (9900)* 　❑　**ExpressVote Test Deck: Marked 99 cards *** 　　　■　Voted each contest on card 　❑　**ExpressVote: Marked first candidate in each contest on a card** *All 9900 ballot styles were loaded on the ExpressVote and the DS200. 99 out of the 9900 ballot styles were selected and printed by the ExpressVote. The DS200 was then used to cast the 99 cards. **Election C:** **Limits Tested:** 　　　■　Maximum candidate counters/election (21,000) 　　　■　Maximum candidates/contest (175) 　　　■　Maximum "Vote for"/contest (98) 　　　■　Maximum number of parties in a General Election **(75)** 　❑　**ExpressVote Test Deck: Marked 15 randomly selected cards**

(The remainder of this page intentionally left blank)

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   System Level Testing (Continued)

4.5.1   Volume and Stress Test (Continued)

Table 4-5 EVS 5.2.0.0 Volume and Stress (Continued)

Voting Pattern	**Election D:**
	
	Limits Tested:
	    ▪ Maximum number of parties in a Primary Election (20 including nonpartisan party)
	  ❑ **ExpressVote Test Deck: 20 cards**
	    ▪ Each candidate was marked
	Election E:
	
	Limits Tested:
	    ▪ Maximum district types (20)
	    ▪ Maximum district names (40)
	  ❑ **ExpressVote Test Deck: 8 cards**
	    ▪ Each candidate was marked

Table 4-6 EVS 5.2.0.0 Volume and Stress Cards Cast

EUT	Election A	Election C	Election D	Election E	Total Cards Cast
DS200	99	15	20	8	142
ExpressVote	99	15	20	8	142

Summary Findings

At the conclusion of the Volume and Stress Test, the DS200 and ExpressVote units successfully exercised the stated system limits. There was one (1) of each DS200 and ExpressVote used for the duration of Volume and Stress performance. A total of 142 ballots were processed without issue upon the completion of the test.

4.5.2   System Integration Test

System Integration Testing was performed to test all system hardware, software, and peripherals. System Integration Testing focused on the complete system including all proprietary software, proprietary hardware, proprietary peripherals, COTS software, COTS hardware, and COTS peripherals configured as described in the ES&S-submitted TDP for the EVS 5.2.0.0 Voting System. To perform the System Integration Testing, NTS Huntsville developed specific procedures and test cases designed to test the system as a whole. These procedures demonstrated compliance of the EVS 5.2.0.0 Voting System to Sections 2, 3, 4, 5, and 6 of Volume I of the VVSG.

(The remainder of this page intentionally left blank)

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   System Level Testing (Continued)

4.5.2   System Integration Test (Continued)

In order to further verify compatibility between the system in scope, ballots were presented across the system and all results verified against the expected results matrix. The created test deck for system integration included hand marked ballots, folded ballots, AutoMARK generated ballots, and ExpressVote generated ballots. The generated test deck was then utilized for system integration testing on the DS200 and DS850 with all expected results verified within ERM.

The six election definitions exercised during the System Integration Testing are listed below:

- GEN-01

- GEN-02

- GEN-03

- PRIM-01

- PRIM-02

- PRIM-03

Summary Findings

Through System Integration Testing, it was demonstrated that the system performed as documented with all components performing their intended functions. No anomalies were noted during testing.

4.5.3   Security

EVS 5.2.0.0 was subjected to Security Testing in accordance with the requirements of Section 7.0 of Volume I and Section 6.4 of Volume II of the EAC 2005 VVSG. The purpose of the Security Test was to verify that the modifications included in the EVS 5.2.0.0 system including the introduction of the DS200 Hardware Version 1.3 and the ExpressVote did not compromise the security of the system. The focus of security testing was on the DS200 Hardware Version 1.3 and the ExpressVote with the remaining components being unmodified from the previously certified versions. Based on the limited modifications to the remainder of the system, all previous security testing for these components were reused and accepted for the current test campaign.

The ES&S TDP was utilized during this portion of testing to ensure the proper placement was identified within the documentation and the placement ensured the security of the component. The DS200 Hardware Version 1.3 underwent physical security testing in which all tie straps, seals, and locks were tested and verified. The ExpressVote underwent a full security test suite to provide verification of the access controls and the physical controls documented by ES&S.

Summary Findings:

NTS Huntsville reviewed the ES&S TDP security documentation and the provided Threat Matrix. An analysis was performed on the ExpressVote configured as documented by ES&S. Attempts were made to access certain functions of the ExpressVote by users that did not have permissions to access those functions. Those attempts were unsuccessful. The ExpressVote and DS200 security tie straps, tamper evident seals, locks, and their documented installation were analyzed and found to be adequate. NTS Huntsville has determined the EVS 5.2.0.0 Voting System to be compliant with the security requirements of the EAC 2005 VVSG.

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   System Level Testing (Continued)

4.5.4   Usability and Accessibility Test

The EVS 5.2.0.0 Voting System was subjected to Usability and Accessibility Tests in accordance with Volume I, Section 3 of the EAC 2005 VVSG. The purpose of this testing was to assess the DS200 Hardware Version 1.3 and the ExpressVote conformance to the usability and accessibility requirements in the EAC 2005 VVSG.

All efforts should be made by the voting system to enable a quality interaction between the voter and voting system with a comfortable and efficient process providing confidence their votes are cast correctly. Additional requirements for task performance are independence and privacy: the voter should normally be able to complete the voting task without assistance from others and the voter selections should be private.

The Usability and Accessibility requirements set forth by the VVSG and the Help America Vote Act (HAVA) ensure that all eligible voters are provided the ability to vote without discrimination regardless of any disabilities. As stated in the VVSG, to meet the requirements of the Usability and Accessibility Test, the voting system shall: conform to the specified usability requirements of Volume I, Section 3.1; provide the capabilities required by Volume I, Section 3.2; and operate consistently with vendor specifications and documentation.

The requirements for physical, sensory, or cognitive disabilities shall be followed according to HAVA (a) (3) (B). Alternative languages shall be in accordance to HAVA (a) (4) and privacy mandated by HAVA (a) (1) (C). In addition, Common Industry Format (CIF) shall be used for testing purposes according to ANSI/INCITS 354-2001 and in accordance with the VVSG. To help meet this requirement, ES&S submitted a summative usability test report for the ExpressVote to NTS for review and is included in Appendix K of this report.

Summary Findings

During the Usability and Accessibility Test, there was one discrepancy recorded for the ExpressVote. Refer to Notice of Anomaly (NOA) No. 1 presented in Appendix F for further details. The test was repeated and the ExpressVote successfully met the requirements of the Usability and Accessibility Test. The DS200 Hardware Version 1.3 successfully met the requirements of the Usability and Accessibility Test.

4.5.5   Data Accuracy Test

Per the VVSG Vol. II Section 4.7.1.1, "As indicated in Volume I, Section 4, data accuracy is defined in terms of ballot position error rate." This rate applies to the voting functions and supporting equipment that capture, record, store, consolidate, and report the selections (or absence thereof) made by the voter for each ballot position. To meet the requirements of this test, the voting system must be subjected to the casting of a large number of ballots to verify vote recording accuracy, i.e. at least 1,549,703 ballot positions correctly read and recorded. An accuracy test was performed on the ExpressVote based on the new component being introduced into the system and NTS Huntsville determined the DS200 (versions 1.2, 1.2.3, 1.3) also required an accuracy test based on the hardware and software changes made to each of the components. Based on the evaluation of the software changes to the AutoMARK and DS850 NTS Huntsville determined these components were excluded from the accuracy test, however the DS850 was utilized for tabulation of the ExpressVote cards that were printed during the ExpressVote accuracy test. The tables below summarize the accuracy test breakdown for the DS200 and the ExpressVote.

Tables 4-7 and 4-8 show the breakdown of the ballots processed during the Accuracy Test.

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   System Level Testing (Continued)

4.5.5   Data Accuracy Test (Continued)

Table 4-7 EVS 5.2.0.0 Accuracy DS200

Ballot Size	No. of Ballots	No. Vendor Marked	No. Hand Marked	No. Ballot Positions per Ballot	No. of Machines in Test	X Voted=	Total Ballot Positions	Total Ballots
11 inch	100	30	70	392	3	2	235,200	600
14 inch	100	30	70	512	3	2	307,200	600
17 inch	100	30	70	640	3	2	384,000	600
19 inch	100	30	70	720	3	3	648,000	900
Total	**400**	**120**	**280**	**N/A**	**N/A**	**9**	**1,574,400**	**2700**

Table 4-8 EVS 5.2.0.0 Accuracy ExpressVote

Ballot Size	No. of Cards	No. of ExpressPass cards with activation bar codes per unit	No. of blank ExpressVote cards per unit	No. Ballot Positions per Ballot	No. of Machines in Test	Total Ballot Positions	Total Cards
11 inch	100	10	90	800	5	400,000	500
14 inch	100	10	90	800	5	400,000	500
17 inch	95	10	85	800	5	380,000	475
19 inch	95	10	85	800	5	380,000	475
Total	**390**	**40**	350	**N/A**	**N/A**	**1,560,000**	**1950**

Summary Findings

The EVS 5.2.0.0 Voting System successfully met the requirements of the Data Accuracy Test by scanning and processing at least 1,549,703 ballot positions.

(The remainder of this page intentionally left blank)

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   System Level Testing (Continued)

4.5.6   Physical Configuration Audit

A Physical Configuration Audit (PCA) of the EVS 5.2.0.0 Voting System was performed as part of the testing activities in accordance with Section 6.6 of Volume II of the VVSG. The PCA compares the voting system components submitted for certification with the vendor's technical documentation and confirms that the documentation submitted meets the requirements of the Guidelines. The PCA included the following activities:

- Establishing a configuration baseline of software and hardware to be tested; confirm whether manufacturer's documentation is sufficient for the user to install, validate, operate, and maintain the voting system;

- Verifying software conforms to the manufacturer's specifications; inspect all records of manufacturer's release control system; if changes have been made to the baseline version, verify manufacturer's engineering and test data are for the software version submitted for certification;

- Reviewing drawings, specifications, technical data, and test data associated with system hardware, and to establish system baseline;

- Reviewing manufacturer's documents of user acceptance test procedures and data against system's functional specifications; resolve any discrepancy or inadequacy in manufacturer's plan or data prior to beginning system integration functional and performance tests;

- Subsequent changes to baseline software configuration made during testing, as well as system hardware changes that may produce a change in software operation are subject to re-examination.

The PCA performed on the EVS 5.2.0.0 Voting System consisted of inspecting the following:

- The EVS Election Management System (EMS) software platform

- ExpressVote Universal Vote Capture Device

- DS200 Precinct Digital Scanner

- AutoMARK ADA Ballot Marking Device

- DS850 Digital Scan Central Ballot Scanner

- All accessories, equipment, and documentation used with the EVS 5.2.0.0 Voting System

Summary Findings

A PCA was performed to baseline the system's hardware and software components that were used during the test campaign. No discrepancies were noted during the PCA.

(The remainder of this page intentionally left blank)

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   System Level Testing (Continued)

4.5.7   Functional Configuration Audit (FCA)

The Functional Configuration Audit encompassed an examination of manufacturer's testing, and additional testing by the VSTL, to verify that the system hardware and software under scope for the test campaign performed all functions described in the manufacturer's documentation submitted as part of the TDP. In addition to functioning according to the manufacturer's documentation, tests were conducted to ensure the system hardware and software met all applicable EAC 2005 VVSG requirements. The FCA for the EVS 5.2.0.0 campaign included the EMS, ExpressVote, DS200, AutoMARK, and DS850.

A Functional Configuration Audit of the ES&S EVS 5.2.0.0 was performed in accordance with Section 6.7 of Volume II of the VVSG. The purpose of the FCA was to verify that the EVS 5.2.0.0 system under scope performed as documented in the ES&S-supplied technical documentation during pre-voting, voting, and post-voting activities and validated that the EVS 5.2.0.0 meets the requirements of the EAC 2005 VVSG. To perform the FCA, the EVS 5.2.0.0 was subjected to a series of tests to simulate pre-voting, voting, and post-voting activities. These tests were performed to ensure compatibility of voting machine functions using the referenced firmware. During the FCA, both normal and abnormal data was input into the system to attempt to introduce errors and test for error recovery. The activities simulated were:

- Verification of hardware status via diagnostic reports prior to election;

- Performing procedures required to prepare hardware for election operations;

- Obtaining 'zero' machine report printouts on all contest fields;

- Performing procedures to open the polling place and enable ballot counting;

- Casting of ballots to demonstrate proper processing, error handling, and generation of audit data;

- Performing hardware operations required to disable ballot counting and closing the polls;

- Obtaining machine reports and verifying correctness

- Obtaining machine-generated audit logs and verifying correctness

The FCA was divided into three phases: pre-voting, voting, and post-voting. The three phases are described in greater detail in the following paragraphs:

1.   Pre-Voting

Pre-Voting encompasses all activities performed to the point of loading the election data on a transport media. These activities include verifying roles, user administration, database administration, defining the political subdivisions, defining election types, defining voting variations, defining the ballot contents, audio ballot definition, election definition loading, auditing election creation process, producing pre-election reports, adding to existing elections, updating existing elections, modifying ballot styles, verifying alternative language translations, and loading an election on precinct count devices.

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   System Level Testing (Continued)

4.5.7   Functional Configuration Audit (FCA) (Continued)

2.   Voting

Voting encompasses all activities performed by poll workers, voters, and warehouse maintenance technicians after an election has been loaded. These activities include pre-election logic testing, diagnostic tests, opening the polls, activating ballots, voting and casting both normal and audio ballots, utilizing the usability and accessibility aspects of the accessible voting station, closing the polls, printing machine reports, performing post-election maintenance tasks, and executing special voting sessions such as the processing of absentee and provisional ballots.

3.   Post-Voting

Post-Voting encompasses all activities performed after the polls have closed. These activities include verifying election results, tabulation of results, consolidating voted data, Election Media maintenance & cleaning, Election Media logs, concluding an election, backing up results, retaining election data for 22 months, deleting elections, and auditing voting machine log.

Summary Findings

A Functional Configuration Audit was performed on the EMS, DS200, ExpressVote, AutoMARK, and DS850 to ensure it functions and operates as described with the system's technical documentation. A total of seven discrepancies were documented during the FCA. All discrepancies notated during the FCA are included within Notice of Anomaly No.5, Rev A and further detail is located within Appendix F of this report. All discrepancies noted were corrected and retested to validate the fix prior to the conclusion of the test campaign.

(The remainder of this page intentionally left blank)

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5 System Level Testing (Continued)

4.5.8 Availability

The voting system achieved at least 99 percent availability during normal operation for the applicable functions of the system.

4.6 Anomalies and Resolutions

A total of five Notices of Anomaly were issued throughout the test campaign upon occurrence of a verified failure, an unexpected test result, or any unsatisfactory condition. All anomalies encountered during testing were successfully resolved prior to test completion. The Notices of Anomaly generated are presented in their entirety in Appendix F of this report and are summarized below, along with their resolution.

Notice of Anomaly (NOA) No. 1: Usability and Accessibility Test:

The horizontal distance between the centers of the keys on the touchscreen keyboard on the ExpressVote was less than 0.8 inches.

Resolution to Anomaly No. 1:

ES&S acknowledged the anomaly and resolved the issue in a subsequent version of the firmware. The distance between the keys was re-tested and found to be compliant.

Notice of Anomaly No. 2: Acoustic Noise Level Test: The ExpressVote would not allow the voter to decrease the volume at the beginning of each voting session.

Resolution to Anomaly No. 2:

ES&S acknowledged the anomaly and resolved the issue in a subsequent version of the firmware. The Acoustic Test was repeated and the volume levels were complaint.

Notice of Anomaly No. 3: Technical Data Package (TDP) Review

Review of the submitted documentation revealed discrepancies between the TDP and the EAC 2005 VVSG requirements. Functional testing also identified text in the TDP that conflicted with the actual operation of the system. Each noted discrepancy was documented in detail in the NTS Huntsville-generated TDP review reports on file as raw data. The review results were recorded in a worksheet that provided the pass/fail compliance to each applicable EAC 2005 VVSG requirement.

Resolution to Anomaly No. 3:

The EVS 5.2.0.0 Voting System is a modification of a previously certified system. As such, the TDP was only reviewed where modified or where impacted by system modification. ES&S corrected each nonconformance observation and resubmitted the associated documents for review. This process continued until the TDP complied with all applicable requirements.

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.6   Anomalies and Resolutions (Continued)

Notice of Anomaly No. 4: Source Code Review

Review of the submitted source code modules comprising the EVS 5.2.0.0 Voting System revealed deviations from the standard as well as issues with the commenting. These anomalies are documented in detail in the NTS-Huntsville generated review reports on file as raw data.

Resolution to Anomaly No. 4:

Upon completion of the review for each source code submission, a technical summary report of all identified standards violations was sent to ES&S for resolution. ES&S then corrected the reported discrepancies and re-submitted the source code for re-review. This process was repeated as many times as necessary until all identified standards violations were corrected. All discrepancies were resolved by ES&S before the conclusion of the test campaign. Additional information can be located in tables 4-1 and 4-2 of this document.

Notice of Anomaly No. 5 Rev A: Functional Configuration Audit (FCA)

During the FCA, seven discrepancies were identified and included within this NOA. The following discrepancies were documented:

1. "ExpressVote General Error. Unknown Error occurred. Please Contact an Election Official. An Error has occurred." Message displayed when attempting to generate hash of Firmware/OS/Bootloader with Include Graphics Option checked.
2. Open Primary contests without party preference on the ExpressVote: Voting in more than one party's contests caused candidates to display as selected, but not print.
3. When attempting to print a ballot image in ElectionWare, if a new printer is selected when attempting to print ballot images, the image will print to the previously selected printer.
4. When attempting to print a ballot image in ElectionWare, pressing the "X" button to close the printer window causes the image to be printed anyways.
5. Enable/Disable BOL Scanning option is stated incorrectly in the system log as "Bypass Graphics/Audio Check Option Enabled/Disabled" on the ExpressVote.
6. For DS200 tabulation in ERM, the option "Update DS200 Results from SFTP" is not greyed out.
7. The DS200 was incorrectly displaying the ballot counts for the ExpressVote cards on the QR Status Code screen. The ExpressVote cards were being counted as DS200 ballots after the polls were closed.

Resolution to Anomaly No. 5 Rev A Items 1, 5, and 7:

ES&S acknowledged the discrepancies and resolved them in subsequent versions of the ExpressVote and DS200 firmware. The items were retested and found to be compliant.

Resolution to Anomaly No. 5 Rev A Items 2, 3, 4, and 6:

ES&S acknowledged the discrepancies and resolved them in subsequent versions of the ElectionWare and ERM software. The items were retested and found to be compliant.

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.7 Recommendation for Certification

NTS Huntsville performed conformance/specification testing on the modifications to EVS 5.2.0.0 Voting System to the EAC 2005 VVSG (Version 1.0). During the test campaign, the data from all testing was reviewed to ensure all VVSG requirements that are supported by the EVS 5.2.0.0 Voting System had been tested. NTS Huntsville also used discretion as granted by the VVSG to design and exercise FCA Test Cases, perform source code reviews, and perform Security Tests.

NTS Huntsville performed conformance testing on all modifications submitted for the ES&S EVS 5.2.0.0 Voting System. The modifications and additions met the requirements of the EAC 2005 VVSG and the manufacturer's technical documentation. As such, NTS Huntsville recommends the EAC grant the ES&S EVS 5.2.0.0 Voting System certification to the EAC 2005 VVSG.

This report is valid only for the equipment identified in Section 2 of this report. Any changes, revisions, or corrections made to the system after this evaluation shall be submitted to the EAC to determine if the modified system requires a new application, or can be submitted as a modified system. The scope of testing required was determined based upon the degree of modification.

Due to the varying requirements of individual jurisdictions, it is recommended by the EAC 2005 VVSG that local jurisdictions perform pre-election logic and accuracy tests on all systems prior to their use in an election within their jurisdiction.

APPENDIX A

SYSTEM MODIFICATIONS

Item Number	Module Affected	Version Number	Modification
1	ExpressVote	Hardware v1.0	Addition of a new universal vote capture device
2	DS200	Hardware 1.2.3	Incorporates all changes in ECO 1281
3	DS200	Hardware v1.3	Implement new motherboard and new scanner board as previous boards are going end-of-life (EOL).
4	DS200	Hardware v1.3	Transport component update to enhance ballot handling and manufacturing tolerances.
5	DS200	Hardware v1.3	Replace CFL backlight with LED backlight due to EOL (end of life).
6	DS200	Hardware v1.3	Usability and compatibility enhancements to battery compartment access, ballot box replacement rails, power/close compartment switch, and equipment labeling.
7	ExpressVote & ElectionWare	ExpressVote FW 1.4.0.0; ElectionWare 4.6.0.0	Enhancement to support the Open Primary election type.
8	ExpressVote	ExpressVote FW 1.4.0.0	Enhancement to update the field length displayed on the ExpressVote
9	ExpressVote & ElectionWare	ExpressVote FW 1.4.0.0; ElectionWare 4.6.0.0	This enhancement will allow the ExpressVote to display the customized precinct name that is configured in ElectionWare.
10	DS200 & ElectionWare	DS200 FW 2.12.0.0 ElectionWare 4.6.0.0	The ability for the DS200 to query blank ExpressVote activation cards.
11	ElectionWare	ElectionWare 4.6.0.0	Enhances the cast vote record (CVR) export so that contest totals by district can be derived from the CVR spreadsheet.
12	DS200	Firmware 2.12.0.0	The enhancement allows an override to bypass "diverter not installed" stop and keep scanning.
13	DS850	Firmware 2.10.0.0	Added the ability to password protect the generation of results reports.
14	DS200	Firmware 2.12.0.0	Enhancement so the candidate order on the zero and results reports on the DS200 matches the ballot for that precinct.
15	DS200, DS850, ExpressVote, AutoMARK, & ElectionWare	DS200 FW 2.12.0.0; DS850 FW 2.10.0.0; ExpressVote FW 1.4.0.0; AutoMARK FW 1.8.6.0; ElectionWare 4.6.0.0	Implement method to validate hash values with Trusted Build to conform to RFI 2012-04.
16	System Wide	EVS 5.2.0.0	TDP update for Configuration Management to conform to RFI 2012-03.
17	ERM	ERM 8.11.0.0	Audit Log timestamp updates to conform with RFI 2013-03.
18	System Wide	EVS 5.2.0.0	Quality Improvements: enhancements to any GUI related issues and toolbox improvements
19	ExpressVote & AutoMARK	ExpressVote FW 1.4.0.0 AutoMARK FW 1.8.6.0	Pennsylvania rule for contest re-voting conditions associated with Straight Party ticket voting.
20	ExpressVote & AutoMARK	ExpressVote FW 1.4.0.0 AutoMARK FW 1.8.6.0	Enhancements of the ExpressVote and AutoMARK screens for plain language and conformance to usability guidelines.
21	ERM	ERM 8.11.0.0	The ERM csv export excludes some vote totals when PRC contest types are used.
22	DS200, DS850, AutoMARK, ERM, & ElectionWare	DS200 FW 2.12.0.0; DS850 FW 2.10.0.0; AutoMARK FW 1.8.6.0; ERM 8.11.0.0 ElectionWare 4.6.0.0	Illinois tabulation rule: An overvoted contest must count as 1 in the overvote tally, rather than being counted as the same number as the Vote-for in the contest.
23	System Wide	EVS 5.2.0.0	Upgrade to Adobe Standard version XI.
24	System Wide	EVS 5.2.0.0	Routine task updates for every release. For example: TDP updates, hardening scripts, source code file listings, and change notes.
25	DS850	DS850 FW 2.10.00	DataWin updates to DS850 firmware

APPENDIX B

PHOTOGRAPHS

Photograph No. 1
ExpressVote Acoustic Noise Level Test Setup

Photograph No. 2	**Photograph No. 3**
DS200 Electrical Supply Test Setup	**ExpressVote Electrical Supply Test Setup**
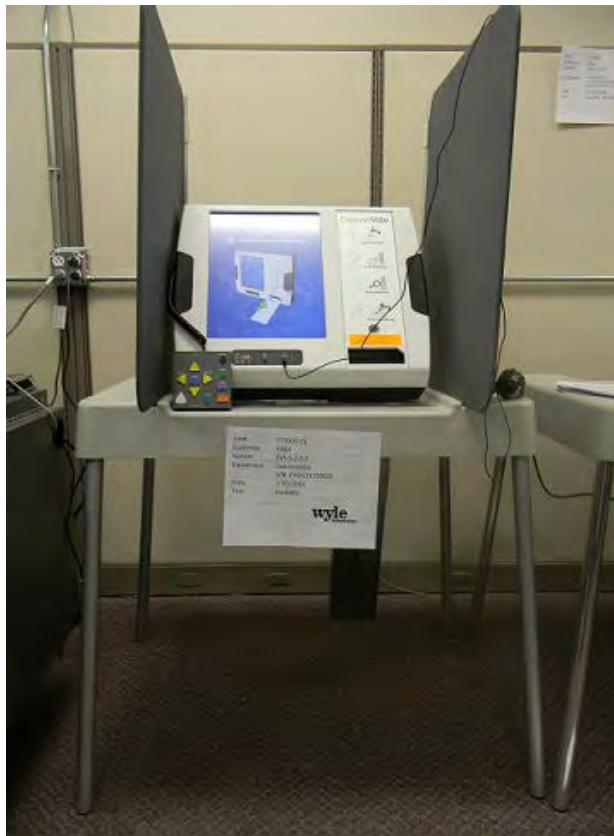
Photograph No. 4
DS200 Maintainability Test Setup

Photograph No. 5
ExpressVote Maintainability Test Setup
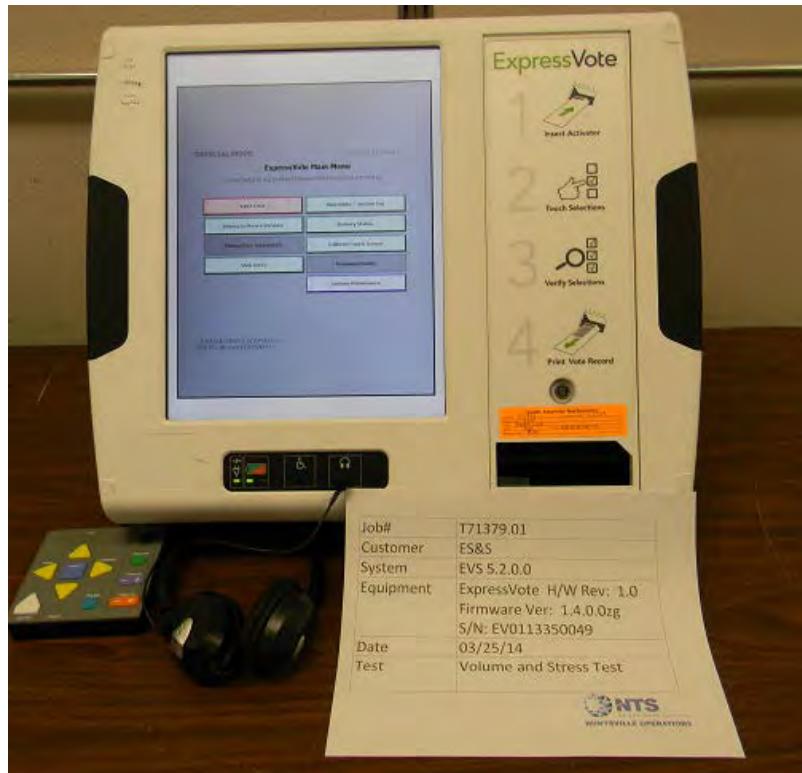
Photograph No. 6
Usability and Accessablity Test Setup

Photograph No. 7
DS200 Accuracy Test Setup
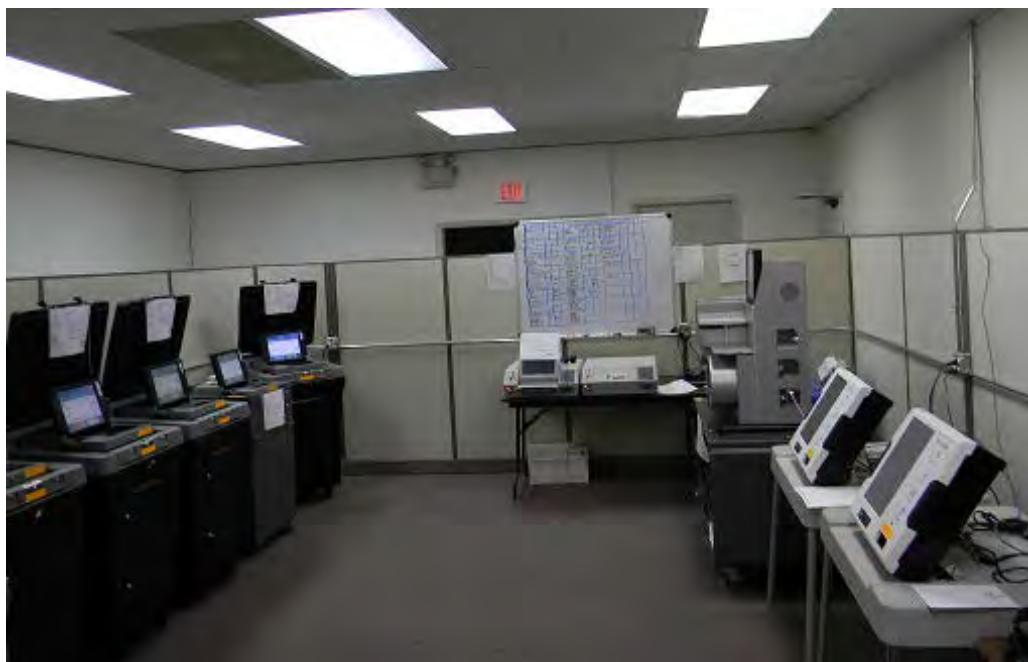
Photograph No. 8
ExpressVote Accuracy Test Setup

Photograph No. 9
Volume and Stress Test Setup
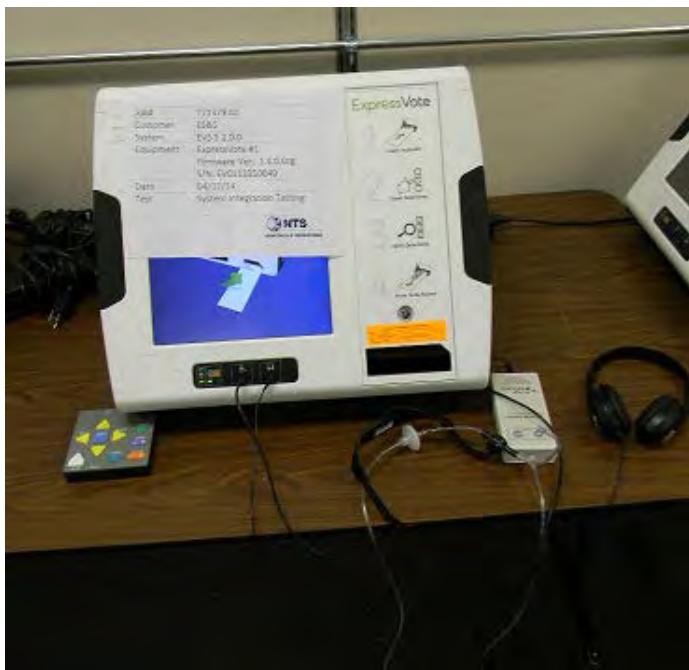
Photograph No. 10
Volume and Stress Test Setup

Photograph No. 11
System Integration Test Setup

Photograph No. 12
DS200 System Integration Test Setup

Photograph No. 13
ExpressVote System Integration Test Setup

Photograph No. 14
AutoMARK System Integration Test Setup

Photograph No. 15
DS850 System Integration Test Setup

APPENDIX C

NTS'S CERTIFICATION TEST PLAN NO. T71379.01-01

CERTIFICATION TEST PLAN

Prepared for:

Manufacturer Name	ES&S
Manufacturer System	EVS 5.2.0.0
EAC Application No.	**ESSEVS5200**
Manufacturer Address	11208 John Galt Boulevard Omaha, NE 68137

Page No. i
Certification Test Plan T71379.01

REV	DATE	PAGE OR PARAGRAPH AFFECTED	DESCRIPTION OF CHANGES
		REPORT NO. Test Plan No. T71379.01 Rev A	
		DATE April 25, 2014	
---	02-13-14	Entire Document	Original Release
A	3-13-14	1.2	Removed "but not limited to" and corrected Appendix C
A	3-13-14	1.3	Corrected section, added more information
A	3-13-14	1.4	Updated section 1.4
A	3-13-14	1.7.2	Added Vote Capture Device
A	3-13-14	1.7.3	Reworded ElectionWare description
A	3-13-14	2.2	Removed the word significant
A	3-13-14	3.3	Updated table 3-3
A	3-13-14	4.1	Reworded Usability section
A	3-13-14	4.2	Removed the word "are"
A	3-13-14	4.4.1	Updated paragraph
A	3-13-14	4.4.3	Reworded 4th paragraph
A	3-13-14	4.4.5	Removed the word "are"
A	3-13-14	4.6	Updated table 4-2
A	3-13-14	4.7	Reworded 2nd paragraph
A	3-13-14	5.2	Reworded paragraph
A	3-13-14	6.3.2	Reworded Security Source Code Review
A	3-13-14	6.3.2	Reworded COTS generated source code paragraph
A	3-13-14	6.3.2	Reworded Error Recovery Test section
A	3-13-14	6.3.3	Added comma after the word documentation
A	3-13-14	6.3.3	Reworded the Regression Testing section

National Technical Systems
Huntsville Facility

TABLE OF CONTENTS

National Technical Systems
Huntsville Facility

TABLE OF CONTENTS (continued)

APPENDICES

1.0 INTRODUCTION

The purpose of this National Certification Test Plan (Test Plan) is to document the procedures that National Technical Systems, Incorporated (NTS) will follow to perform certification testing of the Election Systems and Software (ES&S) EVS 5.2.0.0 voting system to the requirements set forth for voting systems in the U.S. Election Assistance Commission (EAC) 2005 Voluntary Voting System Guidelines (EAC 2005 VVSG). Prior to submitting the system for certification testing, ES&S submitted an application to the EAC for certification of the EVS 5.2.0.0 voting system modification to the previously certified EVS 5.0.0.0 (Certification number: ESSEVS5000) voting system. This test plan follows Notice of Clarification 09-005: Development and Submission of Test Plans for Modifications to EAC Certified Systems and Notice of Clarification 13-02: Detailed Description of Changes for Modifications.

At test conclusion, the results of all testing performed as part of this test campaign will be submitted to the EAC in the form of a final report.

1.1 Established Baseline System

The baseline system for this modification is the EVS 5.0.0.0 voting system. Tables 1-1, 1-2, and 1-3 describe the certified equipment and firmware versions. For full details about the EVS 5.0.0.0 test campaign refer to Wyle Laboratories' Test Report No. T59087.01-01 Rev. A posted on the EAC website.

Table 1-1 EVS 5.0.0.0 Voting System Hardware Components

Component	Hardware Version	Firmware Version
DS200	1.2.1	2.7.0.0
AutoMARK A100	1.0	1.8.1.0
AutoMARK A200 (SBC 2.0)	1.1	1.8.1.0
AutoMARK A200 (SBC 2.5)	1.1	1.8.1.0
AutoMARK A300 (SBC 2.0)	1.3	1.8.1.0
AutoMARK A300 (SBC 2.5)	1.3	1.8.1.0
DS850	1.0	2.4.0.0

Table 1-2 EVS 5.0.0.0 Voting System Software Components

Component	Version
ElectionWare	4.1.0.0
Election Reporting Manager (ERM)	8.6.0.0
ES&S Event Log Service	1.5.0.0
VAT Previewer	1.8.1.0
Removable Media Service	1.4.0.0

Table 1-3 EVS 5.0.0.0 Voting System EMS Components

Equipment	Description	Serial Number
Server PC	Dell PowerEdge T410	4D6BQM1
Server PC	Dell PowerEdge T710	JPZ6VR1
Client PC	Dell OptiPlex 980	3TZJFQ1
Client PC	Dell Latitude E6410	232F0M1

1.0 INTRODUCTION (Continued)

1.2 Scope of Modification

The purpose of this modification is to introduce the ExpressVote, DS200 1.3 & 1.2.3 hardware into the previously certified EVS 5.0.0.0 voting system. In addition, ES&S submitted software changes to the DS200, DS850, AutoMARK, ElectionWare, and Election Reporting Manager (ERM).

The system changes submitted to the EAC in the Application for Certification (ESS1303) include functional and hardware modifications to the EMS, DS850, and DS200. Functional upgrades were made throughout this modification including software fixes, conformance with new RFIs released before application submission, software to enhance usability, replacement of hardware parts nearing end of life, and integration with the EVS suite to enhance usability and performance. These modifications are presented in their entirety in Appendix C.

1.3 Initial assessment

The ExpressVote hardware version 1.0 was submitted for testing in a previous state campaign for the State of Florida (FL EVS 4.5.0.0) that concluded on November 18, 2013. NTS personnel have analyzed the results of the FL EVS 4.5.0.0 testing to determine prior testing acceptance (Wyle Test Repot No. T71013.02-01). Details of this analysis are in section 4.4.1 Hardware Qualitative Examination Design. Based on this analysis, all hardware testing from the FL EVS 4.5.0.0 test campaign was determined to be meet the requirements for reuse. As part of the EVS 5.2.0.0 test campaign, the ExpressVote hardware version 1.0 shall be subjected to Physical Configuration Audit (PCA), Electrical Supply Testing, Maintainability Testing, Acoustical Testing, Usability and Accessibility Testing, Functional Configuration Audit (FCA), Security Testing, Accuracy Testing, and Volume and Stress Testing. In addition, to verify that the modifications to the voting system do not introduce any nonconformities or instabilities, the EVS 5.2.0.0 voting system shall be subjected to a system integration test to ensure all components interact properly.

The DS200 Version 1.3 hardware was submitted for testing in a previous state campaign for the State of Florida (FL EVS 4.5.0.0) that concluded on September 18, 2013. NTS personnel have analyzed the results of the FL EVS 4.5.0.0 testing to determine prior testing acceptance (Wyle Test Report No. T71013.01-01). Details of this analysis are in Section 4.4.1 Hardware Qualitative Examination Design. Based on this analysis, all hardware testing from the FL EVS 4.5.0.0 test campaign was determined to be meet the requirements for reuse. As part of the EVS 5.2.0.0 test campaign, the DS200 hardware Version 1.3 shall be subjected to functional configuration audit (FCA), accuracy, maintainability, accessibility, usability, security, physical configuration audit (PCA), system integration, reliability, and electrical supply testing.

The software utilized for the EVS 5.2.0.0 campaign will comprise of the new ExpressVote software and changes to the DS200, DS850, AutoMARK, ElectionWare, and Election Reporting Manager (ERM) software. All source code will be compared to the EAC certified EVS 5.0.0.0 version to determine the extent of the source code review required. Based on this examination, NTS personnel will perform software code review to ensure that all applicable VVSG requirements are met and changes to the software do not introduce any new functions or features outside of the modifications in Appendix C.

The DS200 Version 1.2.3 hardware incorporates ECO1281 (modifications to the transport assembly and sheet metal) into the previously-certified (EVS 5.0.0.0)1.2.1 hardware. ECO1281 was conditionally approved by the EAC contingent that the change will be tested in the next EAC certification effort. Based on the EAC response to ECO1281, NTS personnel will incorporate a DS200 with this modification throughout testing.

An initial assessment has been performed on the TDP submitted by ES&S for EVS 5.2.0.0. The initial assessment determined that all required documents were delivered to implement the TDP review. The TDP is constructed with the EVS 5.0.0.0 certified TDP and the EVS 5.2.0.0 changes as an addendum.

1.0   INTRODUCTION (Continued)

1.4   References

The documents listed below were used in the development of the test plan and will be utilized to perform certification testing.

- Election Assistance Commission 2005 Voluntary Voting System Guidelines, Volume I, Version 1.0, "Voting System Performance Guidelines," and Volume II, Version 1.0, "National Certification Testing Guidelines," dated December 2005

- Election Assistance Commission Testing and Certification Program Manual, Version 1.0, effective date June 1, 2011

- Election Assistance Commission Voting System Test Laboratory Program Manual, Version 1.0, expires November 2014

- National Voluntary Laboratory Accreditation Program NIST Handbook 150, 2006 Edition, "NVLAP Procedures and General Requirements (NIST Handbook 150)," dated February 2006

- National Voluntary Laboratory Accreditation Program NIST Handbook 150-22, 2008 Edition, "Voting System Testing (NIST Handbook 150-22)," dated May 2008

- United States 107th Congress Help America Vote Act (HAVA) of 2002 (Public Law 107-252), dated October 2002

- Test Guidelines Documents: EMI-001A, Test Guidelines for Performing Electromagnetic Interference (EMI) Testing," and EMI-002A, "Test Procedure for Testing and Documentation of Radiated and Conducted Emissions Performed on Commercial Products"

- Quality Assurance Program Manual, Revision 5

- ANSI/NCSL Z540-1, "Calibration Laboratories and Measuring and Test Equipment, General Requirements"

- ISO 10012-1, "Quality Assurance Requirements for Measuring Equipment"

- EAC Requests for Interpretation (RFI) (listed on www.eac.gov)

- EAC Notices of Clarification (NOC) (listed on www.eac.gov)

- EAC Quality Monitoring Program residing on:
  http://www.eac.gov/testing_and_certification/quality_monitoring_program.aspx

- Wyle Test Report No. T71013.02-01 – Hardware Compliance Testing of Election Systems and Software FL EVS 4.5.0.0 ExpressVote Hardware Version 1.0

- Wyle Test Report No. T71013.01-01 – Hardware Compliance Testing of Election Systems and Software FL EVS 4.5.0.0 DS200 Hardware Version 1.3

- Wyle Test Report No. T59087.01-01 Rev A – National Certification Test Report of Election Systems and Software EVS 5.0.0.0

(The remainder of this page intentionally left blank)

1.0   INTRODUCTION (Continued)

1.5   **Terms and Abbreviations**

This subsection defines all terms and abbreviations applicable to the development of this Test Plan.

Table 1-4 Terms and Abbreviations

Term	Abbreviation	Definition
Americans with Disabilities Act 1990	ADA	ADA is a wide-ranging civil rights law that prohibits, under certain circumstances, discrimination based on disability.
Configuration Management	CM	---
Commercial Off the Shelf	COTS	Commercial, readily available hardware or software.
United States Election Assistance Commission	EAC	Commission created per the Help America Vote Act of 2002, assigned the responsibility for setting voting system standards and providing for the voluntary testing and certification of voting systems.
ES&S Event Log Service	ELS	---
Election Management System	EMS	Within the EVS 5.2.0.0 voting system, the EMS is comprised of five components: ElectionWare, ERM, ES&S Event Log Service, and VAT Previewer.
Election Reporting Manager	ERM	EVS EMS reporting component.
Election Systems and Software	ES&S	---
Equipment Under Test	EUT	Refers to the individual system component or multiple piece of the same component
ES&S Voting System	EVS	---
Functional Configuration Audit	FCA	Verification of system functions and combination of functions cited in the manufacturer's documentation.
Help America Vote Act	HAVA	Act created by United States Congress in 2002.
Intelligent Mark Recognition	IMR	Visible light scanning technology to detect completed ballot targets.
National Institute of Standards and Technology	NIST	Government organization created to promote U.S innovation and industrial competitiveness by advancing measurement science, standards, and technology in ways that enhances economic security and improves our quality of life.

(The remainder of this page intentionally left blank)

1.0 INTRODUCTION (Continued)

1.5 Terms and Abbreviations (Continued)

Table 1-4 Terms and Abbreviations (Continued)

Term	Abbreviation	Definition
Physical Configuration Audit	PCA	Review by accredited test laboratory to compare voting system components submitted for certification testing to the manufacturer's technical documentation, and confirmation the documentation meets national certification requirements.
Personal Computer	PC	Computer component of the EVS 5.2.0.0 voting system.
Quality Assurance	QA	--
System Under Test	SUT	Refers to the system as a whole (all components)
Secure File Transfer Protocol	SFTP	A network protocol that provides file access, file transfer, and file management functionality over any reliable data stream.
Technical Data Package	TDP	Manufacturer documentation related to the voting system required to be submitted as a precondition of certification testing.
Trusted Build	--	Final build of source code performed by a trusted source and overseen by the manufacturer which is delivered to the EAC designated repository; also referred to as a "Witness Build".
Underwriters Laboratories Inc.	UL	
Uninterruptible Power Supply	UPS	--
Voter Assist Terminal	VAT	The electronic ballot marking device component is the ES&S AutoMARK.
Voluntary Voting System Guidelines	EAC 2005 VVSG	Published by the EAC, the third iteration of national level voting system standards.
National Technical Systems, Inc.	NTS	--
NTS Operating Procedure	OP	NTS Test Method or Test Procedure.
Voting System Test Laboratory	VSTL	NTS
Voluntary Voting System Guidelines	VVSG	EAC Voluntary Voting System Guidelines Version 1.0.
Quick Response Code	QR Code	Two-dimensional barcode

(The remainder of this page intentionally left blank)

National Technical Systems
Huntsville Facility

1.0   INTRODUCTION (Continued)

1.6   **Testing Responsibilities**

Prior to the development of this test plan, NTS evaluated test results from two previous test campaigns performed by Wyle: EVS 5.0.0.0 and FL EVS 4.5.0.0. The purpose of this evaluation was to determine the scope of testing required for system certification. Based on this evaluation, NTS determined that testing from previous test campaigns could be utilized to satisfy some requirements of this test campaign. Sections 2.1 and 4.4.1 contain additional details of this evaluation. All other core and non-core software and hardware certification testing shall be conducted under the guidance of qualified NTS personnel.

1.6.1   **Project Schedule**

This information is contained in a NTS-generated Microsoft Project schedule. This schedule is presented in Appendix A, "ES&S Project Schedule." The dates on the schedule are not firm dates but planned estimates presented for informational purposes.

1.6.2   **Test Case Development**

NTS will utilize the "NTS Baseline Test Cases" augmented with specially designed test cases tailored to the EVS 5.2.0.0 voting system for the Functional Configuration Audit (FCA), Usability, and System Integration Tests. NTS has designed specific election definitions and test cases for the Operational Status Check and the Accuracy Tests.

1.6.3   **Test Procedure Development and Validation**

NTS will utilize the NTS Operating Procedures (OPs) during the duration of this test program.

1.6.4   **Third-Party Tests**

NTS will not utilize any 3rd party testing during performance of the EVS 5.2.0.0 test campaign.

(The remainder of this page intentionally left blank)

1.0   INTRODUCTION (Continued)

1.7   **Target of Evaluation Description**

The following sections address the design methodology and product description of the EVS 5.2.0.0 Voting System as taken from the ES&S technical documentation.

1.7.1   **System Overview**

The ES&S EVS 5.2.0.0 voting system is a comprehensive suite of vote tabulation equipment and software solutions providing end-to-end election management. Tables 1-5 and 1-6 detail the EVS 5.2.0.0 voting system with the following core system components.

Table 1-5 EVS 5.2.0.0 Voting System Hardware Components

Component	Hardware Version	Firmware Version
ExpressVote	1.0	1.4.0.0
DS200	1.2.1	2.12.0.0
DS200	1.2.3	2.12.0.0
DS200	1.3	2.12.0.0
AutoMARK A100	1.0	1.8.6.0
AutoMARK A200 (SBC 2.0)	1.1	1.8.6.0
AutoMARK A200 (SBC 2.5)	1.1	1.8.6.0
AutoMARK A300 (SBC 2.0)	1.3	1.8.6.0
AutoMARK A300 (SBC 2.5)	1.3	1.8.6.0
DS850	1.0	2.10.0.0

Table 1-6 EVS 5.2.0.0 Voting System Software Components

Component	Version
ElectionWare	4.6.0.0
Election Reporting Manager (ERM)	8.11.0.0
Removable Media Service (RMS)	1.4.5.0
ES&S Event Log Service (ELS)	1.5.5.0
VAT Previewer	1.8.6.0
ExpressVote Previewer	1.4.0.0
ExpressPass Application*	1.1.0.0

*ExpressPass Application software is not in the scope of certification, but NTS will review the source code for 2005 VVSG compliance.

1.7.2   **System Hardware**

The EVS 5.2.0.0 voting system can be set up to support one or more of the following hardware components:

- ExpressVote Vote Capture Device
- DS200 Precinct Tabulator
- AutoMARK Voting Assist Terminal
- DS850 Central Tabulator

Each of these components is described below.

1.0 INTRODUCTION (Continued)

1.7 Target of Evaluation Description (Continued)

1.7.2 System Hardware (Continued)

<u>Vote Capture Device: ExpressVote</u>

The ExpressVote is a universal vote capture device with an independent voter-verifiable paper record that is digitally scanned for tabulation by the DS200 or the DS850. This system combines paper-based voting with touch screen technology. The ExpressVote includes a mandatory vote summary screen that requires voters to confirm or revise selections prior to printing the summary of ballot selections using the internal thermal printer. Once printed, ES&S ballot scanners process the vote summary card.

Photograph 1: ExpressVote

<u>Precinct Ballot Tabulator: DS200</u>

The precinct ballot tabulator component is the DS200. The DS200 is a digital scan paper ballot tabulator designed for use at the polling place level. After the voter marks a paper ballot, their ballot is inserted into the unit and immediately tabulated. The tabulator uses a high-resolution image-scanning device to image the front and rear of the ballot simultaneously. The resulting ballot images are then decoded by a proprietary recognition engine.

The system includes a 12-inch touch screen display providing voter feedback and poll worker messaging. Once a ballot is tabulated and the system updates internal vote counters, the ballot is dropped into an integrated ballot box. The DS200 includes an internal thermal printer for the printing of the zero reports, log reports, and polling place totals upon the official closing of the polls.

1.0   INTRODUCTION (Continued)

1.7   Target of Evaluation Description (Continued)

1.7.2   System Hardware (Continued)

Electronic Ballot Marking Device: AutoMARK Voter Assist Terminal (VAT)

The electronic ballot marking device component is the ES&S AutoMARK Voter Assist Terminal (VAT). The AutoMARK VAT assists voters with disabilities by marking optical scan ballots.

The AutoMARK VAT includes two user interfaces to accommodate voters who are visually or physically impaired or voters who are more comfortable reading or hearing instructions and choices in an alternative language. The AutoMARK is equipped with a touch-screen and keypad. The touch-screen interface includes various colors and effects to prompt and guide the voter through the ballot marking process. Each key has both Braille and printed text labels designed to indicate function and a related shape to help the voter determine its use.

Regardless whether the voter uses the touch-screen or other audio interface, changes can be made throughout the voting process by navigating back to the appropriate screen and selecting the change or altering selections at the mandatory vote summary screen that closes the ballot-marking session.

Central Tabulator: DS850

The DS850 is a high-speed, digital scan central ballot counter. During scanning, the DS850 prints a continuous audit log to a dedicated audit log printer and can print results directly from the scanner to a second connected printer. The scanner saves results internally and to results collection media (USB flash media) that officials can use to format and print results from a PC running Election Reporting Manager. The DS850 has an optimum throughput rate of 300 ballots per minute and uses cameras and imaging algorithms to image the front and back of a ballot, evaluate the results, and sort ballots into discrete bins to maintain continuous scanning.

EMS Client/Server Configuration

EVS 5.2.0.0 voting system Election Management System (EMS) utilizing a COTS PC configured with a Server running Windows Server 2008 R2 and a combination of a client laptop and a client desktop running Windows 7 Professional.

1.7.3   System Software

The EVS 5.2.0.0 voting system EMS is an application suite comprised of six components: ElectionWare, Election Reporting Manager (ERM), Removable Media Service (RMS), ES&S Event Log Service (ELS), VAT Previewer, and ExpressVote Previewer.

ElectionWare

ElectionWare integrates the election administration functionality into a unified application. Its intended use is to define an election and create the resultant media files used by the DS200 tabulator, AutoMARK Voter Assist Terminal (VAT), the DS850 Central Ballot Scanner, ExpressVote, and Election Reporting Manager (ERM). It also has an integrated ballot viewer that allows election officials to view the scanned ballot and captured ballot data side-by-side and produce ballot reports.

1.0 **INTRODUCTION (Continued)**

1.7 **Target of Evaluation Description (Continued)**

1.7.3 **System Software (Continued)**

Election Reporting Manager (ERM)

Election Reporting Manager (ERM) generates paper and electronic reports for election workers, candidates, and the media. Jurisdictions can use a separate ERM installation to display updated election totals on a monitor as ballot data is tabulated, and send the results' reports directly to the media outlets.

ERM supports accumulation and combination of ballot results data from all ES&S tabulators. Precinct and accumulated total reports provide a means to accommodate candidate and media requests for totals and are available upon demand. High-speed printers are configured as part of the system accumulation/reporting stations PC and related software.

Removable Media Service (RMS)

Removable Media Service (RMS) is an application that runs in the background of the EMS client workstation and supports the installation and removal of election and results media.

ES&S Event Log Service (ELS)

ES&S Event Log Service is a Windows Service that runs in the background of any active ES&S Election Management software application to monitor the proper functioning of the Windows Event Viewer. The ES&S Event Log Service closes any active ES&S software application if the system detects the improper deactivation of the Windows Event Viewer.

VAT Previewer

The VAT Preview is an application within the EMS program that allows the user to preview audio text and screen layout prior to burning Election Day media for the AutoMARK.

ExpressVote Previewer

The ExpressVote Previewer is an application within the EMS program that allows the user to preview audio text and screen layout prior to burning Election Day media for the ExpressVote.

(The remainder of this page intentionally left blank)

1.0   INTRODUCTION (Continued)

1.7   Target of Evaluation Description (Continued)

1.7.4   System Operational Concept

The operational flow and low-level system interfaces for the EVS 5.2.0.0 voting system is illustrated in Figure 1-1.
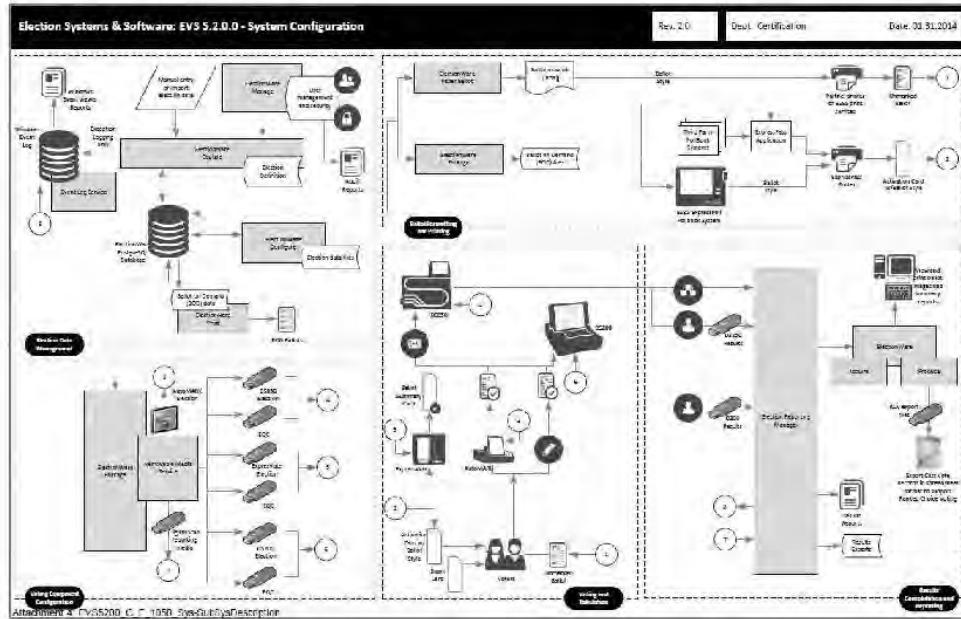
FIGURE 1-1 SYSTEM OVERVIEW DIAGRAM

(The remainder of this page intentionally left blank)

National Technical Systems
Huntsville Facility

2.0 PRE-CERTIFICATION TESTING AND ISSUES

NTS has conducted a pre-certification review, and findings indicate that all system changes are consistent with the change items documented in the EAC Application ESS1303.

2.1 Evaluation of Prior VSTL Testing

ES&S submitted the following test reports to NTS for reuse consideration. The reports and items requested for reuse are as follows:

- Wyle Test Report No. T71013.01-01 (DS200 Hardware Test Report for FL EVS 4.5.0.0)
  - Electrical Power Disturbance
  - Electromagnetic Radiation
  - Electrostatic Disruption
  - Electromagnetic Susceptibility
  - Electrical Fast Transient
  - Lightning Surge
  - Conducted RF Immunity
  - Magnetic Fields Immunity
  - Product Safety Review, UL60950-1
  - Temperature Power
  - High/Low Temperature
  - Humidity
  - Vibration
  - Bench Handling

- Wyle Test Report No. T71013.02-01 (ExpressVote Hardware Test Report for FL EVS 4.5.0.0)
  - Electrical Power Disturbance
  - Electromagnetic Radiation
  - Electrostatic Disruption
  - Electromagnetic Susceptibility
  - Electrical Fast Transient
  - Lightning Surge
  - Conducted RF Immunity
  - Magnetic Fields Immunity
  - Product Safety Review, UL60950-1
  - Temperature Power
  - High/Low Temperature
  - Humidity
  - Vibration
  - Bench Handling

For details of the acceptance of the above items, refer to Section 4.4.1 of this test plan.

2.2 Known Field Issues

The EVS 5.2.0.0 voting system is a modification to EVS 5.0.0.0 voting system. There are no published systemic issues traceable to the EVS family of systems.

3.0 MATERIALS REQUIRED FOR TESTING

The materials required for certification testing of the EVS 5.2.0.0 voting system include software, hardware, test materials, and deliverable materials were shipped directly to NTS by ES&S. The equipment used during this test is the same equipment used during the original certification campaign.

3.1 Software

Table 3-1 lists the software the manufacturer must submit for testing. This section lists all software required for operation and testing of the voting system being certified. This includes the software used for testing accuracy and system integration, as well as supporting software required for the test environment. All COTS software is listed in Appendix D.

Table 3-1 EVS 5.2.0.0 Software Submitted for Testing

Software Required For Testing	Software Version
Proprietary Software	
ExpressVote	1.4.0.0
DS200	2.12.0.0
AutoMARK	1.8.6.0
DS850	2.10.0.0
ElectionWare	4.6.0.0
Election Reporting Manager (ERM)	8.11.0.0
ES&S Event Log Service (ELS)	1.5.5.0
Removable Media Service (RMS)	1.4.5.0
VAT Previewer	1.8.6.0
ExpressVote Previewer	1.4.0.0
ExpressPass Application*	1.1.0.0

*ExpressPass Application software is not in the scope of certification, but NTS will review the source code for 2005 VVSG compliance.

3.2 Equipment

This subsection categorizes the equipment the manufacturer submitted for testing listed in Table 3-2. Each test element is included in the list of equipment required for testing of that element, including system hardware, general purpose data processing and communications equipment, and any required test instrumentation.

Table 3-2 EVS 5.2.0.0 Voting System Equipment Description

Equipment	Description	Serial Numbers/Designation
ExpressVote Hardware v. 1.0 Firmware v. 1.4.0.0	Vote Capture Device	EV0113350021, EV0113350022 EV0113350025, EV0113350037 EV0113350052, EV0113350033, EV0113350049
DS200 Hardware v. 1.2.1 Firmware v. 2.12.0.0	Precinct Count Digital Scanner	ES0108340026, DS0113340087
DS200 Hardware v. 1.2.3 Firmware v. 2.12.0.0	Precinct Count Digital Scanner	DS0113360186
DS200 Hardware v. 1.3 Firmware v. 2.12.0.0	Precinct Count Digital Scanner	DS0313350002, DS0313350010

Page No. 14 of 42
Certification Test Plan T71379.01

3.0 MATERIALS REQUIRED FOR TESTING (Continued)

3.2 Equipment (Continued)

Table 3-2 EVS 5.2.0.0 Voting System Equipment Description (Continued)

Equipment	Description	Serial Numbers/Designation
AutoMARK A100 Hardware v. 1.0 Firmware v. 1.8.6.0	Accessible Voting Station	AM0106431607
AutoMARK A200 Hardware v. 1.1 Firmware v. 1.8.6.0	Accessible Voting Station	AM0308421809
DS850 Hardware v. 1.0 Firmware v. 2.10.0.0	Central Count Digital High Speed Scanner	DS850: DS8511090075 Cart: 549037-01 Laser Printer Oki B430dn: AL03021036A0 UPS APC-RS 1500: JB1103003923 Dot Matrix Printer Oki 420: AE72011853C0
Ballot Box Hardware v. 1.2, 1.3 & 1.4	Plastic Ballot Box	Box1, Box 2, Box 3, Box 4, Box 5, Box 01, Box 02, E089, B099
Ballot Box Hardware v. 1.0, 1.1, & 1.2	Metal Box with Diverter	Box 12
Server PC	Dell PowerEdge T410	4D6BQM1
Server PC	Dell PowerEdge T710	JPZ6VR1
Client PC	Dell OptiPlex 980	3TZJFQ1
Client PC	Dell Latitude E6410	232F0M1
Transport Media (USB Flash Drives)	Delkin 1GB Delkin 2 GB Delkin 4GB Delkin 8GB	NTS-assigned: TM-XXX
Compact Flash	Delkin Devices 1 GB Compact Flash	NTS-assigned: CF-XXX
Report Printer	OKI B6300	LSQX074394
Headphones	Avid FV 60	HP-57936-1-9
ExpressPass Printer*	Thermal Bar Code Printer	Model 4200 S/N: 01901042505
Quick Response (QR) Code Scanner	Motorola QR Code Scanner	Model DS9208 S/N: 14014000502091

*This equipment is not in the scope of certification. This equipment will be tested to ensure that it functions as stated in the TDP. No other testing will be performed on this equipment.

(The remainder of this page intentionally left blank)

Page No. 15 of 42
Certification Test Plan T71379.01

3.0 MATERIALS REQUIRED FOR TESTING (Continued)

3.3 Deliverable Materials

The materials listed in Table 3-3 are to be delivered as part of the EVS 5.2.0.0 Voting System to the users.

Table 3-3 Deliverable Materials

Deliverable Material	Version	Description
ExpressVote	Firmware 1.4.0.0; Hardware 1.0	Vote Capture Device
DS200	Firmware 2.12.0.0; Hardware 1.2.1 or 1.2.3 or 1.3	Precinct Ballot Scanner
AutoMARK A100 or A200 or A300	Firmware 1.8.6.0, Hardware 1.0 or 1.1 or 1.3	Voter Assist Terminal
DS850	Firmware 2.10.0.0, Hardware 1.0	Central Ballot Scanner
OKI Printer	B430dn or B431dn	Laser Report Printer
OKI Printer	Microline 420	Dot Matrix Printer
Headphones	Avid FV 60	Stereo Headphones
QR Code Scanner	Motorola Model DS9208	Bar code scanner
ElectionWare	4.6.0.0	EMS
ERM	8.11.0.0	EMS
ES&S Event Log Service	1.5.5.0	EMS
Removable Media Services	1.4.5.0	EMS
VAT Previewer	1.8.6.0	EMS
ExpressVote Previewer	1.4.0.0	EMS
EVS 5.2.0.0 Voting System Overview	5.0	TDP Document
EVS 5.2.0.0 System Functionality Description	4.0	TDP Document
ES&S ElectionWare Volume I: Administrator's Guide	3.0	TDP Document
ES&S ElectionWare Volume II: Define User's Guide	3.0	TDP Document
ES&S ElectionWare Volume III: Design User's Guide	2.0	TDP Document
ES&S ElectionWare Volume IV: Deliver User's Guide	4.0	TDP Document
ES&S ElectionWare Volume V: Results User's Guide	2.0	TDP Document
Election Reporting Manager User's Guide	6.0	TDP Document
ExpressVote Opererator's Guide	1.4	TDP Document
DS200 Opererator's Guide	5.0	TDP Document
DS850 Opererator's Guide	4.0	TDP Document
AutoMARK System Opererator's Guide	4.0	TDP Document
EVS 5.2.0.0 Network Setup Guide	1.1	TDP Document
ES&S EVS Event Logging Service User's Guide	3.0	TDP Document
EVS 5.2.0.0 Voting System Security Specification	4.0	TDP Document
EVS 5.2.0.0 Hardening Procedures for the Election System	1.2	TDP Document

4.0 TEST SPECIFICATIONS

NTS personnel will perform modification testing of the EVS 5.2.0.0 in the configuration submitted to the EAC in application ESS1303. NTS personnel will ensure that all certification testing conducted on the manufacturer's voting system follows NTS' procedures for testing and that specific test cases are used to ensure the requirements of the EAC 2005 VVSG and EAC Testing and Certification Program Manual are met.

All RFI's and NOC's applicable as of the date of this document shall apply to this test campaign unless otherwise noted.

4.1 Requirements (Strategy of Evaluation)

To evaluate the system test requirements, each section of the EAC 2005 VVSG will be analyzed to determine the applicable tests. The EAC 2005 VVSG requirements, along with the strategy for evaluation, are described below:

Section 2: Functional Requirements – The requirements in this section will be tested during the FCA and System Integration tests utilizing the "NTS Baseline Test Cases" along with test cases specially designed for the ES&S EVS 5.2.0.0 per sections 4.4.3 and 4.4.4. The data input during these tests will be the predefined election definitions submitted as part of the test plan package.

Section 3: Usability and Accessibility – The requirements in this section will be tested during this test campaign on the ExpressVote. During this test campaign, the ExpressVote will be verified that it meets the Usability and Accessibility requirements of the 2005 VVSG.

Section 5: Software Requirements – The requirements in this section will be tested during source code review, TDP review, and FCA. A combination of review and functional testing will be performed to ensure these requirements are met.

Section 7: Security Requirements – The requirements in this section will be tested during source code review, FCA, and security tests.

Section 8: Quality Assurance (QA) Requirements – The requirements in this section shall be tested throughout the test campaign using various methods. A TDP review shall be performed on ES&S QA documentation to determine compliance to EAC 2005 VVSG requirements. All source code shall be checked to ensure that proper QA documentation has been completed. All equipment received for initial testing and follow-up testing shall be checked against ES&S documentation to ensure their QA process is being followed. NTS personnel will complete the requirements of EAC 2005 VVSG Vol. 2, Section 7, "Quality Assurance Testing" and Section 1.3.1.5, "Focus of Vendor Documentation" that requires NTS personnel to physically examine documents at ES&S's location or conduct an external evaluation utilizing equipment, documents, and support information provided by ES&S during the test campaign. NTS may also choose to interview ES&S's QA staff for further evaluation.

Section 9: Configuration Management (CM) Requirements – The requirements in this section shall be tested throughout the test campaign. The TDP review shall be performed on the ES&S configuration management documentation to determine EAC 2005 VVSG compliance and to further determine whether ES&S is following its documented CM requirements within the TDP. Any anomalies shall be formally reported to ES&S and the EAC. NTS personnel will conduct an audit of the ES&S CM Program at the ES&S facility at the conclusion of the test campaign.

4.0   TEST SPECIFICATIONS (Continued)

4.1   Requirements (Strategy of Evaluation) (Continued)

NTS personnel shall maintain a test log of the procedure(s) employed. This log identifies the system and equipment by model and serial number. In the event that the project engineer deems it necessary to deviate from NTS Test Cases or NTS Operating Procedures (OP) pertaining to the test environment, the equipment arrangement and method of operation, the specified test procedure, or the provision of test instrumentation and facilities shall be recorded in the test log. A discussion of the reasons for the deviation and the effect of the deviation on the validity of the test procedure shall also be completed by the Project Engineer and Program Manager.

NTS personnel utilize an internal bug tracking system in order to capture and track all issues and discrepancies found during the testing campaign. This allows for all issues and discrepancies to be monitored for reoccurrence, tracks the root cause analysis, and provides a resolution status. NTS personnel shall verify all items logged into the bug tracking system are resolved prior to the completion of testing and before any recommendation may be made for certification.

The specific NTS OPs to be used during testing include the following:

OP 1 Operations Status Checks	OP 25 Physical Configuration Audit
OP 2 Receipt Inspection	OP 26 Functional Configuration Audit
OP 3 Technical Data Package Review	OP 27 Maintainability
OP 4 Test Plan Preparation *(This document)*	OP 28 Availability
OP 5a-d Source Code Review	OP 29 Electrical Supply
OP 6a-d Security	OP 30 System Integration Test
OP 7 Trusted Build	OP 34 Test Report
OP 22 Acoustic Test	OP 36 Vote Recording Requirements
OP 24-1a-g Usability	OP 40 Volume and Stress
OP 24-2a-h Accessibility	OP 41 Logic & Accuracy

(The remainder of this page intentionally left blank)

4.0   TEST SPECIFICATIONS (Continued)

4.2   **Hardware Configuration and Design**

The EVS 5.2.0.0 voting system is a paper-based precinct voting system using touch-screen and scan technology to scan and validate ballots, provide voter-assisted ballots, and tabulate precinct results. The precinct counting device is the DS200 which is responsible for scanning, validating and tabulating voter ballots. EVS 5.2.0.0 voting system contains multiple voter assistance terminals. It can be configured with the AutoMARK Model A100, A200, A300, or ExpressVote to accommodate special needs voters. The DS850 central count is a high-speed digital scanner that processes large ballot batches at a central location. All EMS functions are handled by proprietary software running on COTS PC/laptops/servers which are listed in section 3.2. NTS has determined that these COTS PC/laptops/servers are not subject to hardware testing per the EAC 2005 VVSG, because all contained CE, UL, and FCC labeling. The Election Management System (EMS) is an application suite consisting of ElectionWare, Election Reporting Manager (ERM), Removable Media Service (RMS), ES&S Event Log Service (CELS), ExpressVote Previewer, and VAT Previewer.

Each unit will be loaded with the Operational Status Check election definition configured for early voting. This will allow all the data generated for the Pre-operational, Operational, and Post-operational test to be further analyzed, compiled and included in the Reliability and Availability Test results.

4.3   **Software System Functions**

The EVS 5.2.0.0 voting system software is comprised of multiple applications written in numerous languages. The system software is broken down into four areas: EMS, Precinct tabulator software acting as firmware, central count software running as firmware, and ADA device software running as firmware. The main components and their subcomponents are as follows:

- ElectionWare (Java)
- ElectionWare/SQL
- ElectionWare PaperBallot
- ERM
- Event Log Service
- Removable Media Service
- VAT Previewer
- ExpressVote Previewer
- DS200
- DS850
- AutoMARK
- ExpressVote

4.4   **Test Case Design**

NTS uses the V-Model Life Cycle as defined by the Institute of Electrical and Electronics Engineers (IEEE). The IEEE definition of the V-Model Life Cycle uses two concepts "Verification" and "Validation." NTS' test approach is to incorporate the use of both "Verification" and "Validation". There are four basic levels of testing in the V-Model Life Cycle: Component, Integration, System, and Acceptance. NTS will be evaluating the ES&S EVS 5.2.0.0 to all four levels.

(The remainder of this page intentionally left blank)

4.0   TEST SPECIFICATIONS (Continued)

4.4   Test Case Design (Continued)

4.4.1   Hardware Qualitative Examination Design

ES&S submitted the results of previous testing in the form of the following test reports:

- Hardware Compliance Testing of the Election Systems & Software FL EVS 4.5.0.0 voting system DS200 Hardware Version 1.3, Wyle Test Report No. T71013.01-01

- Hardware Compliance Testing of the Election Systems & Software FL EVS 4.5.0.0 voting system ExpressVote Hardware Version 1.0, Wyle Test Report No. T71013.02-01

NTS personnel performed a hardware qualitative examination to 1) assess if the testing was performed under the guidelines of the EAC program, 2) assess if the tests were performed per the EAC 2005 VVSG, and 3) determine if the scope of the engineering changes were implemented since test performance. The results from this examination deemed that the hardware testing performed under the T71013.01-01 and T71013.02-01 campaigns were tested to the EAC 2005 VVSG and in accordance with the EAC Testing and Certification Program Manual. NTS recommends that reuse be approved for all hardware test requirements.

The summary of acceptable testing is provided in Table 4-1. NTS will verify all hardware during the PCA and those results will determine if the hardware is compliant with the previous tested versions. All testing that is deemed rejected shall be performed by NTS personnel under this test campaign. The details of those tests are presented in Section 6.0.

(The remainder of this page intentionally left blank)

4.0   TEST SPECIFICATIONS (Continued)

4.4   Test Case Design (Continued)

4.4.1   Hardware Qualitative Examination Design (continued)

Table 4-1 Hardware Test Examination Results

Test/EAC 2005 VVSG Section	Procedure/Description	EVS 5.2.0.0 Voting System Component	
		ExpressVote HW 1.0	DS200 HW 1.3
Electromagnetic Radiation/4.1.2.9	FCC Part 15 Class B for both radiated and conducted emissions	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Low Temperature/4.1.2.14	MIL-STD-810D minimum temperature shall he -4 degrees F	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Vibration/4.1.2.14	MIL-STD-810D, Method 514.3 physical shock and vibration during handling and transport	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Lightning Surge/4.1.2.7	IEC 61000-4-5 (1995-02)	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
High Temperature/4.1.2.14	MIL-STD-810D, Method 501.2 maximum temperature shall be 140 degrees F	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Bench Handling	MIL-STD-810D, Method 516.3 Procedure VI six 4" drops on each edge totaling 24 drops	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Electrical Fast Transient/4.1.2.6	IEC 61000-4-4 (2004)	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Humidity Test/4.1.2.14	MIL-STD-810D, Method 501.2 ten 24 hour humidity cycles	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Electrostatic Disruption/4.1.2.8	IEC 61000-4-2 (1995-01) 15kV air discharge and 8kV contact discharge	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Electromagnetic Susceptibility/4.1.2.10	IEC 61000-4-3 (2006) electromagnetic field of 10V/m modulated by a 1kHZ, 80% AM modulation at 80MHz to 1000MHz frequency	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Conducted RF Immunity/4.1.2.11	IEC 61000-4-6 (1996-04) conducted radio frequency energy	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Magnetic Fields Immunity/4.1.2.12	IEC 61000-4-8 (1993-06) AC magnetic fields of 30 A/m at 60Hz	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Electrical Power Disturbance/4.1.2.5	IEC 61000-4-11 (1994-06) power surges and dips	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Temperature/Power Variation/4.1.2.13	MIL-STD-810D, Method 502.2 and Method 501.2 163 hours at 50 degrees to 95 degrees	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0
Safety/4.3.8	UL 60950-1 product safety review	Accept FL EVS 4.5.0.0	Accept FL EVS 4.5.0.0

(The remainder of this page intentionally left blank)

4.0 TEST SPECIFICATIONS (Continued)

4.4 Test Case Design (Continued)

4.4.2 Hardware Environmental Test Case Design

The EVS 5.2.0.0 voting system hardware was tested by NTS' EMI, Dynamics, and Environmental test facilities for testing to the hardware requirements in accordance with NTS' A2LA certifications 845.01-.03. All EMI testing was performed, per the following NTS Test Guidelines Documents: EMI-001A, "NTS' Test Guidelines for Performing Electromagnetic Interference (EMI) Testing," and EMI-002A, "Test Procedure for Testing and Documentation of Radiated and Conducted Emissions Performed on Commercial Products." All hardware testing was per the guidelines of ANSI/NCSL Z540-1, "Calibration Laboratories and Measuring and Test Equipment, General Requirements," and ISO 10012-1, "Quality Assurance Requirements for Measuring Equipment", and the governing MIL-STD. All pre/post tests were conducted by qualified NTS personnel at the NTS Huntsville, AL, facility.

4.4.3 Software Module Test Case Design and Data

NTS personnel implements Component Level Testing during the FCA for each component and subcomponent exercising the functionality of each as designed and documented. NTS will utilize limited structural-based techniques (white-box testing) mainly in the area of Source Code Review, Compliance Builds, and Security Testing and Review. NTS will depend heavily on specification-based techniques (black-box testing) for the individual software components. The most common specification-based techniques applied to the ES&S EVS 5.2.0.0 during software testing will be "equivalence partitioning" and "boundary value testing."

- "Equivalence partitioning" will be used to evaluate specific software functions and data entry points of the EVS 5.2.0.0 for valid and invalid data during the FCA. For software functions and data entry points, an entry will be made for a valid data requirement and at least one invalid data requirement to test for normal and abnormal conditions.

- "Boundary Value Testing" will be used to evaluate specific software functions and data entry points for minimums and maximums during the FCA. For software functions and data entry points, an entry will be made for all minimum and all maximum documented requirements to test for normal and abnormal conditions. This technique will be used for numeric ranges as well as non-numeric ranges.

NTS personnel will document an expected result for each test. The ACCEPT/REJECT criteria at the Component Level will be based on the expected result. If the System Under Test (SUT) performs as expected, the results will be accepted. If the SUT does not perform as expected, the test will be evaluated for tester errors, test procedure errors, or test equipment errors. If it is determined there were no tester errors, test procedure errors, or test equipment errors, the test will be repeated in an attempt to reproduce the results. If the results can be reproduced and the expected results are not met, the SUT will have failed the test. If the results cannot be reproduced, the manufacturer and VSTL will determine the root cause of the error. If the root cause has been corrected and the SUT performs as expected, then the results will be accepted. If the root cause cannot be determined, the problem has not been corrected, or the SUT still does not perform as expected, the SUT will have failed the test.

4.0   TEST SPECIFICATIONS (Continued)

4.4   **Test Case Design (Continued)**

4.4.3   **Software Module Test Case Design and Data (Continued)**

NTS personnel will document the error and track the error through resolution. NTS personnel will not move to the next level of testing until all documented errors are resolved to try and minimize errors that might occur farther along in the test campaign. Engineering analysis will be performed to determine what effect the resolution has on the component. A determination will be made whether Regression Testing will be sufficient or a complete re-test is necessary.

4.4.4   **Software Functional Test Case Design and Data**

The test approach to be used for the ES&S EVS 5.2.0.0 will be a bottom-up approach where the lower-level components will be tested first and then used to facilitate the testing of higher-level components. The specification-based technique used by NTS personnel at the Integration Level is "Use Case." The actors that have been identified to use the ES&S EVS 5.2.0.0 are:

- Election Administrator – The actor with responsibility of entering the election definition with translation and audio. This actor is also responsible for maintaining EMS users and the election database.

- Warehouse Technician-The actor responsible for loading the election definition onto DS200, AutoMARK, ExpressVote, and DS850. This actor also runs diagnostic test and maintains the units.

- Poll Worker-The actor at the precinct location to set up and close down the DS200, AutoMARK, EspressVote and DS850 on election day.

- Voter-The actor who physically casts the ballot on election day.

- ADA Voter-The actor with special needs who has to vote unassisted on election day.

- Election Official-The actor who reports and audits the election result post-election day.

"Use Case" will be utilized during the FCA with a single pass through each component using only valid data. This pass will be considered the "Master Copy" of data to be passed between interfacing points of applications during integration level testing. If a component downstream in the test process needs data from previous processes, the "Master Copy" of data can be used or altered to accelerate the test process. Known tests that will utilize the "Master Copy" of data at the Integration Level are Security and Usability.

If an error occurs between data interfaces or in the process flow, an engineering analysis will be performed to determine if the error is data, process, or tester error. The ACCEPT/REJECT criteria for integration level testing is whether the components and applications interface using the documented process for each actor. If there is an error interfacing between components, the error shall be documented and tracked through resolution. Engineering analysis shall be performed to determine what effect the resolution has on the component. A determination will be made whether regression testing will be sufficient or a complete re-test is necessary.

4.0 **TEST SPECIFICATIONS** (Continued)

4.4 **Test Case Design** (Continued)

4.4.5 **System Level Test Case Design**

During system level testing, NTS personnel will test the ability of proprietary software, hardware, and peripherals in addition to the COTS software, hardware, and peripherals as a complete system in a configuration of the systems for intended use. The EVS 5.2.0.0 voting system is intended to support both large and small jurisdictions. NTS personnel's approach for the EVS 5.2.0.0 voting system will be to execute System Level Testing with a variety of elections that include various combinations of jurisdictions, parties, and ballot styles.

The ACCEPT/REJECT criteria for system level testing is whether the system can continue in testing. The two scenarios are: ACCEPT or REJECT. ACCEPT is either 1) no errors are found, or 2) an error is encountered but the system continues to operate and engineering analysis determines that the root cause does not affect system testing. REJECT is when an error is encountered and the system is too unstable to continue or engineering analysis determines the root cause could affect further testing. If an error occurs during system level testing, the error shall be documented. If the EVS 5.2.0.0 voting system is able to recover and continue, the test will continue. If the error causes the system to become unstable, the test shall be halted. All errors documented during System Level Testing shall be tracked through resolution.

An engineering analysis shall be performed to determine what effect the resolution has on the system. A determination shall be made by NTS senior level engineers whether regression testing shall be sufficient or a complete re-test is necessary.

NTS personnel will implement acceptance level testing focusing on all the data collected during the entire test campaign along with performing the "Trusted Build" for the system. All data from hardware testing, software testing, functional testing, security testing, volume testing, stress testing, telecommunication testing, usability testing, accessibility testing, and reliability testing activities will be combined to ensure all functions supported by the EVS 5.2.0.0 voting system have been tested. The EAC 2005 VVSG requirements will be checked against the test data to ensure all applicable requirements are met. Items not supported by the EVS 5.2.0.0 voting system will be documented. Any issues documented during testing will be resolved or annotated in the test report.

NTS personnel will test every EAC 2005 VVSG requirement impacted by the EVS 5.2.0.0 voting system modification. NTS personnel will report all issues discovered during this test campaign to ES&S and the EAC. If NTS determines there is not enough data to ensure a requirement was met, the test plan will be altered and further testing will be done. The EAC has the final decision as to whether the system meets all the requirements for an EAC-certified system. NTS will either recommend approval, if the system meets all applicable sections of the VVSG, or recommend disapproval if the system does not meet all applicable sections of the VVSG.

(The remainder of this page intentionally left blank)

4.0   TEST SPECIFICATIONS (Continued)

4.5   **Security Functions**

The purpose of security testing shall be to evaluate the effectiveness of the EVS 5.2.0.0 voting system in detecting, preventing, logging, reporting, and recovering from any security risks identified by simulating attacks on the system; NTS personnel have developed internal operating procedures to evaluate the EVS 5.2.0.0 voting system to the security requirements set forth in the EAC 2005 VVSG. These procedures have been specifically tailored to assess the EVS 5.2.0.0 voting system to the applicable requirements. NTS personnel will attempt to defeat the access controls and physical security measures documented in the ES&S technical data package. A threat matrix shall be created to determine the risks and vulnerabilities.

NTS personnel will utilize a combination of functional testing, source code review, and Fortify SCA to evaluate the EVS 5.2.0.0 voting system. NTS personnel will report all issues discovered during this test campaign to ES&S and the EAC. A report containing all findings shall be issued to the EAC as an addendum to the final test report.

4.6   **TDP Evaluation**

NTS qualified personnel will perform a comprehensive review of the ES&S TDP to determine compliance to the EAC 2005 VVSG requirements and ES&S specific requirements.

NTS qualified personnel utilize a TDP Review Matrix which lists every EAC 2005 VVSG requirement pertaining to TDP review. NTS qualified personnel will record the results of the review of each document to the applicable requirements listed in the TDP Review Matrix.

During the TDP review process, each document will be reviewed for completeness, clarity, correctness, and continuity. The review results will be formally reported to ES&S. If a revised document is received, it will be re-reviewed as discussed in this section. The TDP will be continued to be reviewed during the entire testing process as these documents will be utilized to set up the systems, verify correct operational results and numerous other tests. At the end of the TDP review process, a Discrepancy Report will be issued listing the non-compliant items on a document-by-document basis, if applicable. A listing of all documents contained in the EVS 5.2.0.0 voting system TDP is provided in Table 4-2.

(The remainder of this page intentionally left blank)

4.0   TEST SPECIFICATIONS (Continued)

4.6   TDP Evaluation (Continued)

Table 4-2 EVS 5.2.0.0 Voting System TDP Documents

EVS 5.2.0.0 TDP Documents	Version	Doc No.	Document Code
System Overview			
Voting System Overview	9.0	01-01	EVS5200_C_D_0100_SysOvr
System Functionality Description			
System Functionality Description – Voting System	6.0	02-01	EVS5200_C_D_0200_SFD
System Hardware Specification			
System Hardware Specification – DS200 Hardware Revision 1.2	3.0	03-01	DS200HW_M_SPC_0312_HWSpec
System Hardware Specification – DS200 Hardware Revision 1.3	4.0	03-02	DS200HW_M_SPC_0313_HWSpec
System Hardware Specification – DS850	1.1	03-03	DS850HW_M_SPC_0310_HWSpec
ExpressVote Hardware Specification	3.0	03-04	ExpressVoteHW_M_SPC_0310_HWSpec
AutoMARK System Hardware Overview	3.0	03-05-01	AutoMARK_ESS_System_Hardware_Overview_AQS-18-5002-000-S
AutoMARK System Hardware Specification	3.0	03-05-02	AutoMARK_ESS_System_Hardware_Specification_AQS-18-5000-001-F
Software Design and Specification			
Software Design and Specification – ES&S Event Log Service	1.0	04-01	EVS5200_SDS00_ELS
Software Design and Specification - ElectionWare	2.0	04-02	EVS5200_SDS00_Electionware
Software Design and Specification – ERM	2.0	04-03	EVS5200_SDS00_ERM
ES&S Software Design Specifications ERM Appendices	2.0	04-03-01	EVS5200_SDS00_ERM01_Appendices
Software Design and Specification – DS850	2.0	04-04	EVS5200_SDS00_DS850
DS200 Software Design and Specification	4.0	04-05	EVS5200_D_SDS00_DS200
ExpressVote Software Design and Specification	3.0	04-06	EVS5200_D_SDS00_ExpressVote
Software Design and Specification – AutoMARK	1.8	04-07	AutoMARK ESS Software Design Specifications Overview
AutoMARK Operating Software Design Specifications	5.0	04-07-01	AQS-18-5001-002-R
AutoMARK Ballot processing Specifications	3.0	04-07-01	AQS-18-5002-003-S
AutoMARK Software Design Specifications	5.0	04-07-01	AQS-18-5001-004-S
AutoMARK Software Development Environment	5.0	04-07-01	AQS-18-5001-006-R
AutoMARK Graphical User Interface Specifications	6.0	04-07-01	AQS-18-5001-005-R
AutoMARK Software Diagnostics Specifications	5.0	04-07-01	AQS-18-5000-004-F
AutoMARK Embedded Database Interface Specifications	5.0	04-07-01	AQS-18-5002-005-S
AutoMARK Ballot Scanning and Printing Specifications	5.0	04-07-01	AQS-18-5002-007-S
AutoMARK Driver API Specifications	5.0	04-07-01	AQS-18-5000-002-F
AutoMARK Programming Specifications Details	5.0	04-07-01	AQS-18-5001-011-R

4.0 TEST SPECIFICATIONS (Continued)

4.6 TDP Evaluation (Continued)

Table 4-2 EVS 5.2.0.0 Voting System TDP Documents (Continued)

EVS 5.2.0.0 TDP Documents	Version	Doc No.	Document Code
Software Design and Specification continued)			
AutoMARK ESS Software Standards Specification	5.0	04-07-01	AQS-18-4000-000-S
AutoMARK ESS Operations and Diagnostic Log Specs	5.0	04-07-01	AQS-18-5002-004-S
ES&S System Development Program	2.0	04-08	ESSSYS_SG_P_0400_SystemDevProgram
Coding Standards	3.0	04-09	ESSSYS_D_P_0400_CodingStandards
System Test/Verification Specification			
Voting System Test Plan ES&S Voting System 5.2.0.0	2.0	05-01	EVS5200_QA_D_0500_SysTestPlan
CIF Usability Test Reports ExpressVote	1.0	05-02-01	ExpressVoteHW_P_D_0509_CIFRptExpressVote
ES&S AutoMARK Voter Assist Terminal (VAT)	1.x	05-02-02	AMVATHW_P_D_0510_CIFRptAMVAT
DS200 Precinct Ballot Scanner	1.2.1	05-02-03	DS200HW_P_D_0512_CIFRptDS200
System Security Specification			
Voting System Security Specification	4.0	06-01	EVS5200_CM_SPC00_SysSecuritySpec
Hardening Procedures for the Election System	1.2	06-02	EVS5200_CM_SPC01_HardeningProcedures
Security Script Description	1.1	06-03	EVS5200_CM_SPC02_SecScriptDesc
AutoMark System Security Specifications	6.0	06-04	AutoMARK ESS System Security Specification AQS-18-5002-001-S
System Operations Procedure			
Network Setup Guide	1.2	07-01	EVS5200_CM_SOP_NetworkConfigGuide
AutoMARK System Operator's Guide	4.0	07-02	EVS5200_DOC_SOP_AMVAT
DS200 Operator's Guide	6.00	07-03	EVS5200_DOC_SOP_DS200
DS850 Operator's Guide	4.0	07-04	EVS5200_DOC_SOP_DS850
EVS Event Logging Service	3.0	07-05	EVS5200_DOC_SOP_ELS
Election Reporting Manager User's Guide	7.0	07-06	EVS5200_DOC_SOP_ERM
Electionware Volume I: Administrator's Guide	4.0	07-07	EVS5200_DOC_SOP_EW01Admin
Electionware Volume II: Define User's Guide	5.0	07-08	EVS5200_DOC_SOP_EW02Define
Electionware Volume III: Design User's Guide	3.0	07-09	EVS5200_DOC_SOP_EW03Design
Electionware Volume IV: Deliver User's Guide	4.0	07-10	EVS5200_DOC_SOP_EW04Deliver
Electionware Volume V: Results User's Guide	3.0	07-11	EVS5200_DOC_SOP_EW05Results
ExpressPass Operator's Guide	4.0	07-12	EVS5200_DOC_SOP_ExpressPass
ExpressVote Operator's Guide	4.0	07-13	EVS5200_DOC_SOP_ExpressVote
System Maintenance Manuals			
AutoMARK System Maintenance Manual	2.1	08-01	EVS5200_DOC_SMM_AMVAT
DS200 Maintenance Guide	2.0	08-02	EVS5200_DOC_SMM_DS200
DS850 Maintenance Guide	3.0	08-03	EVS5200_DOC_SMM_DS850
ExpressVote Maintenance Guide	2.3	08-04	EVS5200_DOC_SMM_ExpressVote
Personnel Deployment and Training			
Personnel Deployment and Training Program	3.0	09-01	ESSSYS_T_D_0900_TrainingProgram
Configuration Management Plan			
Configuration Management Plan	2.0	10-1	ESSSYS_CM_P_1000_CMProgram
ES&S Technical Documentation Program	5.0	10-2	ESSSYS_DOC_P_1000_TDPProgram

4.0   TEST SPECIFICATIONS (Continued)

4.6   TDP Evaluation (Continued)

Table 4-2 EVS 5.2.0.0 Voting System TDP Documents (Continued)

EVS 5.2.0.0 TDP Documents	Version	Doc No.	Document Code
QA Program			
Manufacturing Quality Assurance Plan	2.0	11-01	ESSSYS_M_P_1100_MNFQuality AssurancePlan
ES&S 1.3 Hardware DS200 Acceptance Checklist	A	11-01-01	1_3_Hardware DS200_AcceptChklst_001RevA
DS850 Acceptance checklist	D	11-01-01	850_AcceptChklst_revD
DS850 Onsite Acceptance Checklist	B	11-01-01	850_OAcceptChklst_revB
Acceptance Checklist AutoMARK Voter Assist Terminal	A	11-01-01	AutoMark_AcceptChklst_001_Rev_A
AutoMARK QC Checklist	A	11-01-01	AutoMark_QC_Chklst_001Rev.A
ES&S DS200 Acceptance Checklist	D	11-01-01	DS200_AcceptChklst_001RevD
ES&S ExpressVote Acceptance Checklist	B	11-01-01	ExpressVote_AcceptChcklst_001Rev_B
Software Quality Assurance Program	2.0	11-02	ESSSYS_QA_P_1100_SoftwareQuality AssuranceProgram
ES&S Software/Firmware Acceptance	2.0	11-02-01	ESSSYS_QA_L_1100_SoftwareFirmware Acceptance
System Change Notes			
System Change Notes	10.0	12-01	EVS5200_DOC_D_1200_ChangeNotes
Other TDP Documents			
ES&S Ballot Production Guide	2.1	13-01	EVS5200_DOC_SOP_11_BPG

(The remainder of this page intentionally left blank)

4.0   TEST SPECIFICATIONS (Continued)

4.7   **Source Code Review**

The strategy for evaluating EVS 5.2.0.0 will be based on the source code of the previously identified modifications to the system. All code changes from EVS 5.0.0.0 will be reviewed to the EAC 2005 VVSG coding standards and the manufacturer-supplied coding standards located within the TDP under ESSSYS_D_D_0100_Coding Standards.

As the source code is received, a SHA256 hash value will be created for each source code file. NTS source code team will conduct a manual line by line review for every line of modified or new source code for acceptance for all languages other than Java. For applications written in Java, NTS personnel will utilize automated tools (Checkstyle and NetBeans) to augment source code review. NTS personnel will perform a manual 10% review of all automated source code review. This is done to verify compliance of EAC 2005 VVSG coding standards and manufacturer supplied coding standards. Each identified violation shall be recorded by making notes of the standards violation along with directory name, file name, and line number

A technical report of all identified violations will be sent to ES&S for resolution on a regular basis. All revised source code will be checked for corrections until the final issue is resolved. At the end of the Source Code review process, a Discrepancy Report will be issued listing all non-compliance, to the EAC and ES&S. The results will be included in the final test report.

A "Compliance Build" shall be performed by NTS qualified personnel from the reviewed source code using the Compliance Build Procedure throughout the test campaign. This process follows the documented procedures of a "Trusted Build" in the EAC Testing and Certification Program Manual, Version 1.0, but differs from a Trusted Build with two exceptions: The image products will not be submitted to the EAC, and no manufacturer representative shall be required to be present or on-site for these builds. The final step in the source code review shall be to create a Trusted Build from the reviewed source code. The Trusted Build will be performed by completing the following tasks in the order listed:

1. Clean the build machine of existing software
2. Retrieve the compliant source code
3. Construct the build environment
4. Create digital signatures of the build environment
5. Load the compliant source code into the build environment
6. Create a digital signature of the pre build environment
7. Create a disk image of the pre-build environment
8. Build executable code
9. Create a digital signature of executable code
10. Create a disk image of the post-build environment
11. Build installation media
12. Create a digital signature of the installation media
13. Install executable code onto the system and validate the software/firmware
14. Deliver source code with digital signature, disk image of pre-build environment with digital signatures, disk image of post-build environment with digital signatures, executable code with digital signatures, and installation media with signatures to the EAC Approved Repository.

(The remainder of this page intentionally left blank)

4.0   TEST SPECIFICATIONS (Continued)

4.7   **Source Code Review (Continued)**

The "Trusted Build" for the ES&S EVS 5.2.0.0 includes source code, data, and script files, in clear text form. The build also includes COTS software on commercially available media, COTS software downloaded by the VSTL, COTS software verified by SHA256 from the software supplier, and picture and sound files in binary format provided by ES&S. The first step of the process is to clean the hard drives by writing data to every spot on the hard drive, so the drive is cleared of existing data. The appropriate operating system will then be loaded and the applications from the VSTL reviewed source files along with the VSTL verified COTS software will be built. The final step is installing the applications on the hardware.

4.8   **QA and CM System Review**

Both the ES&S QA Plan and CM Plan will be reviewed. The review will be limited to only the changes within this modification to determine compliance with EAC 2005 VVSG Volume II Section 2, and Volume I Sections 8 and 9, EAC stated requirements, and with the requirements of the internal ES&S documentation. Also, the ES&S TDP documentation package will be reviewed to determine if the ES&S QA Plan and the CM Plan are being followed. The results of the TDP review shall be entered on a spreadsheet as previously described in Section 4.6 of this test plan. The results of the TDP review, including the QA and CM compliance results of the Technical Data Package Review, will be included in the final test report.

5.0   TEST DATA

5.1   **Test Data Recording**

All equipment utilized for test data recording shall be identified in the test data package. For hardware environmental and operational testing, the equipment shall be listed on the Instrumentation Equipment Sheet for each test. The output test data shall be recorded in an appropriate manner as to allow for data analysis. For source code and TDP reviews, results shall be compiled in output reports and submitted to ES&S for resolution.

Additionally, all test results, including functional test data, will be recorded on the relevant NTS Operating Procedure and Test Cases. Results will also be recorded real-time in engineering log books. Incremental reports will be submitted to ES&S and the EAC at the completion of major test areas to communicate progress and results as deemed necessary by the stakeholders.

5.2   **Test Data Criteria**

NTS personnel will evaluate all test results against the ES&S provided technical documentation for EVS 5.2.0.0 and the requirements set forth in the EAC 2005 VVSG. The acceptable range for system performance and the expected results for each test case shall be derived from the EVS 5.2.0.0 documentation. Per the EAC 2005 VVSG, these parameters shall encompass the test tolerances and samples to define the minimum number of combinations or alternatives of input and output conditions that can be exercised to constitute an acceptable test of the parameters involved. The parameters will also include events with criteria defining the maximum number of interrupts, halts, or other system breaks that may occur due to non-test conditions (excluding events from which recovery occurs automatically or where a relevant status message is displayed).

5.3   **Test Data Reduction**

Test data shall be processed and recorded in the relevant NTS Operating Procedures and Test Cases. Results will also be recorded real-time in engineering log books.

6.0 TEST PROCEDURES AND CONDITIONS

The following subsections describe test procedures and a statement of the criteria by which readiness and successful completion shall be indicated and measured.

6.1 Facility Requirements

All testing will be conducted at NTS Huntsville, AL facility unless otherwise annotated. Environmental non-operating (storage) and operating hardware testing will be conducted utilizing an adequately sized environmental test chamber or dynamic vibration (shaker) system equipped with the required data gathering support equipment. All remaining operating hardware tests will be conducted at the appropriate test site with the required support equipment. All instrumentation, measuring, and test equipment used in the performance of this test program will be listed on the Instrumentation Equipment Sheet for each test and shall be calibrated in accordance with NTS' Quality Assurance Program, which complies with the requirements of ANSI/NCSL Z540-1 and ISO 10012-1.

Standards used in performing all calibrations are traceable to the National Institute of Standards and Technology (NIST) by report number and date. When no national standards exist, the standards are traceable to international standards or the basis for calibration is otherwise documented.

Unless otherwise specified herein, all remaining tests, including system level functional testing, shall be performed at standard ambient conditions:

- Temperature: 68 to 75 degrees Fahrenheit ($\pm$ 4°F)
- Relative Humidity: 20 to 90%
- Atmospheric Pressure: Local Site Pressure

Unless otherwise specified herein, the following tolerances shall be used:

• Time	± 5%
• Temperature	± 3.6°F (2°C)
• Vibration Amplitude	± 10%
• Vibration Frequency	± 2%
• Random Vibration Acceleration	
20 to 500 Hertz	+ 1.5 dB
500 to 2000 Hertz	± 3.0 dB
• Random Overall grms	± 1.5 dB
• Acoustic Overall Sound Pressure Level	+4/-2 dB

Deviations to the above tolerances may be submitted by the responsible test laboratory with sufficient engineering information to substantiate the deviation request, but only when best effort technique and system limitations indicate the need for a deviation.

(The remainder of this page intentionally left blank)

6.0 TEST PROCEDURES AND CONDITIONS (Continued)

6.2 Test Set-Up

All voting machine equipment (hardware and software), shall be received and documented utilizing NTS' Receiving Ticket (WL-218, Nov. '85) and proper QA procedures. When voting system hardware is received, NTS personnel will notify NTS QA personnel. With NTS QA personnel present, each test article will be unpacked and inspected for obvious signs of degradation and/or damage that may have occurred during transit. Noticeable degradation and/or damage, if present, shall be recorded, photographed, and the ES&S Representative shall be notified. NTS QA personnel shall record the serial numbers and part numbers. Comparison shall be made between those numbers recorded and those listed on the shipper's manifest. Any discrepancies noted shall be brought to the attention of the ES&S representative for resolution. All TDP and source code modules received will be inventoried and maintained by the NTS Project Engineer assigned to testing.

For test setup, the system will be configured as it would for normal field use. This includes connecting all supporting equipment and peripherals. NTS personnel will properly configure and initialize the system, and verify that it is ready to be tested by following the procedures detailed in the EVS 5.2.0.0 voting system technical documentation. NTS personnel will develop an Operational Status Check to be performed prior to and immediately following each hardware test. NTS personnel will develop the system performance levels to be measured during operational tests.

NTS personnel have developed eight election definitions that shall be used during this test campaign:

Operational Status Check

This election definition will be used to verify that the equipment operates properly prior to and immediately following the execution of all tests.

Accuracy

The accuracy test ensures that each component of the voting system can process 1,549,703 consecutive ballot positions correctly within the allowable target error rate. The accuracy test is designed to test the ability of the system to capture, record, store, consolidate and report specific selections and absences of a selection. The required accuracy is measured as an error rate. This rate is the maximum number of errors allowed while processing a specified volume of data. For paper-based voting systems, the ballot positions on a paper ballot must be scanned to detect selections for individual candidates and contests and the conversion of those selections detected on the paper ballot converted into digital data.

(The remainder of this page intentionally left blank)

6.0   TEST PROCEDURES AND CONDITIONS (Continued)

6.2   Test Set-Up (Continued)

<u>General Election: GEN-01</u>

The Gen-01 is a basic election held in four precincts, one of which is a split precinct, containing nineteen contests compiled into four ballot styles. Five of the contests are in all four ballot styles. The other fourteen contests are split between at least two of the precincts with a maximum of four different contests spread across the four precincts. This election was designed to functionally test the handling of multiple ballot styles, support for at least two languages, support for common voting variations, and audio support for at least two languages.

The parameters of this election are listed below:

- Closed Primary: No
- Open Primary: No
- Partisan offices: Yes
- Non-Partisan offices: Yes
- Write-in voting: Yes
- Primary presidential delegation nominations: No
- Ballot Rotation: Yes
- Straight Party voting: Yes
- Cross-party endorsement: No
- Split Precincts: Yes
- Vote for N of M: Yes
- Recall issues, with options: No
- Cumulative voting: No
- Ranked order voting: No
- Provisional or challenged ballots: Yes
- Early Voting: No

In addition to the parameters listed above, the following will also be tested:

- Audio input in an alternative language for basic voting pattern using an ADA device
- Audio input for write-in voting using an ADA device
- Spanish language input for a basic voting pattern
- Input for write-in voting using Spanish language

(The remainder of this page intentionally left blank)

6.0   TEST PROCEDURES AND CONDITIONS (Continued)

6.2   Test Set-Up (Continued)

<u>General Election: GEN-02</u>

The Gen-02 is a basic election held in three precincts. This election contains fifteen contests compiled into three ballot styles. Ten of the contests are in all three ballot styles with the other five split across the three precincts. This election was designed to functionally test the handling of multiple ballot styles, support for ballot rotation, support for two languages, support for complex voting variations, and audio support for multiple languages.

The parameters of this election are listed below:

- Closed Primary: No
- Open Primary: No
- Partisan offices: Yes
- Non-Partisan offices: Yes
- Write-in voting: Yes
- Primary presidential delegation nominations: No
- Ballot Rotation: Yes
- Straight Party voting: No
- Cross-party endorsement: No
- Split Precincts: No
- Vote for N of M: Yes
- Recall issues, with options: Yes
- Cumulative voting: No
- Ranked order voting: Yes
- Provisional or challenged ballots: No
- Early Voting: Yes

In addition to the parameters listed above, the following will also be tested:

- Early voting election with at least one unit in all precincts
- Voting options for over-voting
- Voting options for under-voting
- Spanish language ballots
- Audio ballots utilizing ADA capabilities

(The remainder of this page intentionally left blank)

6.0   TEST PROCEDURES AND CONDITIONS (Continued)

6.2   Test Set-Up (Continued)

<u>General Election: GEN-03</u>

The Gen-03 is a basic election held in two precincts. This election contains eight contests compiled into two ballot styles. Four of the contests are in both ballot styles. The other four contests are split between the two precincts. This election was designed to functionally test the handling of multiple ballot styles, support for at least three languages including a character-based language, support for common voting variations, and audio support for at least three languages and an ADA binary input device.

The parameters of this election are listed below:

- Closed Primary: No
- Open Primary: No
- Partisan offices: Yes
- Non-Partisan offices: Yes
- Write-in voting: Yes
- Primary presidential delegation nominations: No
- Ballot Rotation: No
- Straight Party voting: No
- Cross-party endorsement: No
- Split Precincts: No
- Vote for N of M: Yes
- Recall issues, with options: No
- Cumulative voting: No
- Ranked order voting: No
- Provisional or challenged ballots: Yes
- Early Voting: No

In addition to the parameters listed above, the following will also be tested:

- Spanish language ballot with a basic voting pattern and write-in candidates
- Spanish audio input to simulate ADA device with write-in option
- Character based language with basic voting pattern
- Character based language utilizing an ADA option
- Binary input to support ADA option
- Binary input to support ADA audio device

(The remainder of this page intentionally left blank)

6.0 TEST PROCEDURES AND CONDITIONS (Continued)

6.2 Test Set-Up (Continued)

<u>Primary Election: PRIM-01</u>

The Prim-01 is a closed primary election in two precincts (one precinct is a split), containing thirty contests compiled into five ballot styles. Each ballot style contains six contests. This election was designed to functionally test an open primary with multiple ballot styles, support for two languages, and support for common voting variations.

The parameters of this election are listed below:

- Closed Primary: Yes
- Open Primary: No
- Partisan offices: Yes
- Non-Partisan offices: Yes
- Write-in voting: Yes
- Primary presidential delegation nominations: No
- Ballot Rotation: No
- Straight Party voting: No
- Cross-party endorsement: No
- Split Precincts: Yes
- Vote for N of M: Yes
- Recall issues, with options: No
- Cumulative voting: No
- Ranked order voting: No
- Provisional or challenged ballots: Yes
- Early Voting: No

In addition to the parameters listed above, the following will also be tested:

- Alternative language utilized with a write-in option
- ADA audio device utilized with a write-in option

(The remainder of this page intentionally left blank)

6.0   TEST PROCEDURES AND CONDITIONS (Continued)

6.2   Test Set-Up (Continued)

Primary Election: PRIM-02

The Prim-02 is a basic election held in two precincts. This election contains thirteen contests compiled into three ballot styles. One contest is in all three ballot styles and all other contests are independent. This election was designed to functionally test the handling of multiple ballot styles, support for Primary presidential delegation nominations, support for two languages, support for complex voting variations, and audio support for multiple languages.

The parameters of this election are listed below:

- Closed Primary: No
- Open Primary: Yes
- Partisan offices: Yes
- Non-Partisan offices: Yes
- Write-in voting: Yes
- Primary presidential delegation nominations: No
- Ballot Rotation: No
- Straight Party voting: No
- Cross-party endorsement: Yes
- Split Precincts: No
- Vote for N of M: Yes
- Recall issues, with options: No
- Cumulative voting: No
- Ranked order voting: No
- Provisional or challenged ballots: No
- Early Voting: No

In addition to the parameters listed above, the following will also be tested:

- Open primary election with at least one machine in each precinct
- Voting options for over-voting
- Voting options for under-voting
- Voting option for write-ins
- Spanish language ballot
- Voting option utilizing ADA audio device

(The remainder of this page intentionally left blank)

6.0   TEST PROCEDURES AND CONDITIONS (Continued)

6.2   Test Set-Up (Continued)

<u>Primary Election: PRIM-03</u>

The Prim-03 is a basic election held in two precincts. This election contains ten contests and is compiled into two ballot styles. Two of the contests are in both ballot styles. The other eight contests are split between the two party ballots. This election was designed to functionally test the handling of multiple ballot styles, support for at least three languages including an Ideographic based language, support for common voting variations, and audio support for at least three languages and an ADA binary input device.

The parameters of this election are listed below:

- Closed Primary: Yes
- Open Primary: No
- Partisan offices: Yes
- Non-Partisan offices: Yes
- Write-in voting: Yes
- Primary presidential delegation nominations: No
- Ballot Rotation: No
- Straight Party voting: No
- Cross-party endorsement: No
- Split Precincts: No
- Vote for N of M: Yes
- Recall issues, with options: No
- Cumulative voting: No
- Ranked order voting: No
- Provisional or challenged ballots: Yes
- Early Voting: No

In addition to the parameters listed above, the following will also be tested:

- Spanish ballot with basic voting pattern and write-in option
- Spanish language ballot using ADA audio device with write-n option
- Character based language ballot with basic voting pattern
- Character based language utilizing ADA device
- Binary input to support ADA option
- Binary input to support ADA audio device

(The remainder of this page intentionally left blank)

6.0   TEST PROCEDURES AND CONDITIONS (Continued)

6.3   **Test Sequence**

The components of the EVS 5.2.0.0 voting system will undergo testing to verify that the modification performs as described by ES&S and meets the requirements of the 2005 VVSG. The following sections provide a list of each test and a brief description of each test. NTS personnel will utilize a combination of functional testing and TDP reviews to evaluate the system performance. (The tests are not in a specific sequence.)

6.3.1   **Hardware Test Descriptions**

All of the hardware tests have been previously performed during prior VSTL test campaigns with the exception of the following:

- Electrical Supply
- Maintainability

These tests will be performed during this test campaign.

6.3.2   **Software Test Descriptions**

The software tests include the following:

Source Code Compliance Review – NTS qualified personnel will compare the source code to the manufacturer's software design documentation to ascertain how completely the software conforms to the manufacturer's specifications. A listing of the TDP documents for Software Design and Specification can be found in Table 4-2 of this document. Source code inspection shall also assess the extent to which the code adheres to the requirements in Section 5 of the EAC 2005 VVSG Volumes I and II.

Compliance Build of the System Software, Firmware, and Utilities   Before testing can begin, compliance builds of all the applications will be constructed by NTS personnel using the build environment, build documentation, and reviewed source code. This is to ensure the software being tested is constructed from the same source code that was reviewed.

COTS Source Code Review – Unmodified, general purpose COTS non-voting software (e.g., operating systems, programming language compilers, database management systems, and web browsers) is not subject to the detailed examinations specified in this section; however, NTS personnel will examine such software to ensure that the specific version of software being used is identical to the design specification in order to confirm that the software has not been modified. NTS will verify by downloading the software directly from the manufacturer site, verifying against NRSL, or by being provided original OEM discs.

If there is COTS generated software source code, NTS qualified personnel will inspect the COTS generated software source code in preparation of test plans and to provide some minimal scanning or sampling to check for embedded code or unauthorized changes. For purposes of code analysis, the COTS units shall be treated as unexpanded macros. These will be identified in the Test Report.

The portions of COTS software that have been modified by the manufacturer in any manner are subject to review. Source code generated by a COTS package and embedded in software modules for compilation or interpretation will be provided in human readable form to NTS personnel to enable review.

6.0 TEST PROCEDURES AND CONDITIONS (Continued)

6.3.2 Software Test Description (Continued)

Baseline of EMS Operating and Build Machine OS – NTS personnel will review the submitted NIST SCAP FDCC checklist for the EMS Operating System and Build Machine OS ES&S. The review will be performed for completeness, clarity, and consistency.

Error Recovery Test – This will be tested to ensure that unit is capable of recovering from a non-catastrophic failure of a device, or from any error or malfunction that is within the operator's ability to correct and restore the device gracefully from the failures. Testing will include powering units off while operating, disconnecting various cables and components to ensure operation once restored.

Security Source Code Review – The security source code review is a detailed review of the functionality of the source code that has been submitted. A manual line by line review will be performed for all programming languages except Java. A manual line by line or an automated (Checksyle and Netbeans) review will be performed on Java.

Trusted Build – The trusted build is a process of converting the reviewed source code into machine-readable binary instructions for a computer. This test will follow Section 5.6 of the EAC Testing and Certification Program manual.

Table 6-1 EVS 5.2.0.0 Voting System Software Test Sequence

Test	Description	Procedure	Test Level	Specimen
Technical Data Package (TDP) Review	Documentation review for compliance, correctness, and completeness	WHVS07.1 OP 3	Document	TDP package
Compliance Source Code Review	Source code review for compliance	WHVS07.2 OP 5a	Component	Source Code
Physical Configuration Audit	Audit hardware and software models and versions	WHVS07.3 OP 25	Component & System	System hardware and software
Compliance Build	Using the build documents and source code to construct the EMS	WHVS07.3 OP 25	Component	Source Code
Functional Configuration Audit	Functional testing to the system documentation and EAC 2005 VVSG requirements	WHVS07.4 OP 26 OP30a	Component & Integration	System
Source Code COTS Review	Source code review to examine 3rd party products for modification and versions	WHVS07.2 OP 5d	Component	COTS Source Code
Baseline OS	RFI 2008-03 OS Configuration	WHVS07.3 OP 25	Component	NIST SCAP FDCC Checklist
Source Code Functional Review	Source code review for functionality and high level software design	WHVS07.2 OP5b	Component & Integration	Source Code
Source Code Security Review (manual)	Source code review for specific security concerns augmented by an automated review	WHVS07.2 OP5d OP 6a	Component & Integration	Source Code
Trusted Build	Creation and installation of the final system software	WHVS07.6 OP 7, OP 7a	Component	System software

6.0   TEST PROCEDURES AND CONDITIONS (Continued)

6.3.3   **System Testing**

Physical Configuration Audit – The Physical Configuration Audit compares the voting system components submitted for qualification to the manufacturer's technical documentation, and shall include the following activities:

- Establish a configuration baseline of software and hardware to be tested; confirm whether manufacturer's documentation is sufficient for the user to install, validate, operate, and maintain the voting system

- Verify software conforms to the manufacturer's specifications; inspect all records of manufacturer's release control system; if changes have been made to the baseline version, verify manufacturer's engineering and test data are for the software version submitted for certification

- If the hardware is non-COTS, NTS will review drawings, specifications, technical data, and test data associated with system hardware to establish system hardware baseline associated with software baseline

- Review manufacturer's documents of user acceptance test procedures and data against system's functional specifications; resolve any discrepancy or inadequacy in manufacturer's plan or data prior to beginning system integration functional and performance tests

- Subsequent changes to baseline software configuration made during testing, as well as system hardware changes that may produce a change in software operation are subject to re-examination

Functional Configuration Audit – The functional configuration audit encompasses an examination of manufacturer's tests, and the conduct of additional tests, to verify that the system hardware and software perform all the functions described in the manufacturer's documentation submitted in the TDP. In addition to functioning according to the manufacturer's documentation, tests will be conducted to insure all applicable EAC 2005 VVSG requirements are met. This testing is accomplished through a process called sequencing.

Sequencing is the act of navigating through the user interface to verify that the system performs as described by the manufacturer and does not violate any of the VVSG requirements. The path that the tester navigates follows the logical flow of accomplishing task required to conduct an election. For example, a task in conducting an election is to add a candidate. The tester will follow the flow of the user interface to add the candidate to a contest. If there are multiple ways to achieve this, then each method will be tested. This process will continue until all tasks for conducting an election are completed. Any paths, or combination of paths, that are determined to be at risk for failure that are outside of the normal flow of the interface will be tested on an individual basis.

TDP Review – The technical data package must be submitted as a precondition of national certification testing. These items are necessary to define the product and its method of operation; to provide technical and test data supporting the manufacturer's claims of the system's functional capabilities and performance levels; and to document instructions and procedures governing system operation and field maintenance. Any information relevant to the system evaluation shall be submitted to include source code, object code, and sample output report formats.

Security Test – The security test is designed and performed to test the capabilities of the voting system against the requirements defined in Volume I, Section 7. These procedures shall focus on the ability of the system to detect, prevent, log, and recover from a broad range of security risks identified. This test will also examine system capabilities and safeguards claimed by ES&S in the TDP to go beyond these risks. The range of risks tested is determined by the design of the system and potential exposure to risk.

6.0 TEST PROCEDURES AND CONDITIONS (Continued)

6.3.3 System Testing (Continued)

<u>Usability/Accessibility</u> – The usability test is a measure of the effectiveness, efficiency, and satisfaction achieved by a specified set of users with a given product in the performance of specified tasks. This test applies to the requirements for Volume I, Section 3 of the EAC 2005 VVSG.

<u>Accuracy</u> – The accuracy test ensures that each component of the voting system can each process 1,549,703 consecutive ballot positions correctly within the allowable target error rate. The Accuracy test is designed to test the ability of the system to "capture, record, store, consolidate and report" specific selections and absences of a selection. The required accuracy is defined as an error rate. This rate is the maximum number of errors allowed while processing a specified volume of data. For paper-based voting systems the ballot positions on a paper ballot must be scanned to detect selections for individual candidates and contests and the conversion of those selections detected on the paper ballot converted into digital data.

In an effort to achieve this and to verify the proper functionality of the units under test, the following methods will be used to test components of the voting system:

The accuracy requirements for the DS200 will be met by the execution of the standard accuracy test.
The DS200 will be tested by utilizing a combination of hand marked (70%) and pre-marked (30%) ballots to achieve accuracy rate greater than 1,549,703 correct ballot positions.

The accuracy requirements for the ExpressVote will be met by the execution of an accuracy test developed for the ExpressVote. The ExpressVote will be tested by utilizing a combination of blank vote cards (90%) and vote cards containing pre-printed activation bar codes by the ExpressPass (10%) to achieve accuracy rate greater than 1,549,703 correct ballot positions.

<u>Volume/Stress/Reliability</u> – Tests to investigate the system's response to conditions that tend to overload the system's capacity to process, store, and report data. The test parameters will focus on the system's stated limits and the ballot logic for areas such as the maximum number of active voting positions, maximum number of ballot styles, maximum candidates, maximum contests, and stated limits within the EMS. This test will be utilized to ensure the system can achieve the manufacturer's TDP claims of what the system can support. Testing will be performed by exercising an election definition and test cases developed specifically to test for volume and stress conditions of the system being tested.

<u>System Integration</u> – System Level certification test address the integrated operation of both hardware and software, along with any telecommunication capabilities. Compatibility of the voting system software components or subsystems with one another, and with other components of the voting system environment, shall be determined through functional tests integrating the voting system software with the remainder of the system.

Additionally, the system shall be configured exactly as it would for normal field use. This includes connecting all supporting equipment and peripherals including ballot boxes, voting booths (regular and accessible), and any physical security equipment such as locks and ties. NTS personnel will properly configure and test the system by following the procedures detailed in the EVS 5.2.0.0 voting system technical documentation.

(The remainder of this page intentionally left blank)

6.0   TEST PROCEDURES AND CONDITIONS (Continued)

6.3.3   System Testing (Continued)

Regression Testing - Regression Testing will be performed on all system components to verify all functional and firmware modifications made during the test campaign did not adversely affect the system and its operation.

NTS will verify the audit log records for error and exception activity to verify proper documentation and recovery action for all functional tests performed. A detailed listing of all audit log entries shall be provided by ES&S in the TDP submitted. During testing, audit log entries will be compared to this list to ensure that all expected events were recorded. To ensure the system's ability to gracefully shutdown and recover from error conditions, negative test cases will be performed to introduce such error conditions. The error conditions introduced will be based on the system limits specified within the vendors TDP documentation.

Additional Capabilities - Appendix B describes additional capabilities associated to the EVS 5.2.0.0 voting system. Limited testing will be performed during functional testing.

7.0   TEST OPERATIONS PROCEDURES

7.1   Proprietary Data

All proprietary data that is marked will be distributed only to those persons that the manufacturer or EAC identifies as needing the information to conduct qualification testing. The manufacturer is required to mark all proprietary documents as such. All organizations and individuals receiving proprietary documents will ensure those documents are not available to non-authorized persons.

APPENDIX A

ES&S PROJECT SCHEDULE

Appendix A Page No. 2 of 2
Certification Test Plan T71379.01

ID		Task Name	Duration	Start	Finish	Predecessors
1		EAC Application and Approval	3 days	Fri 12/13/13	Tue 12/17/13	
2		Wyle Receive Equipment	2 days	Wed 12/18/13	Thu 12/19/13	1
3		Test Plan	61 days	Wed 1/1/14	Fri 3/28/14	
4		Test Plan Development	20 days	Wed 1/1/14	Wed 1/29/14	1
5		Test Plan to ES&S for Review	3 days	Thu 1/30/14	Mon 2/3/14	4
6		Test Plan Update	3 days	Tue 2/4/14	Thu 2/6/14	5
7		EAC Review	21 days	Fri 2/14/14	Mon 3/17/14	6
8		Wyle Review and Update	5 days	Tue 3/18/14	Mon 3/24/14	7
9		EAC Approval of Test Plan	8 days	Tue 3/18/14	Fri 3/28/14	8
10		ES&S SOAP Submittal	13 days	Tue 12/17/13	Fri 1/10/14	
11		Source Code Review	5 days	Tue 12/17/13	Mon 12/23/13	
12		Compliance Builds	3 days	Fri 12/20/13	Mon 12/30/13	
13		Network Setup And Software Loads	5 days	Fri 12/20/13	Fri 1/3/14	2
14		TDP Review	100 days	Fri 12/20/13	Mon 5/19/14	2
15		Physical Configuration Audit	7 days	Mon 1/6/14	Tue 1/14/14	13
16		Electrical Supply Testing	3 days	Wed 1/15/14	Fri 1/17/14	15,22
17		Maintainability	3 days	Mon 1/20/14	Wed 1/22/14	15
18		Acoustical Testing	2 days	Thu 2/13/14	Fri 2/14/14	
19		Usability and Accessibility	5 days	Tue 2/18/14	Mon 2/24/14	18
20		Functional Testing	40 days	Wed 1/15/14	Wed 3/12/14	15
21		Security	5 days	Tue 2/25/14	Mon 3/3/14	19
22		Source Code Review	8 days	Wed 1/29/14	Fri 3/7/14	
23		Compliance Builds	5 days	Mon 2/10/14	Fri 2/14/14	22
24		Compliance Builds	3 days	Thu 3/13/14	Mon 3/17/14	20
25		Accuracy	3 days	Tue 3/18/14	Fri 3/21/14	24
26		Volume and Stress	5 days	Mon 3/24/14	Mon 3/31/14	25
27		System Integration	9 days	Tue 4/1/14	Fri 4/11/14	26
28		Trusted Builds	4 days	Mon 4/14/14	Thu 4/17/14	27
29		Regression Testing	5 days	Fri 4/18/14	Thu 4/24/14	28
30		Build and Tool Validation	5 days	Fri 4/18/14	Thu 4/24/14	28
31		**Test Report**	42 days	Fri 4/11/14	Mon 6/9/14	
32		Test Report Development	11 days	Fri 4/11/14	Fri 4/25/14	
33		Test Report to ES&S for Review	2 days	Fri 4/25/14	Mon 4/28/14	
34		Test Report Update	2 days	Mon 4/28/14	Tue 4/29/14	
35		EAC Review	30 days	Tue 4/29/14	Mon 6/9/14	

APPENDIX B

TESTING TO REFLECT ADDITIONAL CAPABILITIES

1.0 Introduction

The Voluntary Voting System Guidelines (VVSG) allows for vendors to provide additional system capabilities in order to respond to the requirements of individual states. The scope of testing for these additional capabilities is defined by the vendor rather than the Election Assistance Commission's 2005 Voluntary Voting System Guidelines.

2.0 Scope of Testing

The EVS 5.2.0.0 Voting System includes additional capabilities that are excluded from EAC certification:

- ExpressPass Application – A standalone application that interfaces with Voter Registration (electronic Pollbook) systems and the ExpressPass printer to print the ballot activation code on an ExpressVote activation card. This code on the activation card activates the correct ballot the voter is authorized to vote.

- ExpressPass Printer – A small, thermal, on demand printer used to print the ballot activation code on the ExpressVote activation card.

Table B1-1 lists the equipment used for the additional testing.

Table B1-1

Equipment	Model Number	Manufacturer	Description	Serial Number
ExpressPass	4200	Microcom	Thermal bar code printer	01901042505

1. **Source code review**

   a. Selection of programming languages
   b. Software integrity
   c. Software modularity and programming
   d. Control constructs
   e. Naming conventions
   f. Coding conventions
   g. Comment conventions

2. **Technical Data Package review**

   a. Equipment Functionality Description

3. **Functionality Testing**

   a. Installation and Uninstallation
   b. Proper activation of ballots using ExpressPass printed bar codes on ExpressVote cards.

4. **Trusted Build**

A Trusted Build of the software will be created using ES&S' trusted build documents. The "Trusted Build" is performed by completing the following tasks in the order listed:

a. Clear hard drive of existing data
b. Retrieve the compliant source code
c. Retrieve the installation media for OS, compilers, and build software
d. Construct the build environment
e. Create digital signatures of the pre-source build environment
f. Create a disk image of the pre-source build environment
g. Load the compliant source code into the build environment
h. Create a digital signature of the post-source build environment
i. Create a disk image of the post-source build environment
j. Build the executable code
k. Create the installation media
l. Create a digital signature of the final build environment
m. Create a disk image of the final build environment
n. Create a digital signature of the installation media
o. Install executable code onto the hardware and validate the software/firmware
p. Deliver source code with digital signature, disk image of pre-build environment with digital signatures, disk image of post-build environment with digital signatures, executable code with digital signatures, and installation media to the EAC Repository.

The "Trusted Builds" for the EVS 5.2.0.0 Voting System include source code, data, and script files, in clear text form. The builds also include COTS software on commercially available media, COTS software downloaded by the VSTL, COTS software verified by SHA256 from the software supplier, and picture and sound files in binary format provided by ES&S. The first step of the process was to clean the hard drives by writing data to every sector of the hard drive, so the drive is cleared of existing data. The designated operating system was then loaded and the applications from the VSTL-reviewed source along with the VSTL verified COTS software was built. The final step was installing the applications on the hardware.

3.0 **Deliverables**

The VSTL will provide a summary report for state certification authorities detailing the functionality tested, along with the functions not tested. Additionally, any functional issues identified during testing will be logged and identified in the letter. However, ES&S will be responsible for determining if the issues are resolved prior to releasing the equipment/application or they may choose to correct these issues and have the additional capabilities re-tested.

APPENDIX C

CHANGE NOTES

Appendix C, Page No. 2 of 2
Certification Test Plan T71379.01

Item Number	Module Affected	Version Number	Modification
1	ExpressVote	Hardware v1.0	Addition of a new universal vote capture device
2	DS200	Hardware v1.3	Implement new motherboard and new scanner board as previous boards are going end-of-life (EOL).
3	DS200	Hardware v1.3	Transport component update to enhance ballot handling and manufacturing tolerances.
4	DS200	Hardware v1.3	Replace CFL backlight with LED backlight due to EOL (end of life).
5	DS200	Hardware v1.3	Usability and compatibility enhancements to battery compartment access, ballot box replacement rails, power/close compartment switch, and equipment labeling.
6	ExpressVote & ElectionWare	ExpressVote FW 1.4.0.0; ElectionWare 4.6.0.0	Enhancement to support the Open Primary election type.
7	ExpressVote	ExpressVote FW 1.4.0.0	Enhancement to update the field length displayed on the ExpressVote
8	ExpressVote & ElectionWare	ExpressVote FW 1.4.0.0; ElectionWare 4.6.0.0	This enhancement will allow the ExpressVote to display the customized precinct name that is configured in ElectionWare.
9	DS200 & ElectionWare	DS200 FW 2.12.0.0 ElectionWare 4.6.0.0	The ability for the DS200 to query blank ExpressVote activation cards.
10	ElectionWare	ElectionWare 4.6.0.0	Enhances the cast vote record (CVR) export so that contest totals by district can be derived from the CVR spreadsheet.
11	DS200	Firmware 2.12.0.0	The enhancement allows an override to bypass "diverter not installed" stop and keep scanning.
12	DS850	Firmware 2.10.0.0	Added the ability to password protect the generation of results reports.
13	DS200	Firmware 2.12.0.0	Enhancement so the candidate order on the zero and results reports on the DS200 matches the ballot for that precinct.
14	DS200, DS850, ExpressVote, AutoMARK, & ElectionWare	DS200 FW 2.12.0.0; DS850 FW 2.10.0.0; ExpressVote FW 1.4.0.0; AutoMARK FW 1.8.6.0; ElectionWare 4.6.0.0	Implement method to validate hash values with Trusted Build to conform to RFI 2012-04.
15	System Wide	EVS 5.2.0.0	TDP update for Configuration Management to conform to RFI 2012-03.
16	ERM	ERM 8.11.0.0	Audit Log timestamp updates to conform with RFI 2013-03.
17	System Wide	EVS 5.2.0.0	Quality Improvements: enhancements to any GUI related issues and toolbox improvements
18	ExpressVote & AutoMARK	ExpressVote FW 1.4.0.0 AutoMARK FW 1.8.6.0	Pennsylvania rule for contest re-voting conditions associated with Straight Party ticket voting.
19	ExpressVote & AutoMARK	ExpressVote FW 1.4.0.0 AutoMARK FW 1.8.6.0	Enhancements of the ExpressVote and AutoMARK screens for plain language and conformance to usability guidelines.
20	ERM	ERM 8.11.0.0	The ERM csv export excludes some vote totals when PRC contest types are used.
21	DS200, DS850, AutoMARK, ERM, & ElectionWare	DS200 FW 2.12.0.0; DS850 FW 2.10.0.0; AutoMARK FW 1.8.6.0; ERM 8.11.0.0 ElectionWare 4.6.0.0	Illinois tabulation rule: An overvoted contest must count as 1 in the overvote tally, rather than being counted as the same number as the Vote-for in the contest.
22	System Wide	EVS 5.2.0.0	Upgrade to Adobe Standard version XI.
23	System Wide	EVS 5.2.0.0	Routine task updates for every release. For example: TDP updates, hardening scripts, source code file listings, and change notes.
24	DS850	DS850 FW 2.10.00	DataWin updates to DS850 firmware
25	DS200	Hardware 1.2.3	Incorporates all changes in ECO 1281

Appendix D, Page No. 1 of 22
Certification Test Plan T71379.01

APPENDIX D

COTS Software Table

National Technical Systems
Huntsville Facility

Appendix D, Page No. 3 of 22
Certification Test Plan T71379.01

The EVS 5.0.1.0 System includes the following COTS software which has been delivered by ES&S:
* NOTE: All hashes for COTS software were obtained from the COTS provider and then verified by NTS.
All propriety software developed by the manufacture is built by NTS and the hashes are provided by NTS.

Software Product	Software Version	Filename	SHA256 Hash Value
Microsoft Windows 7, SP1	5.1	Original Disc	N/A
Micro Focus RM/COBOL Runtime	12.06	Original Disc	N/A
Microsoft Server 2008	R2	Original Disc	N/A
Adobe Acrobat Standard	XI	Original Disc	N/A
Symantec Endpoint Protection Small Business Edition 2013	12.1.4	Original Disc	N/A
Cerberus	6.0.7.1		

Software Product	Software Version	Filename	SHA256 Hash Value
ElectionWare			
Microsoft Windows 7 Pro, SP1	5.1	Original Disk	NA
PostgreSQL	9.1	postgresql-9.1.2-1-windows.exe	b15aff7d85d26227d004e65ee35794272fb630b5
Oracle Java JDK	6u29	jdk-6u29-windows-i586.exe	41a8656f5bf2eb15f22fdee01350e8da37fac7df
ElectionWarePaperBallot.exe			
Microsoft Windows 7 Pro, SP1	5.1	Original Disk	NA
Visual C++ 10.0 CRT (x86)	10.0.40219.1	msvcp100.dll	2ada702a0c143a7ae39b7de16a4fb5cc994d2548b
	10.0.40219.1	msvcr100.dll	0b51fbf415cc89848f339f8989d323bca722bfd70
Visual C++ 10.0 MFC (x86)	10.0.40219.1	mfc100u.dll	2771393d56ff167275bf03170377e43e28ee14a1
PostgreSQL	9.1.2	postgresql-9.1.2-1-windows-binaries.zip	73edb0239de58a64f30510d568e3a85a19816b75
	1.0.0.4	libeay32.dll	26741c73bf8fc843cb74f15070084aeab9033b4f
	1.12.0.0	libiconv-2.dll	2c118fef19547ac5ea4d032f4a5bdad997766134
	0.17.0.6	libintl-8.dll	ad19cce12f2175c1fd1160f8cbb464f2f3de5fca
	9.1.2.11335	libpq.dll	85e03b03e00bc8cf7cf2fd77e50fa4641e820cb3
	1.0.0.4	ssleay32.dll	f6eee4c41027ded239023a7fe8ad9c0f81adf947
XercesC++ XML Parser Library	3.1.1	xerces-c_3_1.dll	Must be built from source. Hash will come from trusted build.

Appendix D, Page No. 3 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
Election Reporting Manager			
Microsoft Windows 7 Pro, SP1	5.1	Original Disk	NA
Micro Focus RM/COBOL Runtime	12.06		NA
InfoZip	2.32	unzip.exe	c1652b058195db3f5f754b7ab430652ae04a50b8
	5.5.2	zip.exe	55c5a72010291fca2275ccfb5b497dd00ac11a60
RoboHelp 2000	8.0.131.0	ROBOEX32.DLL	964d83c7f4dede10241408de04c7d44dr599cf3d
RoboHelp X5	13.10.606.0	wh2robo.dll	4ff22ef83737345923296078de1d4d1464598db
Shamir Optical	1.0.0.0	OpenSaveFile.ocx	47f736752a9894353ec111134bffcd5a4455e29ef
	3.0.0.1	ccme_base.dll	652f5069fea72f20faea001c887073b69c8281b0
	3.0.0.1	ccme_ecc.dll	1a2f7lf2ae1b215739718f04b23a6cdf0eaaf432
	3.0.0.1	ccme_eccaccel.dll	0f90ec44c40227d9b59c9dbc7e1e3b51618513d0
	3.0.0.1	ccme_ecnistaccel.dll	6698462aa02d592cf9a5a9c9dad512f047d289d9
RSA Encryption Library	3.0.0.1	cryptocme2.dll	cc10515599cb629a1137cedbf68ba0c9ce445fe5
	3.0.0.1	cryptocme2.sig	61174bc0385d8a0c5a697f8e4148ff8114ba13a1
Dynamic linked library for Xerces-C	2.8.0.0	xerces-c_2_8_vc80.dll	2896be1d9f6bc38a2c34d76fdc6749090f0395462
Visual C++ 10.0 CRT (x86)	10.0.40219.1	msvcp100.dll	2ada702a0c143a7ac39b7dc16a4b5cc994d2548b
	10.0.40219.1	msvcr100.dll	0b51fb415ec89848f339f8989d323bea722bfd70
	10.0.40219.1	mfc100.dll	29dd7ca9af4085c6897788c1afaadf59dd5d8b0e
	10.0.40219.1	mfc100u.dll	2771393d56ff167275bf03170377c43c28ee14e1
	10.0.40219.1	mfcm100.dll	432a2fddbb87bd13e4e40428e4c6a167eebd7bf1
Visual C++ 10.0 MFC (x86)	10.0.40219.1	mfcm100u.dll	e7fb9b6a36e2f9ad381d00d14e1a20b541c70d94
EventLog Service			
Microsoft Windows 7 Pro, SP1	5.1	Original Disk	NA
Visual C++ 10.0 CRT (x86)	10.0.40219.1	msvcp100.dll	2ada702a0c143a7ac39b7dc16a4b5cc994d2548b
	10.0.40219.1	msvcr100.dll	0b51fb415ec89848f339f8989d323bea722bfd70
Removable Media Service			
Microsoft Windows 7 Pro, SP1	5.1	Original Disk	NA
Visual C++ 10.0 CRT (x86)	10.0.40219.1	msvcp100.dll	2ada702a0c143a7ac39b7dc16a4b5cc994d2548b
	10.0.40219.1	msvcr100.dll	0b51fb415ec89848f339f8989d323bea722bfd70
AutoMARK			
		nk.nb0	941cc95c9884e6073d5daa33f80b37bfc528d246ac7a9cb02c26e21be05ddf57
		ADSApiDll.dll	7841640c8514ab4c8c8e457b4e1374cbb61c9a85ab3b0b3e0a64995e23693708
		FSHDRV.dll	f5e67f3c907fbc860b2662da3bb1038ec669cba003a8e9a0a9ddd441f5bd915d
Eurotech WinCE OS	5.00.20	sysUpgrad.exe	567da9e0f20dd3a13af9922d07adfa4995ce390fca190b549bf005f30fed5bd9
	5K509399AT-A 2.0/1/3/0	bootloader.bin	7ee9258eb57c37c2d5cbf7429a2e1774092b570e1bf98a0f83ad511b182cc02e
Ricoh SBC/Bootloader	5K509399B-A 2.5/1/3/1	bootloader.bin	9042589bad245e864e0cbe3d65aa5c552135e4a8cdb67e911670aed92372651d
DS200			
N/A	N/A	N/A	N/A
DS850			
N/A	N/A	N/A	N/A

Appendix D, Page No. 4 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
EMS Build Environment			
Apache Software Foundation Ant	1.7.1	apache-ant-1.7.1-bin.zip	a7e8fa7bc2102a8d8df99c64db73c2eae3d8b483
Apache Software Foundation Xerces-C++	3.1.1	xerces-c-3.1.1.zip	b61e2829f68d812d649bddaf5264a98f9837201a
CodeSynthesis XSD Including Apache Software Foundation Xerces C++ 2.8.0	3.1.0	xsd-3.1.msi	aa5f2fb2c815e8e1a494314c08697751d056690b
Flexera Software (Macrovision) InstallShield	2008 Premier Edition	Original CD (two disk set)	N/A
Flexera Software (Macrovision) InstallShield Standalone Build Script Objects	2008 Premier Edition	installshieldinstallscriptobjects.exe	6cb960636c4474277fe12a51ee0d0704ee9246ed
MicroFocus (Liant) RM/COBOL Development System	12.06	rmcobol1206ds.exe	f0c1a2cd06936eb12f860deb0a4d8cc6350832f
	12.06	wowext1206.exe	0d9bd6aa0c96dd4552656d54b677750655844761
Microsoft Visual Studio	2010 Premium (X86)	en_visual_studio_2010_premium_x86_dvd_509357.iso	a4c69966496ad0f704f09d97fac2a723cf75499b
	2010 Service Pack 1 (x86)	mu_visual_studio_2010_sp1_x86_dvd_651704.iso	61c2088850185ede8e18001d1ef3e6d12daa5692
Microsoft Windows	XP Professional with Service Pack 3	Original CD	N/A
	XP Professional Update (KB971513)	WindowsXP-KB971513-x86-ENU.exe	e18df80f512a6d9eca206825b981e33c0973abcc
Microsoft Windows Driver Kit (WDK)	7.1.0.7600	GRMWDK_EN_7600_1.ISO	de6abdb8eb4e08942add1aa270c763ed4e3d8242
Oracle (NetBeans) NetBeans	6.9.1	netbeans-6.9.1-ml-javase-windows.exe	84d4a09937c8dcb3c199cf6281672aefe137f70e
Oracle (SDN) Java SE Development Kit	Version 6 Update 29	jdk-6u29-windows-i586.exe	41a8656f5bf2eb15f22fdcc01350e8da37fac7df
PostgreSQL Global Development Group PostgreSQL	9.1.2-1	postgresql-9.1.2-1-windows.exe	b15af7d85d26227d004c65cc357942720b636b5

Appendix D, Page No. 5 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
EMS Build Environment			
RSA BSAFE Crypto-C	Micro Edition (ME) 3	r_unpack.exe	5c48f05c4cf65784f5b129e15a05383611931f015
	Micro Edition (ME) 3	cryptocme-3_0_0_1-win32ve8.pkg	30fb23005a0c315a5ecccc37efbf64b3e3f62b20
SourceForge Boost C++ Libraries	1.46.1	boost_1_46_1.zip	62ae61cb2756abfc8515f842023ca572e733b2f2
	1.46.1	libboost_date_time-vc100-mt-1_46_1.zip	cdf7a788cc8c0e505fdb5fcf5bfb9da430a7dfee
	1.46.1	libboost_filesystem-vc100-mt-1_46_1.zip	c31498f188d644a6acdacb23c925cb956cd03f5c
	1.46.1	libboost_filesystem-vc100-mt-s-1_46_1.zip	dc2142b4ae049e2e1e577ddc9bbfa12e468522S6
	1.46.1	libboost_program_options-vc100-mt-1_46_1.zip	07abf1aaa7548d1273b91afcda83d35bd35f1bcc
	1.46.1	libboost_system-vc100-mt-1_46_1.zip	3fa909d6c6fdccf0c9e5a5a668c85789cc202cfa
	1.46.1	libboost_system-vc100-mt-s-1_46_1.zip	3970de2312ab82b7ea4fe29af31aa622571b39d9
InfoZip	2.32	unzip.exe	c1652b058195db3f5f754b7ab430652a804a50b8
	5.52	zip.exe	55c5a72010291fca2275ccfb5b497dd0bac11a60
MarshallSoft	0.0.0.0 Linker Rev. 3	WSC32 DLL	ac0d9b7d7ac30e98af162735bc9e7b1b24c48d23
RoboHelp 2000	8.0.131.0	ROBOEX32.DLL	964d83c7f4dcdc10241408da04e7d44cb599ef3d
RoboHelp X5	13.10.606.0	wh2robo.dll	4ff22cf837373459232906078dc1d4d1464598db
Sharm Optical	1.0.0.0	OpenSaveFile.ocx	47f736752a9894553cc11134bffcd5a4455c29cf

Appendix D, Page No. 6 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
AutoMARK Build Environment			
AutoIt Consulting AutoIt	3.2.10.0	autoit-v3-setup.exe	bb913c21b1eeb8a580ea226d0a524f339d752596
Applied Data Systems Xscale	4.2	ADS_XSCALE_4_2_SDK.msi	991746a6251c28fc8b28b439c00565f23603f35c
Cosmic Software 68HC08 C Compiler	4.1h	Original CD	N/A
Keil µVision2 Note: CD is mislabeled µVision3	Release 04.2004	Original CD	N/A
Keil µVision2	Add-On Disk	Original 3.5" High-Density Floppy Diskette Note: Must transfer to a CD	N/A
MacroVision InstallShield Professional	10.5	Original CD	N/A
Microsoft Visual Studio	Net 2003	Original CD	N/A
Microsoft Windows	XP Professional with Service Pack 3	Original CD	N/A
Microsoft Windows CE Platform Builder	5.0	Original CD	N/A
	Cumulative 2004 Update	WinCEPB50-041231-Product-Update-Rollup-Armv4I.msi	2a33a1540e25118e9360e729 8af7c96da206006f
	Cumulative 2005 Update	WinCEPB50-051231-Product-Update-Rollup-Armv4I.msi	331f874c41fd2abe79ddc97ae9a47b91d203bdf9
	January 2006 Update	WinCEPB50-060131-2006M01-Armv4I.msi	884241dd89bd1fdа9683fb6d6ba141fc82cf9b2c
	February 2006 Update	WinCEPB50-060228-2006M02-Armv4I.msi	4695c80aff3707a1926ec54d0756af3a426d8e0f
	March 2006 Update	WinCEPB50-060331-2006M03-Armv4I.msi	39dc323b9736441893322fc1b159bc94dd2ec3b5
	April 2006 Update	WinCEPB50-060430-2006M04-Armv4I.msi	823c496b554f9d3d29cd491f80ffda9729176b89
	May 2006 Update	WinCEPB50-060531-2006M05-Armv4I.msi	29df27801c8bd2a3a68567cfa65e1f154de8ae65
	June 2006 Update	WinCEPB50-060630-2006M06-Armv4I.msi	7421d73cc31ed1a9250b6e591c14f06a98988f59
	July 2006 Update	WinCEPB50-060731-2006M07-Armv4I.msi	f8ab5055a648ca23a64c3c89cf01c88cc9836b5c
	August 2006 Update	WinCEPB50-060831-2006M08-Armv4I.msi	43b5d5a6f1bc643c9dd4af970de1785188bbc622
Microsoft Embedded Visual C++	4.0	Original CD	N/A

Appendix D, Page No. 7 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
AutoMARK Build Environment			
RSA BSAFE Crypto-C	Micro Edition (ME) 3	r_unpack.exe	5e48f05e4cf65784f5b129e15a0538361193f015
	Micro Edition (ME) 3	cryptome-3_0_0-ppc2003.pkg	5ac651f5927f6cd8c16dea81a99df850441df9c6
Texas Instruments Code Composer Studio	v2 TMS320C5000 DSP Platform	Original CD	N/A
VAT_1.7.0.0t_Buildpkg_COTS.zip	N/A	N/A	N/A
Microsoft Visual Studio .NET 2003	N/A	cabwiz.ddf	dd44f51edf27710a1ce652276454451672c4bd05
	1.00.0601	Makecab.exe	4825951d19c34deb658228822df95f7df5e1344e
Microsoft .NET Compact Framework	1.0.2268	Microsoft.WindowsCE.Forms.dll	939eb54fedb95782a73837c81ac201f2d638e9da
		MSCORLIB.DLL	8e57ebd267aea2085de298f3fceee0590de52f35
		System.Data.Common.dll	aa7baa9e02c545cc32d43b017fc68f3fbbe0f490
SpeechWorks International, Inc. ETI-Eloquence TTS Engine	6.1.0.0	chs.syn	8a141d890aded7aefd24f7aa2c3b798338dd9da4
		chsrom.dll	5c134dcbf0442a9394d96d3f3135909637c60383
		cei.dll	dc792ccd3d1ac96f8f1d507c22ab800376a0d71c
		enu.syn	08dbecbc6cf27a253535fc1a0d7d8a27169049c5
		esm.syn	eaf755997c900f37d17e4c152b1b40ad349c2a8
		jpn.syn	32ca16c5034918711c8d056b850cd5279871762a
		jpnrom.dll	0a6c13ad82b0f5c5106f0f9d040a8b7e7e7cda4
		kor.syn	8592386bfaa11c2e7196278240c8ca0afc96db2d
		korrom.dll	1dc6f1a4250fccfc542a48accf7ad990f2d04bcb
ATEN Technology Inc.	N/A	PL2303.CAT	a1bd69bdcf67a0c90cdc1785u15b62116c55976d
	N/A	SER2PL.INF	b682d49b5083fb58a4c7725884df40b173d0afc6
	N/A	SER2PL.SYS	60ea554d7e0695998fa83668fc6ae3d21e30cc47
VAT_1.7.0.0t_Source_COTS.zip	N/A	N/A	N/A
Enounce, Inc	1.3	enresult.h	026f14e00f2ffac65ff78ff219523ec702a8971c
	1.7	entypes.h	62f2e746d9e10e33167a8252523e72dc38489e0f
	1.7	tsmiface.h	45e4323d1c24134fea1d653072a116b330474742
	1.21	TSMStrmObj.h	d6bd6b1a0c6815c6935c3f7b5439baa5f879491e
	N/A	tstanmv4I.lib	57f18b940f5cd0bf404f3cd10b003db40bfb4e7c
FTDI Ltd	1.0.1.3	FTD2XX.h	2d753f2d72fa3adab894b0dbf8c85a97466ec89c
		FTD2XX.lib	4685d678b54a7a0159b97b510fc2741cfa64fb5f
zlib	1.1.4	unzip.cpp	afbb534d029875028b7d4048e895083d6901ab32
		unzip.h	5d6a56bd1daab11ae05e801b8b51114d4736e88ed
VAT Preview_1.7.0.0t_Installpkg_COTS.zip	N/A	N/A	N/A
SpeechWorks International, Inc. ETI-Eloquence TTS Engine	6.1.0.0	chs.syn	ff7c1873b84256c25da601d70ad280333e5ce167
		chsrom.dll	63ae8a1f7d0369d887b8f2ee0a47a76efee3bc2f
		cci.dll	7aa1085124b7bec6016c8074297bcf6d40b823df
		enu.syn	3c69875d11e0a53c39c211e484cb6520f8d87f25
		esm.syn	d8057d86c5f677c89cca7834ac47fbd030a0434aa
		jpn.syn	99a931c76c6008da9f01b91b4d91c116ccc8f7d7
		jpnrom.dll	7557c00c8acc29affdabddddb73f166d0877a866
		kor.syn	f32f8ac286cd278320dbb829df338b97a2c846b5
		korrom.dll	76219d7f9f76f021b4815fa796f80e3ca49e3446

Appendix D, Page No. 8 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
DS200 Ancillary Devices Build Environment			
Keil µVision3	3.51	Original CD	N/A
Cypress 102-LSR Dev Kit	2.31	Original CD	N/A
IAR MSP430 Embedded Workbench	3.40A	Original CD	N/A
Microsoft Windows	XP Professional with Service Pack 3	Original CD	N/A
DS200			
Linux From Scratch	6.2-5	lfslivecd-x86-6.2-5.iso	b3e3947bf2c3616fa45541c0643a2adfa0618207
/lfs-sources (LFS Base Files from Live CD)			
autoconf	2.59	autoconf-2.59.tar.bz2	d366a07b2d99c95b7f24395aa8a8e023d8d93b69
automake	1.9.6	automake-1.9.6.tar.bz2	d205db274d3ff5be1ef6734f27fb452e7131866
bash	3.1	bash-3.1.tar.gz	766e5fd938461 6d8a1f03f8f2f662fd8ae791ef29
bash fixes	3.1	bash-3.1-fixes-8.patch	03d6781dd9ad6336eda906d5645ef66e1641dd49
bash doc	3.1	bash-doc-3.1.tar.gz	9eacbbdf3b1be03819b1ea82edaea0f5e61570ef
binutils	2.16.1	binutils-2.16.1.tar.bz2	5e80fd5657da47efef6a63fdd93ef7395319fbbf
bison	2.2	bison-2.2.tar.bz2	b01691e83ce0d08d3c03e32e194f6b03381ced21
bzip2	1.0.3	bzip2-1.0.3.tar.gz	7e749510f65c86fbfff37b97144a02f1b8b8617f
bzip2 patch	1.0.3	bzip2-1.0.3-bzgrep_security-1.patch	56a29bf1278f21bc30c72d19e5766bfda5c74e5b
bzip2 docs patch	1.0.3	bzip2-1.0.3-install_docs-1.patch	ead85296356ef c99db45529ef7acb9f61dd33daa
coreutils	5.96	coreutils-5.96.tar.bz2	782379daf2004 27058ea94a4085 66d600f779823
coreutils patch	5.96	coreutils-5.96-i18n-1.patch	3ff73eceac8ef66345efed38f770e51db4d02199
coreutils patch	5.96	coreutils-5.96-suppress_uptime_kill_su-1.patch	a7dedf947b7651f882c8ede00eb6e56689bbb154
coreutils patch	5.96	coreutils-5.96-uname-1.patch	42cc795e56b96994a4dc9e8f2a8dd72b6a25665f
db	4.4.20	db-4.4.20.tar.gz	fdb4e68a4afef4712cb2954b79917f5de9fe93bf7b
db patch	4.4.20	db-4.4.20-fixes-1.patch	46886ccdf1ea6daab392e5c46b4923f7e71e7d55
dejagnu	1.4.4	dejagnu-1.4.4.tar.gz	fd82ffd396eba5b595f76d2f4a068cb7fcc6effb
diffutils	2.8.1	diffutils-2.8.1.tar.gz	a4c467c3a6a08ede9f3d94d02067cc26436c7da5
diffutils patch	2.8.1	diffutils-2.8.1-i18n-1.patch	2d88d693ab572f04990a3a28dcb5e743c288b9da
expect	5.43.0	expect-5.43.0.tar.gz	854440d937c1d05103bf2d02f9110 05b739fa1e9

Software Product	Software Version	Filename	SHA256 Hash Value
DS200			
expect patch	5.43.0	expect-5.43.0-spawn-1.patch	ba903a7d04b4faa13e8b9db75c1537f55f28c82b
file	4.17	file-4.17.tar.gz	c03710a3fcb95db6d0ec9cfcdf88c19a5e525ce4
findutils	4.2.27	findutils-4.2.27.tar.gz	0655e10b20dc66b1ccddfa45e5d6c57a3cd312a2
flex	2.5.33	flex-2.5.33.tar.bz2	aedb8f06455967ad1a5bfc71855dbcc1253ce56
gawk	3.1.5	gawk-3.1.5.tar.bz2	0d5694461f1c32f1cac41a1c0d7ba0939b47c369
gawk patch	3.1.5	gawk-3.1.5-segfault_fix-1.patch	8dde8415d03b1897f50d5b12b6c876feda15e0be
gcc	4.0.3	gcc-4.0.3.tar.bz2	5a94943d9ab823ef8d080cc7f9e8a4a91797afea
gcc patch	4.0.3	gcc-4.0.3-specs-1.patch	04d4b7d68bfd6b362e9b75678584641a2dde7c2f
gettext	0.14.5	gettext-0.14.5.tar.gz	68737eee1a6427044ccf901dc88e4144d371fb6b
glibc	2.3.6	glibc-2.3.6.tar.bz2	82d0487419f1bdbf2dee439c344e89d6af47e558
glibc patch	2.3.6	glibc-2.3.6-inotify-1.patch	d282d10108a4f6b9c6eddc4351a83abe22a5b5b6
glibc patch	4.0.3	glibc-2.3.6-linux_types-1.patch	0bdf2b15e20c176caf3c85e5b6a7bc957f636d6a
glibc-libidn	2.3.6	glibc-libidn-2.3.6.tar.bz2	95d3a98495d4bd7138149fd312db88da56e735db
grep	2.5.1a	grep-2.5.1a.tar.bz2	2cd082775d30be463c0ac674a00595eb56fda22e
grep patch	2.5.1a	grep-2.5.1a-redhat_fixes-2.patch	6f7f1623d1909f07dc08a8a16a24cbce6be8dfc5
groff	1.18.1.1	groff-1.18.1.1.tar.gz	19c8c83e6ee29dd6041dae0daf1c1d0debd3d32a
groff patch	1.18.1.1	groff-1.18.1.1-debian_fixes-1.patch	39fb82b9673523cb2451a0491929693226ea97dd
grub	0.97	grub-0.97.tar.gz	2580626c4579bd39336d3uf4482c346c95dac40
grub patch	0.97	grub-0.97-disk_geometry-1.patch	65180ffe6d851c9f59ecd16b6bd49f1358c9594c
gzip	1.3.5	gzip-1.3.5.tar.gz	843272609b9bff1bdf2770a28d498d6519901e73
gzip patch	1.3.5	gzip-1.3.5-security_fixes-1.patch	3ab15cd96f2b8b3e26b6f8d878f5cf43f822abca
iana-etc	2.10	iana-etc-2.10.tar.bz2	6a2960c42ccf3266680b7adb83f239c5a640220c
inetutils	1.4.2	inetutils-1.4.2.tar.gz	6b60d2c78702512c95afac3641516fc3523dba77
inetutils patch	1.4.2	inetutils-1.4.2-gcc4_fixes-3.patch	77b063b0fcc15a55c28c18c1b30c1cdf5b1b7d3a
inetutils patch	1.4.2	inetutils-1.4.2-no_server_man_pages-1.patch	ccd3c59f9ed4cca6f7a8dffb494ed8916087bc50
iproute	2.6.16-060323	iproute2-2.6.16-060323.tar.gz	76d866bb3b46a7b2e73d79a4faf6fa8971527633
kbd	1.12	kbd-1.12.tar.bz2	65caac4d98fca3f7ae7dfc9d9db7c5a432a6475f
kbd patch	1.12	kbd-1.12-backspace-1.patch	39c332e42d5145dfc47786dba5eff63cda91d0ba
kbd patch	1.12	kbd-1.12-gcc4_fixes-1.patch	93ec9885a79f79088f0533ec52f7a87d4e69500
less	394	less-394.tar.gz	6b0d9aa30cc461866786c4080bb594fc3337bb02
lfs-bootscripts	6.2	lfs-bootscripts-6.2.tar.bz2	616ccc3d67a79169c62542f141f481ea5150c348c
libtool	1.5.22	libtool-1.5.22.tar.gz	17353c66acaac80ac188ca0a3a90609550cc3254
linux patch	2.6.16.27	linux-2.6.16.27-utf8_input-1.patch	1245af73cf6a0d6df1b1adfa167bbec2c02ca92dd5
linux-libc-headers	2.6.12.0	linux-libc-headers-2.6.12.0.tar.bz2	c72c9b260995b269c9fb9248ed468c18fb01f3fd
linux-libc-headers patch	2.6.12.0	linux-libc-headers-2.6.12.0-inotify-3.patch	724f0349907df408d17650fd2e58448d0a9e1799
m4	1.4.4	m4-1.4.4.tar.gz	4861740db54b6c9d135d04b5fbf460f757f969a5
make	3.80	make-3.80.tar.bz2	d2085842f08e57d58d3e1cd75a5f0342a60e5f45
man-db	2.4.3	man-db-2.4.3.tar.gz	a9f6ac22ccd9f186005920ccdb5f661fdf13d4fa
man-pages	2.34	man-pages-2.34.tar.bz2	99278afd00613fa2409791f20c0cc175118a4fd1
mktemp	1.5	mktemp-1.5.tar.gz	aa001fd61d13bbf128dc58ea4dc6d83311435bac

Software Product	Software Version	Filename	SHA256 Hash Value
DS200			
mktemp patch	1.5	mktemp-1.5-add_tempfile-3.patch	e1ea0e1d5995a44bf82c369d60f415c2cf92b95b
module-init-tools	3.2.2	module-init-tools-3.2.2.tar.bz2	b51e8ae170be23a1f2e301a1dddd47a47ec2186a
module-init-tools patch	3.2.2	module-init-tools-3.2.2-modprobe-1.patch	0eaecb2078cc47c97e496e2e4717b8b82a52eb01
ncurses	5.5	ncurses-5.5.tar.gz	46414a72e91u62f63u8c9uf00f0d65497f5ecc5a
ncurses patch	5.5	ncurses-5.5-fixes-1.patch	617cf de363a6dc2cfeaf5eaafd78cfc01ab34f48
patch	2.5.4	patch-2.5.4.tar.gz	a12d520cba0dc35d1e1d50cc75b7684451a40de9
perl	5.8.8	perl-5.8.8.tar.bz2	4aab190040727ca4419098720eea2ba4367df539
perl patch	5.8.8	perl-5.8.8-libc-2.patch	b72468149e5cce6faefdc7f32bb05bda6c2ad e9d
procps	3.2.6	procps-3.2.6.tar.gz	91f04180cb50a94cb945e2598c0c849879c65893
psmisc	22.2	psmisc-22.2.tar.gz	1ae222803c5b5967a1b93c69f08330c0cde1a554
readline	5.1	readline-5.1.tar.gz	4b2ee2bc9c6dd1d238c84a58f7e6db173600b850
readline patch	5.1	readline-5.1-fixes-3.patch	f58bbd80c7aed462ab7e97e3ac4eae7cd9d1b835
sed	4.1.5	sed-4.1.5.tar.gz	8e575c8a44568392d5b6c089cab5da5cdbd45885
shadow	4.0.15	shadow-4.0.15.tar.bz2	0f7cd3366a032091fdffd2f8edf65056bd576cae
sysklogd	1.4.1	sysklogd-1.4.1.tar.gz	093775da0e429d0768cf195ceb20fdd6d96aeeea
sysklogd patch	1.4.1	sysklogd-1.4.1-8bit-1.patch	edc01eceb4ae7af3d6a02e23a4dace8fee50f3eb
sysklogd patch	1.4.1	sysklogd-1.4.1-fixes-1.patch	4fbd5e56c212c8e37f363eb48ba86a5ecea21f4a
sysvinit	2.86	sysvinit-2.86.gz	3e78df609a2ff0fea6304cb662a7f10298d03667
tar	1.15.1	tar-1.15.1.tar.bz2	f861b7524a0867833056dc382e68085234cae6ff
tar patch	1.15.1	tar-1.15.1-gcc4_fix_tests-1.patch	ba780e0e88c7993a69d5a498912e135bf16e7df8
tar patch	1.15.1	tar-1.15.1-security_fixes-1.patch	93fd5a55bcef25d03bb7e18dffc0bce27c29d207
tar patch	1.15.1	tar-1.15.1-sparse_fix-1.patch	269dfcc556b6217d27d043ea623df75e19e3d8c9
tcl	8.4.13	tcl8.4.13-src.tar.gz	4af6bec9a941d7d798df4287eebece7ded67489c
texinfo	4.8	texinfo-4.8.tar.bz2	b19e906f7220294c1e8b087d583c50f5c4d7c420
texinfo patch	4.8	texinfo-4.8-multibyte-1.patch	b97ae3468c03f3389dbf3c9b6eed64f996f9ed5c
texinfo patch	4.8	texinfo-4.8-tempfile_fix-2.patch	2ead28ch8e2679cdb53e1e4908209f0a31397dfe
udev	096	udev-096.tar.bz2	8d15b89fd f93ba84c2d33f606 1e140acd0a4dce
udev-config	6.2	udev-config-6.2.tar.bz2	5cd22b8e9cf1e996871e2bc540d75e57a4f706a3
util-linux	2.12r	util-linux-2.12r.tar.bz2	740b7eb5ae1448b2200b2cd34a0a6f4b0db577e4
util-linux patch	2.12r	util-linux-2.12r-cramfs-1.patch	60f5192493b939e2e996df9c1f3f769abfa3fa8c
vim-7.0	7.0	vim-7.0.tar.bz2	38cf48eab0942d0de804a794dec6f002b9457fc8
vim-7.0 patch	7.0	vim-7.0-fixes-7.patch	eaf8b4b5635cf72cdd033b048a993f80c5a5aa7b
vim-7.0-lang	7.0	vim-7.0-lang.tar.gz	3db6b0004d213490cc00d361835c7a7c685adb52
vim-7.0-mandir patch	7.0	vim-7.0-mandir-1.patch	182f46df acefdd3b06f821dea7f f90547d414230
vim-7.0-spellfile patch	7.0	vim-7.0-spellfile-1.patch	4c0cb489a9b8f989f154d14cadb50deba619dd2b
zlib	1.2.3	zlib-1.2.3.tar.gz	60faeaaf250642db5c0ea36cd6dcc9f99c8f3902
lfs_kernel-2.6.35.13-src.tar			
Linux Kernel	2.6.35.13	linux-2.6.35.13.tar.bz2	b828b1db449c88a00209b158 8efc0d192fa960c1

Software Product	Software Version	Filename	SHA256 Hash Value
DS200			
lfs_cots-3.0-rhel30-src.tar			
cryptocme	3.0-rhel30	cryptocme-3.0-rhel30.tar.gz	4fe8c6a6ddbf524cfa88e3e6cf195447afc67977
lfs_enhanced-2.7.0.0v-src.tar			
alsa-lib	1.0.13	alsa-lib-1.0.13.tar.bz2	82fa9a7fcb43b319524b18451ea86d691a20f3a3
alsa-utils	1.0.13	alsa-utils-1.0.13.tar.bz2	05b46va0c7ac6519ea37240476f026b59dbc710d
aumix	2.8	aumix-2.8.tar.bz2	5cea563ae91f628433a1950a36efd23681da4bf4
beecrypt	4.1.2	beecrypt-4.1.2.tar.gz	71cebd3329bb2561ffba24a2004dfac50b143f59
blfs-bootscripts	20060910	blfs-bootscripts-20060910.tar.bz2	58ff10492f9abceed6ca4a105c479d5f2e3e8002
BLFS-ca-bundle	3.12.5	BLFS-ca-bundle-3.12.5.tar.bz2	8cf4be3072184940f8cfc3888ef0ba1cb58a5377
boost	1.43.0	boost_1_43_0.tar.bz2	b8257b7da2a7222739314f8d1e07e217debe71d6
coreutils	6.9	coreutils-6.9.tar.bz2	10310a78c4e1d9f742f3815ac28e9bf1086a5885
cpio	2.6	cpio-2.6.tar.gz	5a4ea156519909994fe05933dc823abcf07e3e21
cpio-security_fixes-1	2.6	cpio-2.6-security_fixes-1.patch	d8445256032b903bbd3cee2694e87412e7dca843
ctags	5.6	ctags-5.6.tar.gz	930afaa138624717393fe475201f795251bd5e5e
curl	7.15.3	curl-7.15.3.tar.bz2	7e764126ce564429fe2f142428a27cbfc8fb69ee
cvs	1.11.22	cvs-1.11.22.tar.bz2	5dfa11da84a890d7d61516fd450c001dc24bcc0d
cvs-zlib-1	1.11.22	cvs-1.11.22-zlib-1.patch	0d20bab8a6b6e419a8c900d082b487ad6a3aec38
docbook-xsl	1.69.1	docbook-xsl-1.69.1.tar.bz2	aaabf0e274609134e187a6c36d2be23f3471f507
dosfstools	2.11	dosfstools-2.11.src.tar.gz	b0d8714475ca7a7a96a46adf7c4839d69ce2f412
e2fsprogs	1.41.14	e2fsprogs-1.41.14.tar.gz	24f9364fa3d4c0d7d00cb627b819d0e51055d6c5
expat	2.0.1	expat-2.0.1.tar.gz	663548c37b996082db1f2f2c32af060d7aad5c2d
fuse	2.8.5	fuse-2.8.5.tar.gz	862320b56d6bc4ad5c7bc2b1c0b50291668aaa09b
fuse	0.2.12	fuse-zip-0.2.12.tar.gz	fc6f1a32d7fbe0d8e8598b8c7f56129fa5abe173
gnupg	1.4.3	gnupg-1.4.3.tar.bz2	9c96b36b4f4d1c8be5028c99fac674482cbdb370
gpm	1.20.1	gpm-1.20.1.tar.bz2	e48d937c62abb438c2f6439b34cf3332c89af8d1
gpm-segfault-1	1.20.1	gpm-1.20.1-segfault-1.patch	da53bf78a0cbaa5020c332aa6d6861159170cd86
gpm-silent-1	1.20.1	gpm-1.20.1-silent-1.patch	8899a212cadfbda201d8da3c44590bd05b97f9f6
libao	0.8.6	libao-0.8.6.tar.gz	2050e008ffcfd6803e2c2c03c7d5f169b6d8379e
libogg	1.1.3	libogg-1.1.3.tar.gz	a3e495a8baf6939efad7e0bd11cc0e466838c3db
libusb	0.1.12	libusb-0.1.12.tar.gz	599a5168590ff66bc6f1f9a299579fd8500614807
libvorbis	1.1.2	libvorbis-1.1.2.tar.gz	26289fc41aa5436b1a277d726bb5cb106d675c35
libxml2	2.6.26	libxml2-2.6.26.tar.gz	094ac2aae1c295fc227d88e803013557a269358a
libxslt	1.1.17	libxslt-1.1.17.tar.gz	5b36ab3e1ed85ed0862a10ce22ca03e1084d9121
libzip	0.9.3	libzip-0.9.3.tar.bz2	16e94bc0327f1a76a0296a28908cf6439b0a0a67
net-tools	1.60	net-tools-1.60.tar.bz2	944fb70641505d5d1139dba3aeb8fba124574b83
net-tools-gcc34-3	1.60	net-tools-1.60-gcc34-3.patch	a92286932a423fc987f2a152931d05b0a9a312bd
net-tools-kernel_headers-2	1.60	net-tools-1.60-kernel_headers-2.patch	3e59577c904582503b25c7b21f6c3b77b165f84a
net-tools-mii_ioctl-1	1.60	net-tools-1.60-mii_ioctl-1.patch	912613acbf3a000a2935391a14e55b5ccdeeae6b
ntfsprogs	1.13.1	ntfsprogs-1.13.1.tar.gz	a4e50f6fc10fcc1e1f562ad64bcbf9a0d46ca72a
openssh-4.5	4.5p1	openssh-4.5p1.tar.gz	2eefcbbeb9e4fa16fa4500dec107d1a09d3d02d7
openssl-5.8	5.8p1	openssh-5.8p1.tar.gz	adebb2faa9aba2a3a3c8b401b2b19677ab53f0de
openssl-fix_manpages-1	0.9.8r	openssl-0.9.8r.tar.gz	a02411e5f4d463eac4a2a4a337a4a0b93bf65e72

Appendix D, Page No. 12 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
DS200			
openssl-fips	1.2.2	openssl-fips-1.2.2.tar.gz	e3f94222ec24a5fb6c39b80ac2e5529760de3c33
openssl-fips	1.2.2	openssl-fips-1.2.2.tar.gz.asc	f9fd60bf406c5a98c834b09b1f032ff4341cbf31
pkg-config	0.22	pkg-config-0.22.tar.gz	3ec40bda9864d7aa3c912c6ae87a750fd8b6e420
popt	1.10.4	popt-1.10.4.tar.gz	19e6649e4c37ccfb6fb4296aeea609b5fdd5e34d
ppp	2.4.4	ppp-2.4.4.tar.gz	9b91b0117c0a8bfaf8e4e894af79e0960dd36259
Python	2.4.4	Python-2.4.4.tar.bz2	9e0971f93df8acbd947378d0d16a32fcc8897ba2
Python-gdbm-1	2.4.4	Python-2.4.4-gdbm-1.patch	34c3973ba2e519eaf1fd0ecf28ec465ed08bb96d
soundtouch	1.3.1	soundtouch-1.3.1.zip	d13437848ebe94b46b73fd5b05ba4420d4667527
unzip-security_fix-1	5.52	unzip-5.52-security_fix-1.patch	7f6a287e0b480be4748abdf69429dfc76383e1d6
unzip552	5.52	unzip552.tar.gz	1831bd5b69e607a69052f83b263384895e2d4a19
usbutils	0.72	usbutils-0.72.tar.gz	891b8825d964880146d5c980e52bb9e23d92fe2b
vorbis-tools	1.1.1	vorbis-tools-1.1.1.tar.gz	a1394b39905b389d72f12c2a9f0c86a33d07a487
vorbis-tools-utf8-1	1.1.1	vorbis-tools-1.1.1-utf8-1.patch	35db6e412cc9df5d8b88b58cae5f2e514bc17823
xerces-c-src	2.8.0	xerces-c-src_2_8_0.tar.gz	f0803b1330daec3f94b17dee64c3c99de6b3cd3e
xsd	3.1.0	xsd-3.1.0-i686-linux-gnu.tar.bz2	a7bf9b26ff5ab577fcfeccc9ea76134da88ec7e2
zip232	2.32	zip232.tar.gz	5bc562bf95d9aee0cb6625e6038898e1f191a4aa
lfs_graphics-2.7.0.0v-src.tar			
apache-ant	1.7.0	apache-ant-1.7.0-bin.zip	81aeb13c75edeee51dd5bb1c62001fba47b127a5
atk	1.18.0	atk-1.18.0.tar.bz2	d58dfe3dbda49d8e446e0bd4a0b6260d315ccb0
bdftopcf	1.0.2	bdftopcf-1.0.2.tar.bz2	245778068b5e5ccde07151635ded50da9033352 4
bigreqsproto	1.1.0	bigreqsproto-1.1.0.tar.bz2	32ae0505ec963cc5c0e3ee9258b126e5865d1b1b
cairo	1.8.10	cairo-1.8.10.tar.gz	fd5e8ca82ff0e8542ea4c51612cad387f2a49df3
compositeproto	0.4.1	compositeproto-0.4.1.tar.bz2	fb1ae34418855c313a75e8e697b414a4935e13d6
damageproto	1.2.0	damageproto-1.2.0.tar.bz2	ffe177a6ae2cf023d41e015aa6ece2b191cb8a8a
DirectFB	0.9.22	DirectFB-0.9.22.tar.gz	f3a586c654086c287cd1bce683be0f234973ee17
dmxproto	2.3	dmxproto-2.3.tar.bz2	a3636d1b54d7bbf273f28c0d3e44101777047865
dri2proto	2.2	dri2proto-2.2.tar.bz2	21e9e0e7e0be5fc971f51589d0373b0273202b7f
encodings	1.0.3	encodings-1.0.3.tar.bz2	615b8367ee20fc50688e4876aa280419927d64cc
fixesproto	4.1.1	fixesproto-4.1.1.tar.bz2	fb4792f0a529e08a56442a51968a02a22733085e5
font-adobe-100dpi	1.0.1	font-adobe-100dpi-1.0.1.tar.bz2	814baeef5ef6e6545b7e8f3bbbad377bc569042d
font-adobe-75dpi	1.0.1	font-adobe-75dpi-1.0.1.tar.bz2	3cbed8d4a6bba6ced3d6c07a238f8c9ab7a26c
font-adobe-utopia-100dpi	1.0.2	font-adobe-utopia-100dpi-1.0.2.tar.bz2	e692c3d3933c47c69656be0fd0f06218c2db138d
font-adobe-utopia-75dpi	1.0.2	font-adobe-utopia-75dpi-1.0.2.tar.bz2	2db08e2e0186831e4d68f7a2ffb2f9fe598a7280
font-adobe-utopia-type1	1.0.2	font-adobe-utopia-type1-1.0.2.tar.bz2	565eb66523f59f02da02aa9e74604634a2113643
font-alias	1.0.2	font-alias-1.0.2.tar.bz2	9a0e97d974349e3a943b0ab77015f115f15d34c3
font-arabic-misc	1.0.1	font-arabic-misc-1.0.1.tar.bz2	d11a7bdce7500c3ccc2fe59505f2bc89e4c7aa2a
font-bh-100dpi	1.0.1	font-bh-100dpi-1.0.1.tar.bz2	4f3edda5dd35145ebd1ce8759e0a999b3a04f9c0
font-bh-75dpi	1.0.1	font-bh-75dpi-1.0.1.tar.bz2	7b891d5bfd966c405c19574bca8f87b8803146d1

Appendix D, Page No. 13 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
DS200			
font-bh-lucidatypewriter-100dpi	1.0.1	font-bh-lucidatypewriter-100dpi-1.0.1.tar.bz2	a1c9d28a619358092f7196473ff3e0f0dc5304d0
font-bh-lucidatypewriter-75dpi	1.0.1	font-bh-lucidatypewriter-75dpi-1.0.1.tar.bz2	26efd25d2802c8406a96ccc3240b2cf4c511d19f
font-bh-ttf	1.0.1	font-bh-ttf-1.0.1.tar.bz2	0e9ffbc738072ca832cdf5f82bff071c67b71825
font-bh-type1	1.0.1	font-bh-type1-1.0.1.tar.bz2	b960d8523b02d4401dc6e1257f68dc120761ee4b
font-bitstream-100dpi	1.0.1	font-bitstream-100dpi-1.0.1.tar.bz2	baf63df365a591de5eb9e45fa302059d572dd171
font-bitstream-75dpi	1.0.1	font-bitstream-75dpi-1.0.1.tar.bz2	43344b8ff3b2c2fda8d4cdbee12c0688b2e04789
font-bitstream-type1	1.0.1	font-bitstream-type1-1.0.1.tar.bz2	53800b904fc3ead6b577a34fb7c1f96c1af4423f
fontconfig	2.8.0	fontconfig-2.8.0.tar.gz	570fb55ab14f2c92a7b470f941e9d35dbfafaf716
font-cronyx-cyrillic	1.0.1	font-cronyx-cyrillic-1.0.1.tar.bz2	df0f5974629dab97677a70fa70e21d2cf48071a0
font-cursor-misc	1.0.1	font-cursor-misc-1.0.1.tar.bz2	5087a94c74f8157cb6989f71fb3b4815b236065a
font-daewoo-misc	1.0.1	font-daewoo-misc-1.0.1.tar.bz2	d169eee1e92fe1e99f3ff6766d4c6cdcbb808860
font-dec-misc	1.0.1	font-dec-misc-1.0.1.tar.bz2	2489d19650f2a787b476bab2fa2412d20b95f38c
font-ibm-type1	1.0.1	font-ibm-type1-1.0.1.tar.bz2	9bcf72bcabfdbe218ad3a96ba2a45e92ef9efbc3
font-isas-misc	1.0.1	font-isas-misc-1.0.1.tar.bz2	13f607a669dd93dfdb08717a03efe47936ab9cca
font-jis-misc	1.0.1	font-jis-misc-1.0.1.tar.bz2	adb3275d19e71e9553aa8a5fdc3b2c647277d8d4
font-micro-misc	1.0.1	font-micro-misc-1.0.1.tar.bz2	74a8be2b0b6ace97d8841356e88570f5fa3faad6
font-misc-cyrillic	1.0.1	font-misc-cyrillic-1.0.1.tar.bz2	c178f8a8b6897a8382a0f1315a5b577760ba703c
font-misc-ethiopic	1.0.1	font-misc-ethiopic-1.0.1.tar.bz2	2677191fd8b515c53bde6402513249fc0f48d53a
font-misc-meltho	1.0.1	font-misc-meltho-1.0.1.tar.bz2	d20d9f8ffdeb88b62842b021d5d3d2a8cc31ea2e
font-misc-misc	1.1.0	font-misc-misc-1.1.0.tar.bz2	83c44111b5727c26e52eb915b66dc6c9eba4e458
font-mutt-misc	1.0.1	font-mutt-misc-1.0.1.tar.bz2	b677831b477027f56ad3f35c95ef3cd6711f87ac
font-schumacher-misc	1.1.0	font-schumacher-misc-1.1.0.tar.bz2	ea7e009e222379fa31a16bdbd4ca5b1e9d4f2944
font-screen-cyrillic	1.0.2	font-screen-cyrillic-1.0.2.tar.bz2	4795ea77e14246122d21bc0fa68a3c0d5261e39d
font-sony-misc	1.0.1	font-sony-misc-1.0.1.tar.bz2	e9717546682382ebf3e6e7039766fe52bdb8846c
fontsproto	2.1.0	fontsproto-2.1.0.tar.bz2	395b300fd5120a7ff90cb8fea4c2356b9632dc3e
font-sun-misc	1.0.1	font-sun-misc-1.0.1.tar.bz2	fc91999e66fe479d07ea74e5dd2d950ff02ccb80
font-util	1.1.1	font-util-1.1.1.tar.bz2	6ee3af5466de84d61411e173e578a256aeb1074d
font-winitzki-cyrillic	1.0.1	font-winitzki-cyrillic-1.0.1.tar.bz2	df9f476710783d784dfdbcb6af f34ef7746d3439
font-xfree86-type1	1.0.2	font-xfree86-type1-1.0.2.tar.bz2	09a4c9b8455f3f4954bfc9dd991d7fd1d0f5595a
freetype	2.3.12	freetype-2.3.12.tar.bz2	cbf0438429e0bcdd310059326d91646c3c91016b
giflib	4.1.4	giflib-4.1.4.tar.bz2	2f9aed5d20d862270008bd2f8d4c91cf14c6067b
glib	2.12.12	glib-2.12.12.tar.bz2	527bced2e6d38169c08c8712d5e3b6ebb0dc46b5
glproto	1.4.11	glproto-1.4.11.tar.bz2	7c2a723d488dc0e09e7e0e28bde838502d774b16
gtk-	2.10.13	gtk--2.10.13.tar.bz2	8d00b928a8788ff86d97197c20c18d41f9a1b1cd
iceauth	1.0.3	iceauth-1.0.3.tar.bz2	b75b87fed108bc4fe14ef06f76025016fa54299a
ImageMagick	6.2.8-0	ImageMagick-6.2.8-0.tar.bz2	637569bbcb331233c86258f6c681d5a7c849cba0
inputproto	2.0	inputproto-2.0.tar.bz2	3ed9879b7dd3c14ae2283959f5962162fc01c219
intltool	0.40.6	intltool-0.40.6.tar.bz2	4f8469e09e2c06a8072dffff36f84ff401d7ea75

Appendix D, Page No. 14 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
DS200			
jdk-6u27	6u27	jdk-6u27-linux-i586.bin	7a01bf274b265662acafacdd7b5740d1a3ab0539
jpeg-6b-destdir-1	v6b	jpeg-6b-destdir-1.patch	7b86d4e94a6350fe03f56b09565d780aa1f0cda4
jpegsrc	v6b	jpegsrc.v6b.tar.gz	7079f0d6c42fad0cfba382cf6ad322add1ace8f9
jre-6u27	6u27	jre-6u27-linux-i586.bin	5a5f2e304d6ef62ee6a56ccc322014cf3ccab2ad
kbproto	1.0.4	kbproto-1.0.4.tar.bz2	d30d745389d3a80d90c9a3e989651f228db48ee5
libdmx	1.1.0	libdmx-1.1.0.tar.bz2	8719434f167d476d53fca57c5be516c153354d60
libdrm	2.4.14	libdrm-2.4.14.tar.bz2	a18cc2cdfd02b8ba1c91c3e9ac609521ad3e2fe9
libfontenc	1.0.5	libfontenc-1.0.5.tar.bz2	e71370c349e93ba70f91ad1148ca9e5cabfcca4f
libFS	1.0.2	libFS-1.0.2.tar.bz2	41cf53fae37210acaa054199f01f36af3f3ec548
libICE	1.0.6	libICE-1.0.6.tar.bz2	ac1f702ea580bd496610266b13434858b62df9e1
libpciaccess	0.11.0	libpciaccess-0.11.0.tar.bz2	bcebba8b8441af151b59b63e8e91e66133b64158
libpng	1.2.42	libpng-1.2.42.tar.bz2	e41cea7a6f5e3065f4289de3742db87ded05b99d
libpthread-stubs	0.1	libpthread-stubs-0.1.tar.bz2	34ef40880d0112dc6d32b386d59ce94f2c139eef
librsvg	2.14.4	librsvg-2.14.4.tar.bz2	9314f0d44dbfe672dc1f1a65b66821593c3bf1ce
libSM	1.1.1	libSM-1.1.1.tar.bz2	dc535at7328dee9a6121b85c3f8041656681a195
libX11	1.3.3	libX11-1.3.3.tar.bz2	2a19724ccf78b5bb5a8eba9159d2b95e640e7b11
libXau	1.0.5	libXau-1.0.5.tar.bz2	b1c68843edf7e80ce952f7ee0541448f41bac202
libXaw	1.0.7	libXaw-1.0.7.tar.bz2	0e5ef7e33c4e44d960132e3dd50370134a28f8b2
libXcomposite	0.4.1	libXcomposite-0.4.1.tar.bz2	959180b067c64f3f7ae06c85400bd265c5579031
libXcursor	1.1.10	libXcursor-1.1.10.tar.bz2	096d0e538d37fd865705e5f45b0e96c7294c1f2f
libXdamage	1.1.2	libXdamage-1.1.2.tar.bz2	dc1f0c938e9bbc859c70cf2087440fe1f5b00bf1e
libXdmcp	1.0.3	libXdmcp-1.0.3.tar.bz2	7cfd71d29d6cfba797b8791398c4d81adc677d77
libXext	1.1.1	libXext-1.1.1.tar.bz2	c2cb8d8d760c6881c51c938812764d1d6ccfd51c
libXfixes	4.0.4	libXfixes-4.0.4.tar.bz2	3f2d1c473855ba0ef13137a80d585df7fc37111c
libXfont	1.4.1	libXfont-1.4.1.tar.bz2	f8dc669760975b41885143f828b54164224c8a31
libXft	2.1.14	libXft-2.1.14.tar.bz2	e08ac6b1f56c160f79b9f41bfab79933cc725c
libXi	1.3	libXi-1.3.tar.bz2	7685f2881cc40b13028d9409ccdbb9cf1cd0d8cf
libXinerama	1.1	libXinerama-1.1.tar.bz2	5f415194ef3318f66c287c0c69f778988a3f9266
libxkbfile	1.0.6	libxkbfile-1.0.6.tar.bz2	6364e0679eb893d6fbb6adcf0e8230cfdefe0b68
libXmu	1.0.5	libXmu-1.0.5.tar.bz2	c7ff596of2374852b941f909edbdeafc7d29322f
libXpm	3.5.8	libXpm-3.5.8.tar.bz2	3bfc833ed1527f74b1c66c386da62271d0313413
libXrandr	1.3.0	libXrandr-1.3.0.tar.bz2	33dd2f67060465f872db9ea03f597e28517f0c8e
libXrender	0.9.5	libXrender-0.9.5.tar.bz2	278f762feb8e754aa5214175abf580ff48628117
libXres	1.0.4	libXres-1.0.4.tar.bz2	d5ee9560a61666e6bb3d2285b9634fccd7211d65
libXScrnSaver	1.2.0	libXScrnSaver-1.2.0.tar.bz2	ea2935eb67ef3a77fd90372337f2d782a8ef74cea
libXt	1.0.7	libXt-1.0.7.tar.bz2	3c285b9c04a393dec1cc3d60cf5582d798eb3272
libXtst	1.1.0	libXtst-1.1.0.tar.bz2	4363e9285bfb5a884073efacc50d39edb803a1a5
libXv	1.0.5	libXv-1.0.5.tar.bz2	3936dd661c75d173b9fd1da9d97c57206965725 4
libXvMC	1.0.5	libXvMC-1.0.5.tar.bz2	153b85884f22b882cecb9fc462fe24c669a80dbd
libXxf86dga	1.1.1	libXxf86dga-1.1.1.tar.bz2	a93004cfbe4f0dbc37c6645705d5a6d90c0940b7

Appendix D, Page No. 15 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
DS200			
libXxf86vm	1.1.0	libXxf86vm-1.1.0.tar.bz2	f5ec7854f201d9e69dfedd13123b51f497b69a47
makedepend	1.0.2	makedepend-1.0.2.tar.bz2	57e092856580d9984e47c4b1433b69391de07df3
mkfontdir	1.0.5	mkfontdir-1.0.5.tar.bz2	971728b0f453ea5df028aa5d54fe3fbdb8e99a7d
mkfontscale	1.0.7	mkfontscale-1.0.7.tar.bz2	0a0c25da68c87380e2c013c808a6e0cc0983f6e9
pango	1.16.4	pango-1.16.4.tar.bz2	6a21126632cd99950818c64d8598b6c92f47da58
pixman	0.15.20	pixman-0.15.20.tar.gz	a5f973b6895c269731964fbc328f61a8cbfdc931
randrproto	1.3.1	randrproto-1.3.1.tar.bz2	36731bac66815453af4b055c26ad8e9c2653ca05
recordproto	1.14	recordproto-1.14.tar.bz2	212928572898cd150366c6026c2694b193f79f79
renderproto	0.11	renderproto-0.11.tar.bz2	d30ef508b1a1b5f0deb1c6db41ba2f4c57680632
resourceproto	1.1.0	resourceproto-1.1.0.tar.bz2	36b86840005c15e393c86d7075688d430ab2a11d
scrnsaverproto	1.2.0	scrnsaverproto-1.2.0.tar.bz2	c734cfe9a1ce57fd42957389dcc90518fd7ca6b6
sessreg	1.0.5	sessreg-1.0.5.tar.bz2	d1cbac6d398b23ed44b67286ea083e9071bd00e7
setxkbmap	1.1.0	setxkbmap-1.1.0.tar.bz2	f02f93a08ac060d760566693c748c0fba3db8a06
smproxy	1.0.3	smproxy-1.0.3.tar.bz2	1ba44a4a58b05d6a6f7c4b1f67b793dcc2ccf2ba
splashy	0.3.12	splashy-0.3.12.tar.gz	4c721222b20b8fd3fbb8c815cd5c0f05cccad68a
tiff	3.8.2	tiff-3.8.2.tar.gz	549c67b6a15b42bfcd72fcf7cda7c9a198a393dc
twm	1.0.4	twm-1.0.4.tar.bz2	7456c90f19c4747c17851596b93f692d68a9f079
util-macros	1.5.0	util-macros-1.5.0.tar.bz2	ac61387bc2a0b97f839041832bd8d06c03efc942
videoproto	2.3.0	videoproto-2.3.0.tar.bz2	4aef2b138d45b3ab75e640996ce1267d3468f18c
x11perf	1.5.1	x11perf-1.5.1.tar.bz2	d1f85da3df5b21d6a64c1735d109380214787222d
xauth	1.0.4	xauth-1.0.4.tar.bz2	90d32f28bb61ca6d831dcc35429a5ad53be73283
xbacklight	1.1.1	xbacklight-1.1.1.tar.bz2	3541ab5e0956b4f0c97b1200dc32a35d2ccb0f0f
xbitmaps	1.1.0	xbitmaps-1.1.0.tar.bz2	845b825f7e6d193d47db8b67ae8332d87ef8c2b3
xclock	1.0.4	xclock-1.0.4.tar.bz2	1987cafb31d3c6b68be7ecfbe143c8cd373d64bb
xcmiscproto	1.2.0	xcmiscproto-1.2.0.tar.bz2	1a55e042b33c0e0aaf2299942315a5208d644707
xcmsdb	1.0.2	xcmsdb-1.0.2.tar.bz2	8341f7219a5720da758b0571eb1f4d9072265485
xcursorgen	1.0.3	xcursorgen-1.0.3.tar.bz2	7df26b371476654dc191c45e7d20ne3a5e0cad87
xcursor-themes	1.0.2	xcursor-themes-1.0.2.tar.bz2	12b865c17c65e70a6bc20300dfa660fe8faaa0a4
xdpyinfo	1.1.0	xdpyinfo-1.1.0.tar.bz2	01971f00704Sa46a4a31a69c661bc3a378de60f0
xdriinfo	1.0.3	xdriinfo-1.0.3.tar.bz2	d211d6f12f4c801d2f4cf184c6daae37aa5858ff
xev	1.0.4	xev-1.0.4.tar.bz2	4f62e131b96842eef1660e8869533cd3923ac35
xextproto	7.1.1	xextproto-7.1.1.tar.bz2	1bb4bd12d65a17b316sdc9b4e028b33a2f7b2cad
xf86bigfontproto	1.2.0	xf86bigfontproto-1.2.0.tar.bz2	312a2ea708b257520c1af4393b69d73a393a478f
xf86dgaproto	2.1	xf86dgaproto-2.1.tar.bz2	97a06120e7195c968875e8ba42e82c90ab54948b
xf86driproto	2.1.0	xf86driproto-2.1.0.tar.bz2	0dfc6616ff268ea3c3b5dccb1c565aaa93bc8548
xf86-input-keyboard	1.4.0	xf86-input-keyboard-1.4.0.tar.bz2	5061fdaff8b7ddcbcca82f065c4abbfff255a1da
xf86-input-mouse	1.5.0	xf86-input-mouse-1.5.0.tar.bz2	b9213bf745b793a3da2c946ea4d8ee5768e560f4
xf86-video-vesa	2.3.0	xf86-video-vesa-2.3.0.tar.bz2	4689b7c295d7a8d7326302dafecb812739617134
xf86vidmodeproto	2.3	xf86vidmodeproto-2.3.tar.bz2	22d034c2f66985f8541b9ea3421096ceaa006355

Appendix D, Page No. 16 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
DS200			
Xgamma	1.0.3	xgamma-1.0.3.tar.bz2	f9c7d93f4b271bab41ee3e91b371d52572e46d8c
xhost	1.0.3	xhost-1.0.3.tar.bz2	cbedecdc908c642c527ecbbdc6ba8084d90c04f6
xineramaproto	1.2	xineramaproto-1.2.tar.bz2	3c397c9ea38aaae785dd7901f250891dfa7f3249
ximil	1.2.0	ximil-1.2.0.tar.bz2	85a838c2010f27cf6d09d6ce4b1208a66cc8d697
xinput	1.5.0	xinput-1.5.0.tar.bz2	02d1cce83007aa7848b1b024ae64c310303f973c
xkbcomp	1.1.1	xkbcomp-1.1.1.tar.bz2	aeb733c195d7afd42136bf8ae5c6e792c63f0b4b
xkbevd	1.1.0	xkbevd-1.1.0.tar.bz2	b510b4a1b7486beacb5570c204f7fdd4b61f0ab4
xkbutils	1.0.2	xkbutils-1.0.2.tar.bz2	2c925038ca12ee2494b2401ea2c12c74fe88bf91
xkeyboard-config	1.7	xkeyboard-config-1.7.tar.bz2	d6df43bfc0596be04865f2be7c4e794e198358c8
xkill	1.0.2	xkill-1.0.2.tar.bz2	90f08652859daf71b682c3b9163ebf72ce88c4bc
xlsatoms	1.0.2	xlsatoms-1.0.2.tar.bz2	3855734b5ec0d43b5886ac0ffa58d7cf96f46926
xlsclients	1.0.2	xlsclients-1.0.2.tar.bz2	5cde39a28c5352d1d555714836f37c05197e419d
XML-Parser	2.36	XML-Parser-2.36.tar.gz	74acac4f939ebf788d8ef5163cbc9802b1b04bfa
xmodmap	1.0.4	xmodmap-1.0.4.tar.bz2	9b49388bb527a8f7b7e86c4ac4c75a83372f6baa
xorg-server	1.7.1	xorg-server-1.7.1.tar.bz2	d31c259b3ab975e2c1baea8f7310b57152ae3c62
xpr	1.0.3	xpr-1.0.3.tar.bz2	9dbd0ff136b612285e00d92d0c7675a4207b1c4a
xprop	1.1.0	xprop-1.1.0.tar.bz2	16b377c76a4a010200063a056e7a5e244ab6ff00
xproto	7.0.16	xproto-7.0.16.tar.bz2	0edu5588d42f2c810d8491da44f684a4093ef2bc
xrandr	1.3.2	xrandr-1.3.2.tar.bz2	0e49b0a0889ac8a590452c6cd0d6f0a2253a8d940
xrdb	1.0.6	xrdb-1.0.6.tar.bz2	e4faff3e02b3027298dc589e318a6dc7eb30a6d5
xrefresh	1.0.3	xrefresh-1.0.3.tar.bz2	3f34ceca9509f47e60ddfe14a98225eaffeba705
xset	1.1.0	xset-1.1.0.tar.bz2	f0429544282f826092b17248c1ad65c16cd860cf
xsetroot	1.0.3	xsetroot-1.0.3.tar.bz2	56cd1df9834627a107550475629df51275cd0e44
xterm	254	xterm-254.tgz	934811737745b76ca75bf940fcb975943bf1084d
xtrans	1.2.5	xtrans-1.2.5.tar.bz2	c8c4cc58b42d05c613fc535319a7d7f45f30f3c9
xvinfo	1.1.0	xvinfo-1.1.0.tar.bz2	8695bf0597dbf3cd8c3277fddda4722da2fbaaa3
xwd	1.0.3	xwd-1.0.3.tar.bz2	f6708d14040630d1d3255987c28cfcbf7ace05aa
xwininfo	1.0.5	xwininfo-1.0.5.tar.bz2	973db0d1bd75b8bc5bc399f56cab9f5aee3bcfc
xwud	1.0.2	xwud-1.0.2.tar.bz2	15a6c5e3ffc03b7e8e597947061940fee6c0a9fc

Software Product	Software Version	Filename	SHA256 Hash Value
DS850			
BAPIS	412	COTS-412.tar.bz2	07e4317efb1eec055046a2a55bacb2a0b1b92608
cryptocme	3.0	cryptocme-3.0-rhel30.tar.gz	4fc8c6a6ddbf524cfa88c3c6cf195447afc87977
Linux From Scratch	6.2.5	lfslivecd-x86-6.2-5.iso	b3e3947bf2c3616fa45541c0643a2adfa0618207
lfs_enhanced-2.4.0.0m-src.tar			
alsa-lib	1.0.13	alsa-lib-1.0.13.tar.bz2	82fa9a7fcb43b319524b18451ca86d691a20f4a3
alsa-utils	1.0.13	alsa-utils-1.0.13.tar.bz2	05b460a0e7ae6519ea37240476f026b59dbc710d
aumix	2.8	aumix-2.8.tar.bz2	5cea563ae91f628433a1950a36efd23681da4bf4
beecrypt	4.1.2	beecrypt-4.1.2.tar.gz	71cebd3329bb2561ffba24a2004dfac50b143f59
blfs-bootscripts	20060910	blfs-bootscripts-20060910.tar.bz2	58ff10492f9abceed6ca4a105c479d5f2e3e8002
BLFS-cn-bundle	3.12.5	BLFS-cn-bundle-3.12.5.tar.bz2	8cf4be3072184940f8cfc3888ef0ba1cb58a5377
boost	1.43.0	boost_1_43_0.tar.bz2	b8257b7da2a7222739314f8d1e07e217debe71d6
chkrootkit	0.49	chkrootkit-0.49.tar.gz	cec1a3c482b95b20d3a946b07fffb23290abc4a6
coreutils	6.9	coreutils-6.9.tar.bz2	10310a78c4e1d9f742f3815ac28e9bf1086a5885
cpio	2.6	cpio-2.6.tar.gz	5a4ea156519909994fe05933dc823abcf07e3e21
cpio-security-fixes-1	2.6	cpio-2.6-security_fixes-1.patch	d8445256032b903bbd3cee2694e87412e7dca843
ctags	5.6	ctags-5.6.tar.gz	930afaa138624717393fe475201f795251bd5e5e
curl	7.15.3	curl-7.15.3.tar.bz2	7e764126ce564429fe2f142428a27cbfc8fb69ee
cvs	1.11.22	cvs-1.11.22.tar.bz2	5dfb11db84a890d7d61516fd450c001dc24bcc0d
cvs-zlib-1	1.11.22	cvs-1.11.22-zlib-1.patch	0d20bab8a6b6c419a8c900d082b487ad6a3ace38
dmidecode	2.9	dmidecode-2.9.tar.bz2	0346690d32120b9fff22accd5b4e731414a3676b
docbook-xsl	1.69.1	docbook-xsl-1.69.1.tar.bz2	aaabf0e274609f34e187a6e36d2be23f3471f507
dosfstools	2.11	dosfstools-2.11-src.tar.gz	b0d8714475ca7e7a96a46adf7c4839d69ec2f412
expat	2.0.1	expat-2.0.1.tar.gz	663548c37b996082db1f2f2c32af060d7ad15c2d
fuse	2.6.1	fuse-2.6.1.tar.gz	85cc4458d0ab2647b8b43605f0200006d89981cd
gnupg	1.4.3	gnupg-1.4.3.tar.bz2	9c96b36c4f4d1c8bc5028c99f6c674482cdrlb370
gpm	1.20.1	gpm-1.20.1.tar.bz2	e48d937c62abb4338c2f6439b34cf3332c89af8d1
gpm-segfault-1	1.20.1	gpm-1.20.1-segfault-1.patch	da53bf78a0cbaa5020c332aa6d68611591706d86
gpm-silent-1	1.20.1	gpm-1.20.1-silent-1.patch	8899a212cadfbda201d8da3e44590bd05b97f9f6
libao	0.8.6	libao-0.8.6.tar.gz	2050c008ffcfd6803e2c2c03c7d5f469b6d8379e
libogg	1.1.3	libogg-1.1.3.tar.gz	a3c495a8baf6939cfad7c0bd11cc0c466838c3db
libusb	0.1.12	libusb-0.1.12.tar.gz	599a5168590f66bc6f1f9a299579fd8500614807
libvorbis	1.1.2	libvorbis-1.1.2.tar.gz	26289fc41aa543Gb1a277d726bb5cb106d675c35
libxml2	2.6.31	libxml2-2.6.31.tar.gz	97233a210425bad96b35e52aa3e0010ac11bbcc9
libxslt	1.1.22	libxslt-1.1.22.tar.gz	55ce4dc659681d9a5ba2322c45cbdfe75b46639c
logrotate	3.7.8	logrotate-3.7.8.tar.gz	5742dc0d9541ac59eba5f5718520f7504aea2159
LPRng	3.8.28	LPRng-3.8.28.tgz	f4373004adb1439819600701bb98517137daf1fc
net-tools	1.60	net-tools-1.60.tar.bz2	944fb70641505d5d1139dba3aeb81ba124574b83
net-tools	1.60	net-tools-1.60.tar.gz	4e8100957be645241d685055ebdde9d5c744cb54
net-tools-gcc34-3	1.60	net-tools-1.60-gcc34-3.patch	a92286932a423fc987f2a152931d05b0a9a312bd
net-tools-gcc34-3	1.60	net-tools-1.60-gcc34-3.patch	a92286932a423fc987f2a152931d05b0a9a312bd
net-tools-kernel_headers-2	1.60	net-tools-1.60-kernel_headers-2.patch	3c59577c904582503b25e7b21f6e3b77b165f84a

Appendix D, Page No. 18 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
DS850			
net-tools-kernel_headers-2	1.60	net-tools-1.60-kernel_headers-2.patch	3e59577e904582503b25c7b21f6e3b77b165f84a
net-tools-mii_ioctl-1	1.60	net-tools-1.60-mii_ioctl-1.patch	912613acbf3a000a2935391a14c55b5ecdeeae6b
net-tools-mii_ioctl-1	1.60	net-tools-1.60-mii_ioctl-1.patch	912613acbf3a000a2935391a14c55b5ecdeeae6b
ntfsprogs	1.13.1	ntfsprogs-1.13.1.tar.gz	a4e50f6fc10fcc1e1f562ad64bcbf9a0d46ca72a
null	2.2.2	null-2.2.2.tar.gz	f54ee909b229931f0f91b4a360f0447b539d4ea6b
openssh	4.5p1	openssh-4.5p1.tar.gz	2ecfcbbcb9e4f0f16fa4500dccf07d1a09d3cf02d7
openssl	0.9.8n	openssl-0.9.8d-fix_manpages-1.patch	afb498051e466131ae90dfc678234e8876af88a4
openssl-fix_manpages-1	0.9.8n	openssl-0.9.8n.tar.gz	595f5ebf592568515964f0adc62239e7012ef08b
pkg-config	0.22	pkg-config-0.22.tar.gz	3ec40bda9864d7aa3e912c6ae87a750fd8b6e420
popt	1.10.4	popt-1.10.4.tar.gz	10c6649e4c37ecfb6f04296aeca609b5fdd5e34d
ppp	2.4.4	ppp-2.4.4.tar.gz	9b91b0117e0a8bfaf8e4e894af79e0960dd36259
Python	2.4.4	Python-2.4.4.tar.bz2	9e0971f93df8acba947378d0df6a32fcc8897ba2
Python-gdbm-1	2.4.4	Python-2.4.4-gdbm-1.patch	34c3973ba2c519caf1fd0eef28ce465ed08bb96d
unzip552	5.52	unzip-5.52-security_fix-1.patch	7f6a287e0bf480be1748abdf69429dfc76383e1d6
unzip-security_fix-1	5.52	unzip552.tar.gz	1831bd59b9e607a69052f83b2633384895c2d4a19
usbutils	0.72	usbutils-0.72.tar.gz	891b8825d964880146d5e980e52bb9e23d92fe2b
vorbis-tools	1.1.1	vorbis-tools-1.1.1.tar.gz	a1394b39905b389d72f12c2a9f0c86a63d07a487
vorbis-tools-utf8-1	1.1.1	vorbis-tools-1.1.1-utf8-1.patch	35db6e412ce9df5d8b88b58cac5f2c514bc17823
xerces-c-src	2.8.0	xerces-c-src_2_8_0.tar.gz	f0803b1330daec3f44b17dee64c3c99de6b3cd3e
xsd	3.1.0-i686-linux-gnu	xsd-3.1.0-i686-linux-gnu.tar.bz2	a7bf9b26ff5ab877fcfecce9ea76134da88ec7e3
zip232	2.32	zip232.tar.gz	5ba562b0f95d9aea0cb6625e6038898a1f191a4aa
lfs_graphics-2.4.0.0m-src.tar			
a2ps	4.14	a2ps-4.14.tar.gz	365abbbe4b7128bf70dad16d06e23e5701874852
atk	1.18.0	atk-1.18.0.tar.bz2	d58dfc3dbdad49d8e446e0bd4a0b6260d515ceb0
bdftopcf	1.0.2	bdftopcf-1.0.2.tar.bz2	245378068b5e5eede07151635ded50da90333524
bigreqsproto	1.1.0	bigreqsproto-1.1.0.tar.bz2	32ae0505ec963ee5c0e3ee9258b126e6865d1b1b
cairo	1.4.14	cairo-1.4.14.tar.gz	63310243ba8af949060b06c01fc28ee5471ed5a4
compositeproto	0.4.1	compositeproto-0.4.1.tar.bz2	fb1ae34418855c313a75e8e697b414a4935e13d6
damageproto	1.2.0	damageproto-1.2.0.tar.bz2	ffe177a6ae2cf023d41e015aa6ece2b191eb8a8a
DirectFB	0.9.22	DirectFB-0.9.22.tar.gz	f3a586c654086c287cd1bec683be0f234923ee17
dmxproto	2.3	dmxproto-2.3.tar.bz2	a3636d1b54d7bbf273f28c0d5c44101777047865
dri2proto	2.2	dri2proto-2.2.tar.bz2	21e9e0c7e0be5fe971f51589d0573b0273202b7f
encodings	1.0.3	encodings-1.0.3.tar.bz2	615b8367ee20fc50688e4876aa250419927d64cc
fbida	2.07	fbida-2.07.tar.gz	4758178299e09d5251b9cf20337a81cc20553d45
fixesproto	4.1.1	fixesproto-4.1.1.tar.bz2	fb47920c629e08a56442a51968a02a22733085e5
font-adobe-100dpi	1.0.1	font-adobe-100dpi-1.0.1.tar.bz2	814baccf5cf6c6545b7e8f3bbbad377be369042d
font-adobe-75dpi	1.0.1	font-adobe-75dpi-1.0.1.tar.bz2	3cbed8a4a3a6bbe6ccd3d6e07a238f8c9ab7a26c

Appendix D, Page No. 19 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
DS850			
font-adobe-utopia-100dpi	1.0.2	font-adobe-utopia-100dpi-1.0.2.tar.bz2	e692c3d3933c47c6965cbe0f80f06218c2db138d
font-adobe-utopia-75dpi	1.0.2	font-adobe-utopia-75dpi-1.0.2.tar.bz2	2db08c2e0186831c4d68f7a2ffb2f9fe598a7280
font-adobe-utopia-type1	1.0.2	font-adobe-utopia-type1-1.0.2.tar.bz2	565cb66523f59f02da02aa9c74604634a2113643
font-alias	1.0.2	font-alias-1.0.2.tar.bz2	9a0e97d974349e3a943b0ab77015f115f15d34c3
font-arabic-misc	1.0.1	font-arabic-misc-1.0.1.tar.bz2	d11a7bdce7500c3ccc2fe59505f2bc89e1c7aa2a
font-bh-100dpi	1.0.1	font-bh-100dpi-1.0.1.tar.bz2	4f3edda5dd35145cbd1ce8759e0a999b3a04f9c0
font-bh-75dpi	1.0.1	font-bh-75dpi-1.0.1.tar.bz2	7b891d5bfd966c405c19574bca8f87b8803146d1
font-bh-lucidatypewriter-100dpi	1.0.1	font-bh-lucidatypewriter-100dpi-1.0.1.tar.bz2	a1c9d28a619358092f7196473ff3c0f0de5304d0
font-bh-lucidatypewriter-75dpi	1.0.1	font-bh-lucidatypewriter-75dpi-1.0.1.tar.bz2	26efd25d2802c8406a96ccc3240b2c14e511d49f
font-bh-ttf	1.0.1	font-bh-ttf-1.0.1.tar.bz2	0e9ffbc738072ea832cdf5f82bff071c62b71825
font-bh-type1	1.0.1	font-bh-type1-1.0.1.tar.bz2	b960d8523b02d4401de6c1257f68de120761cc4b
font-bitstream-100dpi	1.0.1	font-bitstream-100dpi-1.0.1.tar.bz2	ba163df365a591dc5cb9e45fa302059d572ddf71
font-bitstream-75dpi	1.0.1	font-bitstream-75dpi-1.0.1.tar.bz2	43344b8ff3b2c2fda8d4cdbcef2c0688b2c04789
font-bitstream-type1	1.0.1	font-bitstream-type1-1.0.1.tar.bz2	53800b904f3cad6b577a34fb7c1f96c1af4423f
fontconfig	2.8.0	fontconfig-2.8.0.tar.gz	570fb55eb14f2c92a7b470b941e9d35dbfafa716
font-cronyx-cyrillic	1.0.1	font-cronyx-cyrillic-1.0.1.tar.bz2	dfff5974629dab97677a70fa20e21c2cf48071a0
font-cursor-misc	1.0.1	font-cursor-misc-1.0.1.tar.bz2	5087a94c74f8157cb6989f71fb3b4815b236065a
font-daewoo-misc	1.0.1	font-daewoo-misc-1.0.1.tar.bz2	d169cec1e92fe1e99f3ff6766d4c6edcbb808860
font-dec-misc	1.0.1	font-dec-misc-1.0.1.tar.bz2	2489d19650f2a787b476dab2fa2412d20b95f38e
font-ibm-type1	1.0.1	font-ibm-type1-1.0.1.tar.bz2	9bcf72bcabfcbe218ad3a96ba2a45e92ef9efbc3
font-isas-misc	1.0.1	font-isas-misc-1.0.1.tar.bz2	13fe07a669dd93dfdb08717a03efe47936ab9cea
font-jis-misc	1.0.1	font-jis-misc-1.0.1.tar.bz2	adb3275d19e71e9553an8a5fdc3b2c647277d8d4
font-micro-misc	1.0.1	font-micro-misc-1.0.1.tar.bz2	74a8be2b0b6ace97d8841356e88570f5fa3faad6
font-misc-cyrillic	1.0.1	font-misc-cyrillic-1.0.1.tar.bz2	c178f8a8b6897a8382a0f4315a5b577760ba703c
font-misc-ethiopic	1.0.1	font-misc-ethiopic-1.0.1.tar.bz2	2677191fd8b515c53bde6402513249fc0f48d53a
font-misc-meltho	1.0.1	font-misc-meltho-1.0.1.tar.bz2	d20d9f8ffdeb88b62842b021d5d3d2a8cc31ea2c
font-misc-misc	1.1.0	font-misc-misc-1.1.0.tar.bz2	83c44111b5727c26e52eb915b66dc6c9eba4c458
font-mutt-misc	1.0.1	font-mutt-misc-1.0.1.tar.bz2	b677831b477027f56ad3f35c95ef3cd6711f87ac
font-schumacher-misc	1.1.0	font-schumacher-misc-1.1.0.tar.bz2	ea7e009e222379fa31a16bdbd4ca5b1e9d412944
font-screen-cyrillic	1.0.2	font-screen-cyrillic-1.0.2.tar.bz2	4795ea77e14246f22cf21be0fa68a3c0f5261e39d
font-sony-misc	1.0.1	font-sony-misc-1.0.1.tar.bz2	e9717546682382cbf3e6e70397667e52bdb8846c
fontsproto	2.1.0	fontsproto-2.1.0.tar.bz2	395b300fd5120a7ff90cb8fea4e2356b9632dc3e
font-sun-misc	1.0.1	font-sun-misc-1.0.1.tar.bz2	fc91999e66fe479d07ea74e5dd2d950f02cdd80
font-util	1.1.1	font-util-1.1.1.tar.bz2	6ce3af5466dc84d6f4f1e173e578a256acb1074d
font-winitzki-cyrillic	1.0.1	font-winitzki-cyrillic-1.0.1.tar.bz2	d19f4767f0783d784dfdbcb6a1f34cf7246d3439
font-xfree86-type1	1.0.2	font-xfree86-type1-1.0.2.tar.bz2	09a4c9b8455f3f4954bfc9dd991d7fd1d0f5595a

Appendix D, Page No. 20 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
DS850			
freetype	2.3.12	freetype-2.3.12.tar.bz2	eb0438429c0bcdd510059326d91646c3c91016b
giflib	4.1.4	giflib-4.1.4.tar.bz2	2f9aed5d20d862270008bd2f8d4e91cf14c6067b
glib	2.12.12	glib-2.12.12.tar.bz2	527bced2e6d38169c08c8712d5e3b6ebb0dc46b5
glproto	1.4.11	glproto-1.4.11.tar.bz2	7e2a723d488dc0b09c7c0c28bdc838502d774b16
gperf	3.0.3	gperf-3.0.3.tar.gz	3c535d2727eb0dea10ca87ccfa03720a8280c7a2
gtk+	2.10.13	gtk+-2.10.13.tar.bz2	8d00b928a8788ff86d97197c20c18d41f9a1b1cd
iceauth	1.0.3	iceauth-1.0.3.tar.bz2	b75b87fed108bc4fe14ef06f76025016fa54299a
ImageMagick	6.2.8-0	ImageMagick-6.2.8-0.tar.bz2	637569bbcb331233c86258f6c681d5a7c849cba0
inputproto	2.0	inputproto-2.0.tar.bz2	3ed9879b7dd3c14ae2283959f5962162fc01c219
intltool	0.40.6	intltool-0.40.6.tar.bz2	4f6469e09e2c06a8072dffff36f84ff401d7ea75
jpeg-6b-destdir-1	v6b	jpeg-6b-destdir-1.patch	7b86d4e94a6350fc03f56b09565d780aa1f0eda4
jpegsrc	v6b	jpegsrc.v6b.tar.gz	7079f0d6c42fad0cfba382cf6ad322addlace8f9
kbproto	1.0.4	kbproto-1.0.4.tar.bz2	d300745389d3a80d00c9a3c989651f228db486e5
libdmx	1.1.0	libdmx-1.1.0.tar.bz2	8719434f167d476d53fca57c5be516c153354d60
libdrm	2.4.14	libdrm-2.4.14.tar.bz2	a18cc2cdfd02b8ba1c91c3e9ac609521ad3e2fe9
libexif	0.6.19	libexif-0.6.19.tar.bz2	820f07ff12a8cc720a6597d46277f01498c8aba4
libfontenc	1.0.5	libfontenc-1.0.5.tar.bz2	e71370c349e93ba70f91ad1148ca9e5cabfcca4f
libFS	1.0.2	libFS-1.0.2.tar.bz2	41cf53fae3721 0acaa034199f01f36af3f3ec548
libICE	1.0.6	libICE-1.0.6.tar.bz2	acf702ca580bd49661 0266b13434858b62df9ef
libpciaccess	0.11.0	libpciaccess-0.11.0.tar.bz2	bcebba8b8441af151b59b63e8e91e66133b64158
libpng	1.2.42	libpng-1.2.42.tar.bz2	e41 ceu7a6f5e3063f4289de3742db87ded05b99d
libpthread-stubs	0.1	libpthread-stubs-0.1.tar.bz2	34cf40880d01f2dc6f32f386d59cc94f2cf39eef
librsvg	2.14.4	librsvg-2.14.4.tar.bz2	9314f0d44dbfc672de1f1a65b66821593c3bffaa
libSM	1.1.1	libSM-1.1.1.tar.bz2	de535af7328dcc9a6121b85c3f8041656681a195
libX11	1.3.3	libX11-1.3.3.tar.bz2	2a19724cef78b5bb5a8cba9159d2b95c640c7b11
libXau	1.0.5	libXau-1.0.5.tar.bz2	b1c68843cdf7c80cc952f7cc0541448f41bac202
libXaw	1.0.7	libXaw-1.0.7.tar.bz2	0c5cffc33c4c44d960132c3dd50370134a28f8b2
libXcomposite	0.4.1	libXcomposite-0.4.1.tar.bz2	9591 80b067c64f3f7ac06e85400bd265e5579031
libXcursor	1.1.10	libXcursor-1.1.10.tar.bz2	096d0e538d37fd865705e5f45b0e96c7294c1f2f
libXdamage	1.1.2	libXdamage-1.1.2.tar.bz2	de1fbc938a9bbc859e70cf2087440fc15b00bb1c
libXdmcp	1.0.3	libXdmcp-1.0.3.tar.bz2	7efd71d29d6cfba797b8791398e4d81ade677d77
libXext	1.1.1	libXext-1.1.1.tar.bz2	c2eb8d8d760c6881e51c938812764d1d6cefd51c
libXfixes	4.0.4	libXfixes-4.0.4.tar.bz2	3f2d1c473855ba0cf13137a80d585df7fe371111c
libXfont	1.4.1	libXfont-1.4.1.tar.bz2	f8dc669760975b41885143f828b54164224c8a31
libXft	2.1.14	libXft-2.1.14.tar.bz2	e08ae6b1f56c160179b9f141b4ab799333ec725e
libXi	1.3	libXi-1.3.tar.bz2	7685f2881ce40b13028d9409eedbb9cf1ed0d8ef
libXinerama	1.1	libXinerama-1.1.tar.bz2	5f445194ef3318f66c287c0c69f778988a3f9266
libxkbfile	1.0.6	libxkbfile-1.0.6.tar.bz2	6364e0679eb893d6fbb6adcf0e8230cfdefe0b68

Software Product	Software Version	Filename	SHA256 Hash Value
DS850			
libXmu	1.0.5	libXmu-1.0.5.tar.bz2	e7ff5960f23748526941f909edbdeafe7df29322f
libXpm	3.5.8	libXpm-3.5.8.tar.bz2	3bfe833ed4527f74b1e66e386da62271d0313413
libXrandr	1.3.0	libXrandr-1.3.0.tar.bz2	33dd2f67060465f872db9ea03f597e28517f0c8e
libXrender	0.9.5	libXrender-0.9.5.tar.bz2	278f762feb8e754aa5214175abf580ff186281f7
libXres	1.0.4	libXres-1.0.4.tar.bz2	d5ca9560a61666c6bb3d2285b9634feed7211d65
libXScrnSaver	1.2.0	libXScrnSaver-1.2.0.tar.bz2	ea2935eb67efa77fd90372333f2d782a8ef74cea
libXt	1.0.7	libXt-1.0.7.tar.bz2	3c285b9c04a393dec1cc3d60cf5582d798eb3272
libXtst	1.1.0	libXtst-1.1.0.tar.bz2	4363e9285btb5a884073eface50d39edb803a1a5
libXv	1.0.5	libXv-1.0.5.tar.bz2	3936dd661e75d173b9fd1da9d97e5720e9657254
libXvMC	1.0.5	libXvMC-1.0.5.tar.bz2	153b85884f22b882cecb9fc462fe24c669a80dbd
libXxf86dga	1.1.1	libXxf86dga-1.1.1.tar.bz2	a93004ctbe4fd6bc37c6645705d5a6d90c0940b7
libXxf86vm	1.1.0	libXxf86vm-1.1.0.tar.bz2	f5ce7854f201d9c69dfcdd13123b5ff497b69a47
makedepend	1.0.2	makedepend-1.0.2.tar.bz2	57e092856580d9984e47e4b1433b69391de07df3
mkfontdir	1.0.5	mkfontdir-1.0.5.tar.bz2	971728b0f453ea5df028aa5d54fe3fbdb8e99a7d
mkfontscale	1.0.7	mkfontscale-1.0.7.tar.bz2	0a0c25da68c87380e2c013c808a6e0cc0983fae9
pango	1.16.4	pango-1.16.4.tar.bz2	6a21126632ed99950818c64d8598b6e92fa7da58
pixman	0.15.20	pixman-0.15.20.tar.gz	a5f973b6895e269731964fbe328f61a8cbfdc931
qt-x11-opensource-src	4.5.0	qt-x11-opensource-src-4.5.0.tar.gz	503842349b644f16af6e6c735bec7174ebed6245
randrproto	1.3.1	randrproto-1.3.1.tar.bz2	36731bac6c815453a4f4b055c26ad8c9c2653ca05
recordproto	1.14	recordproto-1.14.tar.bz2	212928572898ed150366c6026e2694b193ff9f79
renderproto	0.11	renderproto-0.11.tar.bz2	d30cf508b1a1bf0deb1c6db41ba2f4e57680637
resourceproto	1.1.0	resourceproto-1.1.0.tar.bz2	36b86840005e15c393c86d7075688d430ab2a11d
scrnsaverproto	1.2.0	scrnsaverproto-1.2.0.tar.bz2	c734efc9af-ee57fd42937389dee90518fd7ca6b6
sessreg	1.0.5	sessreg-1.0.5.tar.bz2	d1dac6a398b23cd44bb67286cc083c9071bd00c7
setxkbmap	1.1.0	setxkbmap-1.1.0.tar.bz2	f02f93a08ae060d760566693c748c0fba3db8a06
smproxy	1.0.3	smproxy-1.0.3.tar.bz2	1ba44a4a58b05d6a6f7e1b1f67b793dcc2ccf2ba
splashy	0.3.12	splashy-0.3.12.tar.gz	4c721222b20b8fd3fbb8c845cd5c0f05cccad68a
tiff	3.8.2	tiff-3.8.2.tar.gz	549e67b6a15b42bfcd72fe17cda7c9a198a393eb
twm	1.0.4	twm-1.0.4.tar.bz2	7456e90f19e4747e1785f596b93f692d68a9f079
util-macros	1.5.0	util-macros-1.5.0.tar.bz2	ae61387bc2a0b97f839041832bd8d06c03efe942
videoproto	2.3.0	videoproto-2.3.0.tar.bz2	4aef2b438d45b3ab75c640996cc1267d3468f18c
x11perf	1.5.1	x11perf-1.5.1.tar.bz2	d1f85da3df5b216b64c1735d109380214787222d
xauth	1.0.4	xauth-1.0.4.tar.bz2	90d32f28bb61ca6d831dcc35429a5ad53be73283
xbacklight	1.1.1	xbacklight-1.1.1.tar.bz2	3541ab5e0956b4f0c97b1200dc32a35d2ccb0f0f
xbitmaps	1.1.0	xbitmaps-1.1.0.tar.bz2	845b825f7e6d193d47db8b67ae8332d87ef8c2b3
xclock	1.0.4	xclock-1.0.4.tar.bz2	1987catb3163c6b68bc7ectbe143c8cd373d64bb
xcmiscproto	1.2.0	xcmiscproto-1.2.0.tar.bz2	1a55e042b33c0e0aaf2299942315a5208d644707
xcmsdb	1.0.2	xcmsdb-1.0.2.tar.bz2	8341f7219a5720da758b0571eb1f4d9072265485
xcursorgen	1.0.3	xcursorgen-1.0.3.tar.bz2	7df26b371476654d191c45e7d20a3a5e0cad87
xcursor-themes	1.0.2	xcursor-themes-1.0.2.tar.bz2	12b865c17c65e70a6bc20300dfa660fe8faaa0a4
xdpyinfo	1.1.0	xdpyinfo-1.1.0.tar.bz2	01971f007048a46a4a31a69c661bc3a37Sde60f0
xdriinfo	1.0.3	xdriinfo-1.0.3.tar.bz2	d211d6f12f4c801d2f4cf184c6daae37aa5858ff
xev	1.0.4	xev-1.0.4.tar.bz2	4f62e131ba96842eef1660e8869533cd3923ac35

Appendix D, Page No. 22 of 22
Certification Test Plan T71379.01

Software Product	Software Version	Filename	SHA256 Hash Value
DS850			
Xextproto	7.1.1	xextproto-7.1.1.tar.bz2	1bb4bd12d65a17b3168de9b4e028b33a2f7b2cad
xf86bigfontproto	1.2.0	xf86bigfontproto-1.2.0.tar.bz2	312a2ca708b257520c1af4393b69d73a393a478f
xf86dgaproto	2.1	xf86dgaproto-2.1.tar.bz2	97a06120e7195c968875e8ba42e82c90ab54948b
xf86driproto	2.1.0	xf86driproto-2.1.0.tar.bz2	0dfe66f6f7c68ea3eb5dceb1e365aaa93be8548
xf86-input-keyboard	1.4.0	xf86-input-keyboard-1.4.0.tar.bz2	5061fdaff8b7ddebcea82f065c4abbfff255a1da
xf86-input-mouse	1.5.0	xf86-input-mouse-1.5.0.tar.bz2	b9213bf745b793a3da2c946ea4d8ee5768e560f1
xf86-video-vesa	2.3.0	xf86-video-vesa-2.3.0.tar.bz2	4689b7c295d7a8d7326302dafecb812739617134
xf86vidmodeproto	2.3	xf86vidmodeproto-2.3.tar.bz2	22d034c2f66985f8541b9ea3421096ceaa006355
xgamma	1.0.3	xgamma-1.0.3.tar.bz2	f9c7d93f1b271bab41ee3c91b371d52572e4e08c
xhost	1.0.3	xhost-1.0.3.tar.bz2	ebcdccdc908e642e527eebbde6ba8084d90c04f6
xineramaproto	1.2	xineramaproto-1.2.tar.bz2	3c397c9ea38aaae785dd79011250891dffa7f3249
xinit	1.2.0	xinit-1.2.0.tar.bz2	85a838c2010f27ef6d09d6ec4b1208a66cc8d697
xinput	1.5.0	xinput-1.5.0.tar.bz2	02d1ccc830007a7848b1b024ac64c310303f973e
xkbcomp	1.1.1	xkbcomp-1.1.1.tar.bz2	aeb733c495d7afd42136bf8ae5c6e792c63f0b4b
xkbevd	1.1.0	xkbevd-1.1.0.tar.bz2	b510b4a1b7486beacb5570c204f7fdd4b61f0ab4
xkbutils	1.0.2	xkbutils-1.0.2.tar.bz2	2c025038ca12ee2494b2401ea2c12c74fe88bf91
xkeyboard-config	1.7	xkeyboard-config-1.7.tar.bz2	d6df43bfc0596be04865f2be7c4e794e198358c8
xkill	1.0.2	xkill-1.0.2.tar.bz2	90708652859dbf71b682c3b9163eb172ce88e4bc
xlsatoms	1.0.2	xlsatoms-1.0.2.tar.bz2	3855734b5ec0d43b5886ac0ffa58d7cf96f46926
xlsclients	1.0.2	xlsclients-1.0.2.tar.bz2	5cde39a28c5352d1d555714836f57c05197e419d
XML-Parser	2.36	XML-Parser-2.36.tar.gz	74aaaa4f939ebf788d8ef5163cbc9802b1b04bfa
xmbroff	0.6.2	xmbroff-0.6.2.tar.gz	4a540b067881c069d389ccc40bd79578cffc7c9b
smodmap	1.0.4	smodmap-1.0.4.tar.bz2	9b49388bb527a8f7b7e86e4ba4c75a83372f6baa
xorg-server	1.7.1	xorg-server-1.7.1.tar.bz2	d31c259b3ab975c2c1baca8f7310b57152ac3c62
xpr	1.0.3	xpr-1.0.3.tar.bz2	9dbd0ff136b612285c00d92d0c7675a4207b1c4a
xprop	1.1.0	xprop-1.1.0.tar.bz2	16b377c76a4a010200063a056c7a5c244ab6ff00
xproto	7.0.16	xproto-7.0.16.tar.bz2	0cda5588d42f2c810d8491da44fc84a4093c12bc
xrandr	1.3.2	xrandr-1.3.2.tar.bz2	0e49b0a0889ae8a590152c6cd0d60a2255a8d940
xrdb	1.0.6	xrdb-1.0.6.tar.bz2	e4faff5e02b3027298dc589e318a6dc7eb50a6d5
xrefresh	1.0.3	xrefresh-1.0.3.tar.bz2	3f34ccca9509f17c60ddfc14498225caffcba705
xset	1.1.0	xset-1.1.0.tar.bz2	ff4295442821826092b17248c1ad65e16cd860ef
xsetroot	1.0.3	xsetroot-1.0.3.tar.bz2	56ed1df9834627a107550475629df51275cd0c44
xterm	254	xterm-254.tgz	934811737745b76ca75bf940feb975943bf1084d
xtrans	1.2.5	xtrans-1.2.5.tar.bz2	e8c4ee58b42d05e613fe535319a7d7f45f30f3e9
xvinfo	1.1.0	xvinfo-1.1.0.tar.bz2	8695bfb597dbf5ed8e3277fddda4722da21baaa3
xwd	1.0.3	xwd-1.0.3.tar.bz2	f6708d14040630d1d3255987c28efcbf7aee05aa
xwininfo	1.0.5	xwininfo-1.0.5.tar.bz2	9730db0d1bd75b8bc5bc399f56cab9f5aee3bcfc
xwud	1.0.2	xwud-1.0.2.tar.bz2	15a6c5e3ffc03b7e8e597947061940fee6c0a9fc
lfs_kernel-2.6.22.19-src.tar			
linux kernel	2.6.22.9	linux-2.6.22.19.tar.bz2	fd0767105a5bac3010562692cd53c8506814e9ff

Appendix E

FL EVS 4.5.0.0 DS200 Test Report

National Technical Systems
Huntsville Facility

wyle
laboratories

Wyle Laboratories, Inc.
7800 Highway 20 West
Huntsville, Alabama 35806
Phone (256) 837-4411 ▪ Fax (256) 721-0144
www.wyle.com

REPORT NO.:	T71013.01-01
WYLE JOB NO.:	T71013.01
CLIENT P.O. NO.:	ES&S-MSA-TA029
CONTRACT:	N/A
TOTAL PAGES (INCLUDING COVER):	125
DATE:	September 18, 2013

TEST REPORT

HARDWARE COMPLIANCE TESTING
OF THE
ELECTION SYSTEMS & SOFTWARE
FL EVS 4.5.0.0 VOTING SYSTEM
DS200 HARDWARE VERSION 1.3

for

Election Systems & Software, LLC
11208 John Galt Boulevard
Omaha, NE 68137

STATE OF ALABAMA
COUNTY OF MADISON

Robert R. Bridges, Director being duly sworn, deposes and says: The information contained in this report is the result of complete and carefully conducted testing, and is to the best of his knowledge true and correct in all respects.

SUBSCRIBED and sworn to before me this 18 day of Sept 20 13

Natalie Vucea
Notary Public in and for the State of Alabama at Large.
My Commission expires: 3/19/16

Wyle shall have no liability for damages of any kind to person or property, including special or consequential damages, resulting from Wyle's providing the services covered by this report.

PREPARED BY: _____ 09/18/2013
Ryan D. Chambers, Project Engineer   Date

APPROVED BY: _____ 9/18/13
Frank Padilla, Voting Systems Manager   Date

WYLE Q.A.: _____ 9/18/13
Raul Toroteo, Q.A. Manager   Date

NVLAP
NVLAP LAB CODE 200773-0

VSTL
VSTL Code 8739

National Technical Systems
Huntsville Facility

Page No. TOC 1 of 2
Test Report No. T71013.01-01

	Revisions	REVISION	Original Release
wyle		REPORT NO.	T71013.01-01
		DATE	September 18, 2013

REV	DATE	PAGE OR PARAGRAPH AFFECTED	DESCRIPTION OF CHANGES
—	9-12-12	Entire Document	Original Release

TABLE OF CONTENTS   Page No.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. TOC 2 of 2
Test Report No. T71013.01-01

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. TOC 3 of 2
Test Report No. T71013.01-01

TABLE OF CONTENTS (continued)

Page No.

ATTACHMENTS

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 1 of 23
Test Report No. T71013.01-01

1.0 INTRODUCTION

1.1 Scope

This report documents the test procedures followed and the results obtained from the Environmental and Electrical Testing performed on the Florida Election Voting System (FL EVS) 4.5.0.0 for Election Systems & Software (ES&S). Upon receipt by Wyle Laboratories, the systems were inspected and subjected to a Physical Configuration Audit (PCA). All testing was performed at Wyle Laboratories' Huntsville, Alabama, Test Facility.

1.2 Objective

The ES&S FL EVS 4.5.0.0 Voting System was tested in reference to the United States Federal Election Commission (FEC) 2002 Voting System Standards (VSS) and all applicable EAC 2005 Voluntary Voting Systems Guidelines (VVSG).

1.3. Test Report Overview

This test report consists of four main sections and attachments:

- 1.0 Introduction – Provides the architecture of the National Certification Test Report (hereafter referred to as Test Report); a brief overview of the testing scope of the Test Report; a list of documentation, customer information, and references applicable to the voting system hardware, software, and this test report.

- 2.0 System Identification and Overview – Provides information about the equipment tested.

- 3.0 Test Background – Contains information about the certification test process and a list of terms and nomenclature pertinent to the Test Report and system tested.

- 4.0 Test Procedures and Results – Provides a summary of the results of the testing process.

- Attachments – Information supporting reviews and testing of the voting system are included as attachments to this report.

1.4 Customer

Election Systems & Software, LLC
11208 John Galt Boulevard
Omaha, NE 68137

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 2 of 23
Test Report No. T71013.01-01

1.0   INTRODUCTION (Continued)

1.5   References

The documents listed were utilized to perform certification testing.

- Election Assistance Commission 2005 Voluntary Voting System Guidelines, Volume I, Version 1.0, "Voting System Performance Guidelines," and Volume II, Version 1.0, "National Certification Testing Guidelines," dated December 2005

- United States Federal Election Commission Voting System Standards Volume I, "Performance Standards" and Volume II, "Test Standards" dated April 2002

- Election Assistance Commission Testing and Certification Program Manual, Version 1.0, effective date January 1, 2007

- Election Assistance Commission Voting System Test Laboratory Program Manual, Version 1.0, effective date July 2008

- Florida Voting System Standards, Form DS-DE 101, 1-12-05

- National Voluntary Laboratory Accreditation Program NIST Handbook 150, 2006 Edition, "NVLAP Procedures and General Requirements (NIST Handbook 150)," dated February 2006

- National Voluntary Laboratory Accreditation Program NIST Handbook 150-22, 2008 Edition, "Voting System Testing (NIST Handbook 150-22)," dated May 2008

- United States 107th Congress Help America Vote Act (HAVA) of 2002 (Public Law 107-252), dated October 2002

- Wyle Laboratories' Test Guidelines Documents: EMI-001A, "Wyle Laboratories' Test Guidelines for Performing Electromagnetic Interference (EMI) Testing," and EMI-002A, "Test Procedure for Testing and Documentation of Radiated and Conducted Emissions Performed on Commercial Products"

- Wyle Laboratories' Quality Assurance Program Manual, Revision 5

- ANSI/NCSL Z540-1, "Calibration Laboratories and Measuring and Test Equipment, General Requirements"

- ISO 10012-1, "Quality Assurance Requirements for Measuring Equipment"

- EAC Requests for Interpretation (listed on www.eac.gov)

- EAC Notices of Clarification (listed on www.eac.gov)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 3 of 23
Test Report No. T71013.01-01

2.0 SYSTEM IDENTIFICATION AND OVERVIEW

2.1 System Overview

The ES&S FL EVS 4.5.0.0 Voting System is a new system that contains a newly configured DS200 hardware version 1.3. The new DS200 tabulator configuration consists of a new mother board, scanner board, redesigned transport path, and a removable battery access panel. Based on the upgrades and modifications to the DS200 a full hardware testing suite was performed at Wyle. For the ES&S FL EVS 4.5.0.0 Voting System, Wyle subjected the DS200 to: non-operating environmental tests, operating environmental tests and Electromagnetic Compatibility (EMC) tests. The ElectionWare EMS was only utilized to generate election media and verify results. Wyle only documented the configuration used during testing conducted at Wyle.

2.2 System Identification

The materials required for testing of the ES&S FL EVS 4.5.0.0 Voting System included software, hardware, test materials, and deliverable materials shipped directly to Wyle by ES&S. The materials documented in the following sections are the materials used during Wyle's testing of only the DS200 and the interface with the EMS.

2.2.1 Hardware

This subsection categorizes the equipment the manufacturer submitted for testing and is listed in Table 2-1. Each test element is included in the list of the equipment required for testing of that element, including system hardware, general purpose data processing and communications equipment, and any required test instrumentation.

Table 2-1 ES&S FL EVS 4.5.0.0 Test Equipment

Equipment	Description	Serial Numbers
DS200 (Hardware Revision 1.3)	Precinct Count Digital Scanner	DS0313350006 (ENV) DS0313350010 (ENV) DS0313350009 (EMI)
Ballot Box	Plastic Ballot Box/Plastic Transport Case	T71013-BB-002
Ballot Box	Hard Vinyl Transport Case	T71013-BB-003
Ballot Box	Metal Box with Electromechanical Diverter	T71013-BB-001
Dell Latitude Laptop	CPU: Intel Core i5-2540M 2.60Ghz; RAM: 4.00 GB HDD: 250 GB – ST250LT007-9ZV14C OS: Windows 7 Professional SP1 – 64 bit	39CMJS1
Transport Media/ Memory Device/ USB Flash Drive	Approved Manufacturer List: Kingston SanDisk Delkin Approved Capacity List: 512 MB 1 GB 2 GB 4 GB 8GB	Wyle-assigned TM-XXX*
Compact Flash Card/ CF Card	Approved Manufacturer List: Delkin Approved Capacity List: 1 GB	Wyle-assigned CF-XXX*

*Wyle uniquely labels each media device with the information (election, results, test utilized for) loaded on the device.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 4 of 23
Test Report No. T71013.01-01

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.2   System Identification (Continued)

2.2.2   Software

The software evaluated was limited to ElectionWare, Election Reporting Manager (ERM), and the firmware build for the DS200. Only the changes incorporated since the EVS 5.0.0.0 test campaign were evaluated by Wyle. Wyle utilized an EMS setup with new versions of ElectionWare and ERM to load election information onto transport media. Wyle did not test the EMS for any other functionality.

Table 2-2 Software Required for Testing

Software Identification	Version
DS200 Firmware	2.11.0.01
DS200 Scanner Board Firmware	3.0.0.0b
DS200 Power Management Board	1.2.10.0a

2.3   Test Support Materials

This subsection enumerates any and all test materials needed to perform voting system testing. The scope of testing determines the quantity of a specific material required.

The following test materials were required to support the ES&S FL EVS 4.5.0.0 test campaign:

Table 2-3 Test Support Equipment

Test Material	Quantity
Paper Rolls	25 rolls total
Pre Printed Ballots	1,200 total (14" size)

2.4   Vendor Technical Data Package

The Technical Data Package (TDP) contains information about requirements, design, configuration management, quality assurance, and system operations. A scaled version of the TDP was submitted for this campaign due to only Hardware Testing being performed. The table below provides the TDP documents submitted and reviewed for the ES&S FL EVS 4.5.0.0 campaign.

Table 2-5 ES&S FL EVS 4.5.0.0 Voting System TDP

ES&S FL EVS 4.5.0.0 TDP Documents	Version	Doc No.	Document Code
System Hardware Specification			
System Hardware Specification – DS200	1.0	03-01	DS200HW_M_SPC_0313_HWSpec
System Test/Verification Specification			
System Operations Procedures – DS200	1.0	07-06	FLEVS4500_SOP_DS200
System Maintenance Manuals			
System Maintenance Manual – DS200	1.0	08-01	FLEVS4500_SMM_DS200

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 5 of 23
Test Report No. T71013.01-01

3.0 TEST BACKGROUND

Wyle Laboratories is an independent testing laboratory for systems and components under harsh environments, including dynamic and climatic extremes as well as the testing of electronic voting systems. Wyle holds the following accreditations:

- ISO-9001:2000
- NVLAP Accredited ISO 17025:2005
- EAC Accredited VSTL, NIST 150,150-22
- A2LA Accredited (Certification No.'s 845.01, 845.02, and 845.03)
- FCC Approved Contractor Test Site (Part 15, 18, 68)

3.1 General Information about the Test Process

All testing performed as part of the test effort was performed at the Wyle Labs Huntsville, AL facility. Conformance testing was limited to the ES&S FL EVS 4.5.0.0 Voting System component previously identified in this report.

All hardware used during testing for this test campaign was configured "As Used" for voting. Each tabulator was placed on a ballot box and loaded with the proper firmware. The ES&S FL EVS 4.5.0.0 EMS suite was loaded on a COTS PC. All media used during testing was loaded from this EMS PC. All hardware used to build the DS200 firmware was configured by Wyle.

3.2 Wyle Quality Assurance

All work performed on this program was in accordance with Wyle Laboratories' Quality Assurance Program and Wyle Laboratories' Quality Program Manual, which conforms to the applicable portions of International Standard Organization (ISO) Guide 17025.

The Wyle Laboratories, Huntsville Facility, Quality Management System is registered in compliance with the ISO-9001 International Quality Standard. Registration has been completed by Quality Management Institute (QMI), a Division of Canadian Standards Association (CSA).

3.3 Test Equipment and Instrumentation

All instrumentation, measuring, and test equipment used in the performance of this test program was calibrated in accordance with Wyle Laboratories' Quality Assurance Program, which complies with the requirements of ANSI/NCSL 2540-1, ISO 10012-1, and ISO/IEC 17025. Standards used in performing all calibrations are traceable to the National Institute of Standards and Technology (NIST) by report number and date. When no national standards exist, the standards are traceable to international standards, or the basis for calibration is otherwise documented.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 6 of 23
Test Report No. T71013.01-01

3.0   **TEST BACKGROUND (Continued)**

3.4   **Terms and Abbreviations**

Table 3-1 in this subsection defines all terms and abbreviations applicable to this Test Report.

Table 3-1 Terms and Abbreviations

Term	Abbreviation	Definition
Americans with Disabilities Act of 1990	ADA	ADA is a wide ranging civil rights law that prohibits, under certain circumstances, discrimination based on disability
Configuration Management	CM	---
Commercial Off the Shelf	COTS	Commercial, readily available hardware or software
Direct Record Electronic	DRE	---
United States Election Assistance Commission	EAC	Commission created per the Help America Vote Act of 2002, assigned the responsibility for setting voting system standards and providing for the voluntary testing and certification of voting systems.
Election Management System	EMS	
Equipment Under Test	EUT	---
Help America Vote Act	HAVA	Act created by United States Congress in 2002
National Institute of Standards and Technology	NIST	Government organization created to promote U.S. innovation and industrial competitiveness by advancing measurement science, standards, and technology in ways that enhances economic security and improves our quality of life.
Physical Configuration Audit	PCA	Review by accredited test laboratory to compare voting system components submitted for certification testing to the manufacturer's technical documentation and confirmation the documentation meets national certification requirements. A witnessed build of the executable system is performed to ensure the certified release is built from tested components.
Quality Assurance	QA	---
Technical Data Package	TDP	Manufacturer documentation related to the voting system required to be submitted as a precondition of certification testing
Voting System Standards	VSS	Published by the FEC, second iteration of national level voting system standards
Voluntary Voting System Guidelines	2005 VVSG	Published by the EAC, the third iteration of national level voting system standards
Wyle Operating Procedure	WOP	Wyle Test Method or Test Procedure

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 7 of 23
Test Report No. T71013.01-01

4.0   TEST FINDINGS AND RECOMMENDATIONS

The ES&S FL EVS 4.5.0.0 Voting System component, as listed in Section 2.0, were subjected to the tests described in Section 3.2 of this report. The results of those tests are summarized in the sections below. All hard copy data generated by the performance of these tests is retained by Wyle as raw data.

4.1   System Level Baseline

A System Level Baseline was performed to evaluate the system being submitted for testing in comparison to the system TDP. A Physical Configuration Audit was performed on the ES&S FL EVS 4.5.0.0 submitted for Hardware Testing.

4.1.1   Physical Configuration Audit

A focused Physical Configuration Audit (PCA) of the ES&S FL EVS 4.5.0.0 Voting System was performed in accordance with Section 6.6 of Volume II of the VVSG. The PCA compares the voting system components submitted for certification with the vendor's technical documentation and confirms that the documentation submitted meets the requirements of the Guidelines. The purpose of the PCA is to: establish a configuration baseline (both hardware and software) of the system to be tested; verify that the reviewed source code conforms to the vendor's specification; and assess the adequacy of user acceptance test procedures and data.

The PCA performed on the ES&S FL EVS 4.5.0.0 Voting System consisted of inspecting the DS200 scanner, firmware/software, and the TDP used in the ES&S FL EVS 4.5.0.0 Voting System.

Summary Findings: A focused PCA was performed to baseline the system's hardware and software components prior to commencement of the test campaign. No discrepancies were noted during the PCA.

4.2   Technical Data Package Review

The ES&S FL EVS 4.5.0.0 Voting System Technical Data Package (TDP) was not reviewed to the 2005 VVSG. The supplied TDP documents were only utilized as reference material for EUT configuration and test set-up.

Summary Findings: TDP was not performed.

4.3   Hardware Testing

Hardware testing included: the inspection and evaluation of voting system documentation; tests of voting system under conditions simulating the intended storage, operation, and transportation; and operational tests verifying system performance and function under normal and abnormal conditions. Hardware testing was limited to the ES&S FL EVS 4.5.0.0 Voting System. Hardware Testing Data can be located in Attachments A - G of this document for additional information

The DS200 was subjected to hardware tests as summarized in Table 4-1.

Table 4-1 Test Program Requirements

REPORT SECTION	VVSG VOL. I SECTION	VVSG VOL. II SECTION	TEST DESCRIPTION
4.5.1	N/A	4.6.4	Low Temperature Test
4.5.1	N/A	4.6.5	High Temperature Test
4.5.1	N/A	4.6.3	Vibration Test

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 8 of 23
Test Report No. T71013.01-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.3 Hardware Testing (Continued)

Table 4-1 Test Program Requirements (Continued)

REPORT SECTION	VVSG VOL. I SECTION	VVSG VOL. II SECTION	TEST DESCRIPTION
4.5.1	N/A	4.6.2	Bench Handling Test
4.5.1	N/A	4.6.6	Humidity Test
4.5.2	N/A	4.7.1	Temperature/Power Variation Test
4.6.1	4.1.2.5	4.8A	Electrical Power Disturbance Test
4.6.2	4.1.2.9	4.8B	Electromagnetic Radiation Test
4.6.3	4.1.2.8	4.8C	Electrostatic Disruption Test
4.6.4	4.1.2.10	4.8D	Electromagnetic Susceptibility Test
4.6.5	4.1.2.6 (a)	4.8E	Electrical Fast Transient Test
4.6.6	4.1.2.7 (a) (b)	4.8F	Lightning Surge Test
4.6.7	4.1.2.11 (a)	4.8G	Conducted RF Immunity Test
4.6.8	4.1.2.12	4.8H	Magnetic Fields Immunity Test
4.6.9	4.3.8	N/A	Product Safety Review, UL60950-1

4.4 Environmental Tests

Environmental tests were performed to ensure that the EUT and associated machine resident firmware were in compliance with the VVSG.

During test performance, the EUT was configured as it would be for use in an election precinct.

4.4.1 Non-Operating Environmental Tests

The EUT was subjected to various Non-Operating Environmental Tests. Prior to and immediately following each test environment, the EUT was powered on and subjected to operability functional checks to verify continued proper operation. The EUT was not powered on during the performance of any of the non-operating tests.

Low Temperature Test

The EUT was subjected to a Low Temperature Test in accordance with section 4.6.4 of Volume II of the VVSG. The purpose of this test is to simulate stresses associated with the storage of voting machines and ballot counters. This test is equivalent to the procedure of MIL-STD-810D, Method 502.2, Procedure I-Storage, with a minimum temperature of -4°F.

Prior to test initiation, the EUT was subjected to a baseline operability checkout to verify system readiness. The EUT was then placed in an environmental test chamber and the chamber temperature was lowered to -4°F and allowed to stabilize. Upon temperature stabilization, the temperature was maintained for an additional four hours. The temperature was then returned to standard laboratory ambient conditions at a rate not exceeding 10°F per minute.

During the Low Temperature Test there was one anomaly encountered (reference Notice of Anomaly No. 7 in Attachment A for further reference). This anomaly required testing to be repeated.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 9 of 23
Test Report No. T71013.01-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4.1   Non-Operating Environmental Tests (Continued)

Upon completion of the second attempt the EUT was removed from the chamber and inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was successfully subjected to a post test operability checkout.

The EUT successfully completed the requirements of the Low Temperature Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, C, and G of this report.

High Temperature Test

The EUT was subjected to a High Temperature Test in accordance with section 4.6.3 of Volume II of the VVSG. The purpose of this test is to simulate stresses associated with the storage of voting machines and ballot counters. This test is equivalent to the procedure of MIL-STD-810D, Method 501.2, Procedure I-Storage, with a maximum temperature of 140°F.

Prior to test initiation, the EUT was subjected to a baseline operability checkout to verify system readiness. The EUT was then placed in an environmental test chamber and the chamber temperature was raised to 140°F and allowed to stabilize. Upon temperature stabilization, the temperature was maintained for an additional four hours. The temperature was then returned to standard laboratory ambient conditions at a rate not exceeding 10°F per minute.

The EUT was removed from the chamber and inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was successfully subjected to a post-test operability checkout.

The EUT successfully completed the requirements of the High Temperature Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, C, and G of this report.

Vibration Test

The EUT was subjected to a Vibration Test in accordance with section 4.6.3 of Volume II of the VVSG. The purpose of this test is to simulate stresses faced during transport of voting machines and ballot counters between storage locations and polling places. This test is equivalent to the procedure of MIL-STD-810D, Method 514.3, Category 1- Basic Transportation, Common Carrier.

Prior to test initiation, the EUT was subjected to a baseline operability checkout to verify system readiness. Upon completion, the EUT was secured to an electro dynamics shaker. One control accelerometer was affixed to the shaker table. The EUT was subjected to the Basic Transportation, Common Carrier profile as depicted in Mil-Std-810D, Method 514.3, Category I, with a frequency range from 10 to 500 Hz and an overall rms level of 1.04, 0.74, and 0.20 G for durations of 30 minutes in each orthogonal axis.

The DS200 successfully completed the requirements of the Vibration Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, C, and G of this report.

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 10 of 23
Test Report No. T71013.01-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4   Environmental Tests (Continued)

4.4.1   Non-Operating Environmental Tests (Continued)

Bench Handling Test

The EUT was subjected to a Bench Handling Test in accordance with section 4.6.2 of Volume II of the VVSG. The purpose of this test is to simulate stresses faced during maintenance and repair of voting machines and ballot counters. This test is equivalent to the procedure of MIL-STD-810D, Method 516.3, Procedure VI.

Prior to performance of the test, the EUT was subjected to a baseline operability checkout. Following the checkout, each edge of the base of the machine was raised to a height of four inches above the surface and allowed to drop freely. This was performed six times per edge, for a total of 24 drops.

Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

The EUT successfully completed the requirements of the Bench Handling Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, C, and G of this report.

Humidity Test

The EUT was subjected to a Humidity Test in accordance with section 4.6.6 of Volume II of the VVSG. The purpose of the test was to simulate stresses encountered during storage of voting machines and ballot counters. This test is similar to the procedure of MIL-STD-810D, Method 507.2, Procedure I-Natural Hot-Humid.

The EUT was subjected to a baseline operability checkout to verify system readiness. Upon completion, the EUT was placed in an environmental test chamber and was subjected to a 10-day humidity cycle in accordance with the 24-hour cycle values as shown in Table 4-2.

Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. The DS200 successfully completed the requirements of the Humidity Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, C, and G of this report.

Table 4-2 Humidity Test Cycle Values

Time	Hot-Humid (Cycle 1)			Time	Hot-Humid (Cycle 1)		
	Temperature		RH		Temperature		RH
	°F	°C	%		°F	°C	%
0000	88	31	88	1200	104	40	62
0100	88	31	88	1300	105	41	59
0200	88	31	88	1400	105	41	59
0300	88	31	88	1500	105	41	59
0400	88	31	88	1600	105	41	59
0500	88	31	88	1700	102	39	65
0600	90	32	85	1800	99	37	69
0700	93	34	80	1900	97	36	73
0800	96	36	76	2000	94	34	76
0900	98	37	73	2100	97	33	85
1000	100	38	69	2200	90	32	85
1100	102	39	65	2300	89	32	88

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 11 of 23
Test Report No. T71013.01-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4   Environmental Tests

4.4.2   Operating Environmental Tests

Temperature/Power Variation Test

The DS200 was subjected to a Temperature and Power Variation Test in accordance with section 4.7.1 of Volume II of the VVSG. The purpose of this test was to evaluate system operation under various environmental conditions. The cumulative duration of at least 163 hours was achieved by utilizing three units for a period of 64 hours based on the (EAC RFI 2008-01), with 48 hours in the environmental test chamber. For the remaining hours, the equipment was operated at room temperature. This test is similar to the low temperature and high temperature tests of MIL-STD-810-D, Method 502.2 and Method 501.2.

To perform the test, the EUTs were placed inside an environmental walk-in test chamber and connected to a variable voltage power source. The temperature inside the chamber and the voltage supplied to the hardware varied from 50°F to 95°F and from 105 VAC to 129 VAC (as depicted in Figures 4-1 through 4-4). During test performance, the operational functions were continuously exercised by the scanning of ballots. A minimum of 100 ballots per hour were scanned.
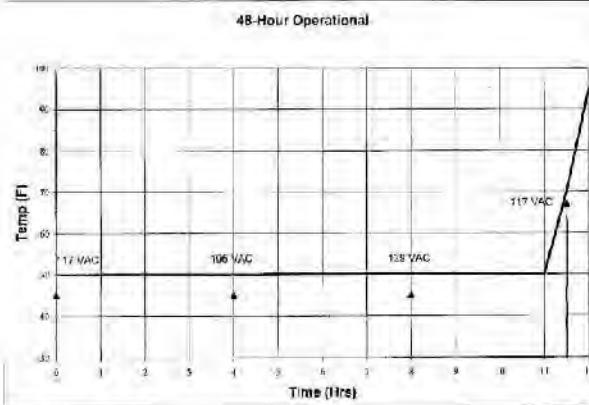

Figure 4-1 Temperature/Power Variation Profile Hours 0-12

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 12 of 23
Test Report No. T71013.01-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4.2   Operating Environmental Tests (Continued)
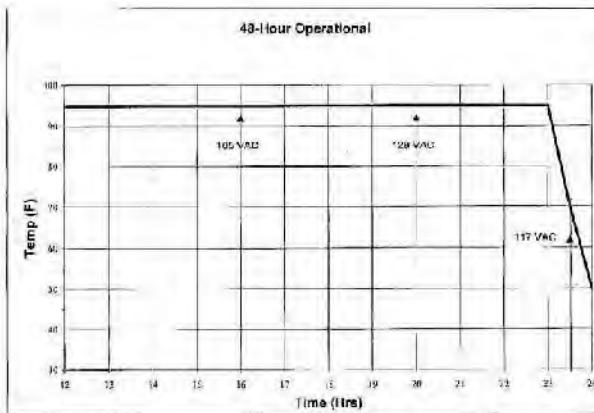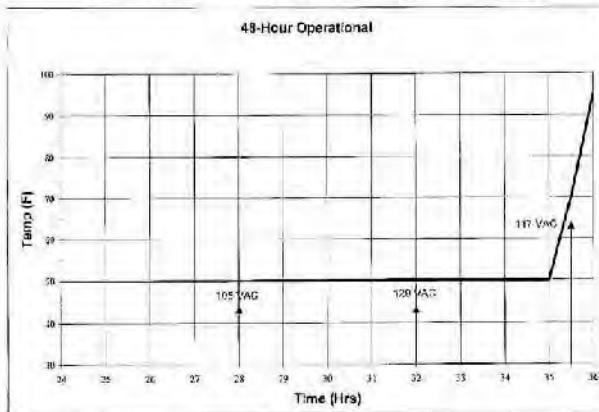
Figure 4-2 Temperature/Power Variation Profile Hours 12-24

Figure 4-3 Temperature/Power Variation Profile Hours 24-36

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 13 of 23
Test Report No. T71013.01-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4.2   Operating Environmental Tests (Continued)
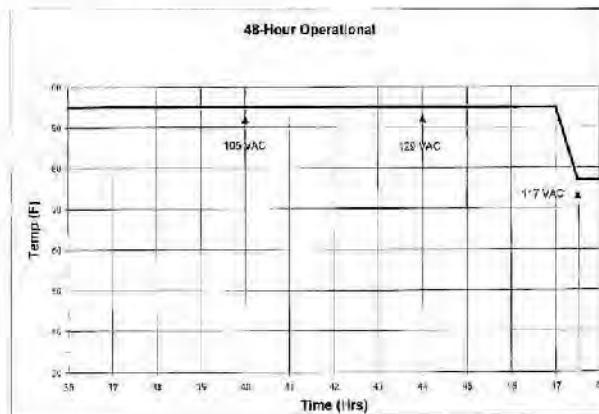
Figure 4-4 Temperature/Power Variation Profile Hours 36-48

Summary Findings

The DS200 successfully completed the requirements of the Temperature/Power Variation Test on the first attempt without issue.

4.5   **Electrical Tests**

Electrical tests were performed to ensure that the EUT and associated machine resident firmware were in compliance with the VVSG.

During test performance, the EUT was configured as it would be for use in an election precinct.

The EUT was subjected to various electrical tests to ensure continued system operation and reliability in the presence of abnormal electrical events. The EUT was powered and actively counting ballots during all electrical tests. Prior to and immediately following each electrical test, an operational status check was performed. The Test Data Sheets, Photographs, and Instrumentation Equipment Sheets are contained in Attachments B, D, and G of this report.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 14 of 23
Test Report No. T71013.01-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5.1 Electrical Power Disturbance

Electrical Power Disturbance testing was performed in accordance with sections 4.1.2.5 of Volume I and 4.8 of Volume II of the VVSG. This testing was performed to ensure that the EUT was able to withstand electrical power line disturbances (dips/surges) without disruption of normal operation or loss of data.

The EUT was configured to run in an automated ballot count test mode, where continual ballot processing would occur during the testing, and subjected to the voltage dips and surges over periods ranging from 20ms to four hours.

The EUT successfully met the requirements of the Electrical Power Disturbance Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.2 Electromagnetic Radiation Test (FCC Part 15 Emissions)

Electromagnetic Radiation emissions measurements were performed in accordance with sections 4.1.2.9 of Volume I and 4.8 of Volume II of the VVSG. This testing was performed to ensure that emissions emanating from the unit do not exceed the limits of 47 CFR Part 15, Subpart B, Class B Limits.

The EUT was configured to run in an automated ballot count test mode, where continual ballot processing would occur during the testing. The DS200 was subjected to the test requirements detailed in Table 4-3.

Table 4-3 Conducted and Radiated Emissions Requirements

Conducted Emissions			Radiated Emissions	
Frequency Range (MHz)	Limits (dBµV)		Frequency Range (MHz)	3 Meter Test Limit (dBµV)
	Quasi-peak	Average		
0.15 to 0.50	66 to 56	56 to 46	30 to 88	40.0
0.50 to 5.0	56	46	88 to 216	43.5
5.0 to 30.0	60	50	216 to 960	46.0
			960 to 1000	54.0

Testing was performed at the Wyle Laboratories' Open Air Test Site 2 (OATS-2) located on the Intergraph Complex in Huntsville, AL. The OATS-2 is fully described in reports provided to the Federal Communication Commission (FCC) (FCC Reference 98597). The site was tested and complies with the requirements of ANSI C63.4-2003.

To perform the Conducted Emissions portion of the test, the DS200 was set up as depicted in Figure 4-5.

[The remainder of this page intentionally left blank]

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 15 of 23
Test Report No. T71013.01-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5.2 Electromagnetic Radiation Test (FCC Part 15 Emissions) (Continued)
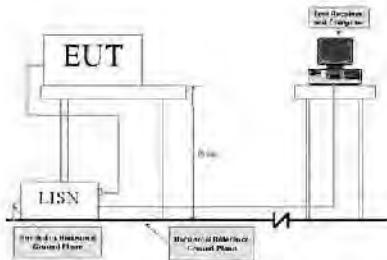
Figure 4-5 Conducted Emissions Test Setup

The DS200 was then subjected to the following test procedure:

1. The DS200 was placed on a non-metallic table 0.8 meters above the turntable and reference ground plane at the Open-Area Test Site.

2. The DS200 AC/DC Power Adapter was connected to the power mains through a Line Impedance Stabilization Network (L.I.S.N.). Other support units were connected to the power mains through another L.I.S.N. The L.I.S.Ns provided 50 ohm/50 μH of coupling impedance for the measuring instrument.

3. The DS200 was placed in an active state and monitored for functionality throughout testing.

4. Both Line and Neutral of the power mains connected to the DS200 were checked for maximum conducted interference.

5. The frequency range from 150 kHz to 30 MHz was evaluated and recorded. Emissions levels below – 20 dB were not recorded.

To perform the Radiated Emissions portion of the test, the DS200 was set up as depicted in Figure 4-6.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 16 of 23
Test Report No. T71013.01-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5.2 Electromagnetic Radiation Test (FCC Part 15 Emissions) (Continued)
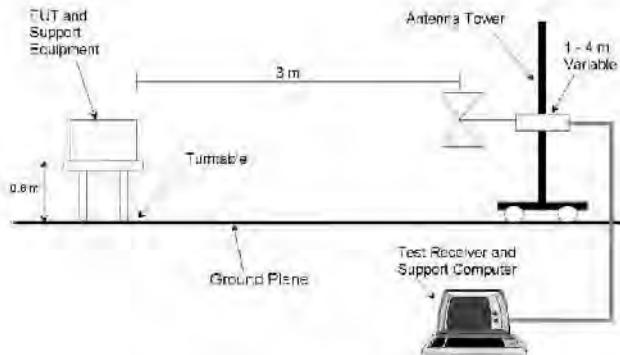

Figure 4-6 Radiated Emissions Test Setup

The DS200 was then subjected to the following test procedure:

1. The DS200 was placed on a non-metallic turn-table 0.8 meters above the reference ground plane at the Open-Area Test Site.

2. The DS200 was placed 3 meters away from the interference-receiving antenna, which was mounted on a variable-height antenna tower. The interference-receiving antenna used was a broadband antenna.

3. For each suspected emissions point, the DS200 was arranged in a worst case configuration. The table was rotated from 0 to 360 degrees and the antenna height was varied from one (1) to four (4) meters to identify the maximum reading.

4. All emissions points identified within 20 dB of the specified limit were tested individually using the quasi-peak method as specified and then reported in the tabular data.

The EUT was found to comply with the required emissions limits. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 17 of 23
Test Report No. T71013.01-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5 Electrical Tests (Continued)

4.5.3 Electrostatic Disruption

Electrostatic Disruption testing was performed in accordance with sections 4.1.2.8 of Volume I and 4.8 of Volume II of the VVSG to ensure that should an electrostatic discharge event occur during equipment setup and/or ballot counting, that the EUT would continue to operate normally. A momentary interruption is allowed so long as normal operation is resumed without human intervention or loss of data.

The EUT was configured to run in an automated ballot count test mode, where continual ballot processing would occur during the testing without operator intervention. The EUT was then subjected to electrostatic discharges of +/- 8 kV contact and +/- 15 kV air as shown in Table 4-4. Discharges were performed at areas typical of those which might be touched during normal operation, including the touch screen, user buttons, and other likely points of contact. The DS200 was then setup per the following conditions:

1.   Power lines and power line returns were configured as required by the system configuration.

2.   The EUT was raised approximately 10 cm from the ground using isolated stand-offs.

3.   Signal/control test cables were positioned approximately 5 cm (2 in.) above the ground.

Table 4-4 Electrostatic Discharge Transients

Characteristic	Requirements		Value
	Capacitance	Resistance	
Pulse Wave Shape (RC Network)	150	330	pf / Ω
Test Levels	Discharge Types		Value
	Air Gap	Direct Contact	
	±15	±8	KV
Rise Time	<1		nanosecond
Pulse Decay Time	≈30 at 50% height		nanosecond
Pulse Repetition	≥1		per second
Total Injected Pulse at each Test Point	10		per polarity (±)
Temperature	≥15 to ≤35		°C
Relative Humidity	≥20 to ≤60		%

During the ESD Test there was one anomaly encountered (reference Notice of Anomaly No. 8 in Attachment A for further reference).

During the second attempt the EUT successfully met the requirements of the ESD Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 18 of 23
Test Report No. T71013.01-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5 Electrical Tests (Continued)

4.5.4 Electromagnetic Susceptibility

Electromagnetic Susceptibility testing was performed in accordance with sections 4.1.2.10 of Volume I and 4.8 of Volume II of the 2005 VVSG. This testing was performed to ensure that the EUT was able to withstand a moderate level of ambient electromagnetic fields without disruption of normal operation or loss of data.

The EUT was configured to run in an automated ballot count test mode, where continual ballot processing would occur during the testing without operator intervention. The DS200 was then subjected to ambient electromagnetic fields at 10 V/m over a range of 80 MHz to 1000 MHz, as shown in Figure 4-7. Testing was conducted utilizing both horizontally and vertically polarized waves. The limits were measured with a maximum scan rate of 1% of the fundamental frequency and the dwell duration was three seconds.
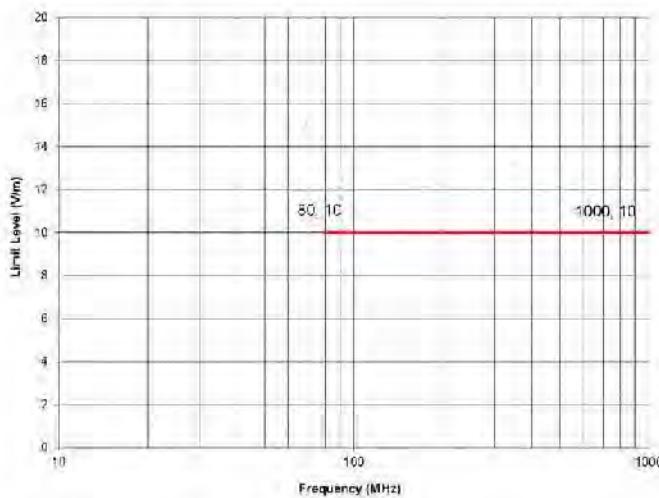

Figure 4-7 Radiated Susceptibility Limit

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 19 of 23
Test Report No. T71013.01-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5 Electrical Tests (Continued)

4.5.4 Electromagnetic Susceptibility

During the Susceptibility Test there were three anomalies encountered (reference Notice of Anomaly Nos. 4, 5 and 6 in Attachment A). During the fourth attempt there was no loss of normal operation or loss of data as a result of the applied electromagnetic fields.

On the fourth attempt the EUT successfully met the requirements of the Electromagnetic Susceptibility Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.5 Electrical Fast Transients

Electrical Fast Transients (EFT) testing was performed in accordance with sections 4.1.2.6 (a) of Volume I and 4.8 of Volume II of the 2005 VVSG to ensure that, should an electrical fast transient event occur on a power line, the EUT would continue to operate without disruption of normal operation or loss of data. Section 4.1.2.6 (b) of Volume I is not applicable because there are no I/O lines greater than three meters.

The EUT was configured to run in an automated ballot count test mode, where continual ballot processing would occur during the testing without operator intervention. The EUT was then subjected to electrostatic fast transients of 2 kV applied to its AC power lines. The pulse characteristics are listed in Table 4-5.

Table 4-5 EFT Pulse Characteristics

Pulse Description	Requirements	Units
Pulse Amplitude	+-2.0	kV peak to peak
Pulse Rise Time	5 ±30%	nanoseconds
Pulse Width	50 ±30%	nanoseconds
Pulse Repetition Rate	100	kHz
Pulse Shape	Double exponential	N/A
Burst Duration	15	milliseconds
Burst Period	300	milliseconds
Test Duration	60	seconds

There was no loss of normal operation or loss of data as a result of the applied transients. The EUT successfully met the requirements of the Electrical Fast Transients Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.6 Lightning Surge

Lightning Surge testing was performed in accordance with sections 4.1.2.7 (a), (b) of Volume I and 4.8 of Volume II of the 2005 VVSG to ensure that, should a surge event occur on a power line due to a lightning strike, the EUT will continue to operate without disruption of normal operation or loss of data. Sections 4.1.2.7 (c), (d), and (e) are not applicable because there are no DC lines greater than 10 meters and no I/O lines greater than 30 meters.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 20 of 23
Test Report No. T71013.01-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5 Electrical Tests (Continued)

4.5.6 Lightning Surge (Continued)

The EUT was configured to run in an automated ballot count test mode, where continual ballot processing would occur during the testing. The EUT power input lines were then subjected to lightning surge testing at a level of 2 kV applied to its AC power line per the surge characteristics listed in Table 4-6.

Table 4-6 Surge Characteristics

Test I.D.	Cable Type	Number of Interfacing Cables	Description	Injection Signals Summary Characteristics
Surge	Line (L) to Neutral (N)	1	120 VAC Power Lines	Injection at Power Input Sinewave: 0°, 90°, and 270° Combination Wave Test Levels: +2.0 kV and Ring Wave Test Level = +2.0 kV
	Line (L) to Ground (G)	1		
	Neutral (N) to Ground (G)	1		
	Line (L) & Neutral (N) to Ground (G)	1		

During the Lightning Surge Test there were two anomalies encountered (reference Notice of Anomaly Nos. 1 and 2 in Attachment A).

During the third attempt the EUT successfully met the requirements of the Lightning Surge Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.7 Conducted RF Immunity

Conducted RF Immunity testing was performed in accordance with sections 4.1.2.11 (a) of Volume I and 4.8 of Volume II of the 2005 VVSG. Section 4.1.2.11 (b) of Volume I is not applicable because there are no signal/control lines greater than three meters. This testing was performed to ensure that the EUT was able to withstand conducted RF energy onto its power lines without disruption of normal operation or loss of data.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 21 of 23
Test Report No. T71013.01-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   Electrical Tests (Continued)

4.5.7   Conducted RF Immunity

The EUT was configured to run in an automated ballot count test mode, where continual ballot processing would occur during the testing without operator intervention. The EUT was then subjected to conducted RF energy of 10 V rms applied to its power lines over a frequency range of 150 kHz to 80 MHz.

There was no loss of normal operation or loss of data as a result of the applied conducted RF energy. The EUT successfully met the requirements of the Conducted RF Immunity Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.8   Magnetic Fields Immunity

Magnetic Fields Immunity testing was performed in accordance with sections 4.1.2.12 of Volume I and 4.8 of Volume II of the 2005 VVSG. This testing was performed to ensure that the EUT was able to withstand AC magnetic fields without disruption of normal operation or loss of data.

The EUT was configured to run in an automated ballot count test mode, where continual ballot processing would occur during the testing. The EUT was then subjected to AC magnetic fields of 30 A/m at a 60 Hz power line frequency.

There was no loss of normal operation or loss of data as a result of the applied magnetic field.

The EUT successfully met the requirements of the Magnetic Fields Immunity Test. The Test Data Sheet, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.9   Product Safety Review

The VVSG states that all voting systems shall meet the following requirements for safety:

All voting systems and their components shall be designed to eliminate hazards to personnel or to the equipment itself.

Defects in design and construction that can result in personal injury or equipment damage must be detected and corrected before voting systems and components are placed into service.

Equipment design for personnel safety shall be equal to or better than the appropriate requirements of the Occupational Safety and Health Act, Code of Federal Regulations, Title 29, Part 1910.

To satisfy these requirements, the voting system was subjected to a Product Safety Review in accordance with UL 60950-1, "Safety of Information Technology Equipment".

Attachment F of this report contains the Product Safety Certificate of Conformance.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 22 of 23
Test Report No. T71013.01-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.6 Anomalies and Resolutions

Eight Notices of Anomalies were issued during the test campaign. A Notice of Anomaly (NOA) is generated upon occurrence of a verified failure, an unexpected test result, or any significant unsatisfactory condition. The Notices of Anomaly generated during testing are presented in their entirety in ATTACHMENT A and are summarized below.

Notice of Anomaly No. 1: Lightning Surge Test

After being subjected to the Lightning Surge Test, the AC Power Adapter ceased to function. As a result, the FL EVS 4500 system did not successfully pass the Lighting Surge Test.

Resolution to Notice of Anomaly No. 1
ES&S acknowledged the nonconformance observation and resubmitted a replacement AC Power Adapter for testing as part of the DS200.

Notice of Anomaly No. 2: Lightning Surge Test

After being subjected to the Lightning Surge Test, the AC Power Adapter ceased to function. As a result, the FL EVS 4500 system did not successfully pass the Lighting Surge Test.

Resolution to Notice of Anomaly No. 2
ES&S modified the FL EVS 4500 system to include an in-line COTS surge suppressor and resubmitted a replacement AC Power Adapter for testing as part of the DS200.

Notice of Anomaly No. 4: Electromagnetic Susceptibility Test

After being subjected to the Electromagnetic Susceptibility Test, the DS200 suffered disruption of normal operation. As a result, the FL EVS 4500 system did not successfully pass the Electromagnetic Susceptibility Test.

Resolution to Notice of Anomaly No. 4
ES&S acknowledged the nonconformance observation and provided a root cause analysis.

Notice of Anomaly No. 5: Electromagnetic Susceptibility Review

After being subjected to the Electromagnetic Susceptibility Test, the DS200 suffered disruption of normal operation. As a result, the FL EVS 4500 system did not successfully pass the Electromagnetic Susceptibility Test.

Resolution to Notice of Anomaly No. 5
ES&S acknowledged the nonconformance observation and provided a root cause analysis.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 23 of 23
Test Report No. T71013.01-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.6   Anomalies and Resolutions (Continued)

<u>Notice of Anomaly No. 6: Electromagnetic Susceptibility Review</u>

After being subjected to the Electromagnetic Susceptibility Test, the DS200 suffered disruption of normal operation. As a result, the FL EVS 4500 system did not successfully pass the Electromagnetic Susceptibility Test.

> <u>Resolution to Notice of Anomaly No. 6</u>
> ES&S acknowledged the nonconformance observation and provided a root cause analysis.

<u>Notice of Anomaly No. 7: Low Temperature Test</u>

After being subjected to the Low Temperature Test, the DS200 was damaged due to human error during testing. As a result, the FL EVS 4500 system did not successfully pass the Low Temperature Test.

> <u>Resolution to Notice of Anomaly No. 7</u>
> Wyle counseled and retrained all technicians on the associated Wyle Operating Procedure and performed the test correctly, at which time the DS200 successfully completed the Low Temperature Test.

<u>Notice of Anomaly No. 8: Electrostatic Disruption Test (ESD)</u>

After being subjected to the Electrostatic Disruption, the DS200 ceased to function and required human intervention in the form of a power cycle, during testing. As a result, the FL EVS 4500 system did not successfully pass the Electrostatic Disruption.

> <u>Resolution to Notice of Anomaly No. 8</u>
> ES&S acknowledged the nonconformance observation; Wyle performed the Electrostatic Disruption Test a second time and the EUT successfully passed.

4.7   Test Summary and Conclusion

Wyle performed conformance testing on all modifications submitted for the ES&S FL EVS 4.5.0.0 Voting System. Wyle only tested the DS200 for the modifications. Modifications of the DS200 met all applicable requirements in the EAC 2005 VVSG.

This report is valid only for the system identified in Section 2 of this report. Any changes, revisions, or corrections made to the system after this evaluation shall be submitted to Wyle to determine the scope of testing for the modified system. The scope of testing required will be determined based upon the degree of modification.

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 29 of 126
Certification Test Plan T71379.01

Page No. A-1 of 10
Test Report No. T71013.01-01

ATTACHMENT A

NOTICES OF ANOMALY

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. A-2 of 10
Test Report No. T71013.01-01

wyle
Laboratories

ORIGINAL | **NOTICE OF ANOMALY** | DATE: 07/11/2013

NOTICE NO: 1	P.O. NUMBER: ES&S-MSA-TA029	CONTRACT NO: N/A
CUSTOMER: ES&S		WYLE JOB NO: T71013.01
NOTIFICATION MADE TO: Paul Huffman		NOTIFICATION DATE: 07/11/2013
NOTIFICATION MADE BY: Ryan Chambers		VIA: In person

CATEGORY: [X] SPECIMEN [ ] PROCEDURE [ ] TEST EQUIPMENT | **DATE OF ANOMALY:** 07/11/2013

PART NAME: DS200   PART NO. DS200

TEST: Lightning Surge Test (LST)   I.D. NO. 1280313350009

SPECIFICATION: VVSG Volume I

PARA. NO. Section 4.1.2.7

REQUIREMENTS: 2005 VVSG Volume I: Section 4.1.2.4

Vote scanning and counting equipment for paper-based systems, and all DRE equipment shall be able to withstand, without disruption of normal operation or loss of data, surges of:

    a. +2 kV AC line to line
    b. +2 kV AC line to earth
    *c. + or – 0.5 kV DC line to line >10m
    *d. + or – 0.5 kV DC line to earth >10m
    *e. +1 kV I/O signal/control >30m

*Indicates requirements that do not apply to the Unit Under Test (UUT), due to the fact that UUT does not contain DC lines in excess of 10 Meters, nor does it contain any I/O lines greater than 20 meters.

DESCRIPTION OF ANOMALY:

After the being subjected to the Lightning Surge Test (LST) being performed on July 11, 2013 the AC Power Adapter ceased to function and as a result, the DS200 suffered a disruption of normal operation. The AC Power Adapter ceased to function, during application of 2 kV. The failure occurred at pulse 3 of 7 Sync: 0°/60Hz between the Path L1–N. Photographs were taken of the testing site.

Component Description: AC Power Adapter
Manufacturer: Power-Win Technology Corp.
Model: PW-080A2-1Y24A"

(The remainder of this page intentionally left blank)

Wyle Labs. Rev. Mar. 10   Page _____ of _____

WYLE LABORATORIES, INC.
Huntsville Facility
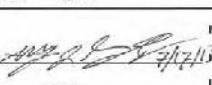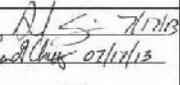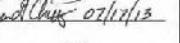
Page No. A-3 of 10
Test Report No. T71013.01-01

wyle
laboratories

NOTICE OF ANOMALY

DISPOSITION • COMMENTS • RECOMMENDATIONS:
The final disposition is pending a root cause analysis to be presented by the client.

Potential 10 CFR Part 21	☐ YES	☒ NO	

RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21:	☒ CUSTOMER	☐ WYLE

CAR Required:	☐ YES	☒ NO	CAR No.	

VERIFICATION: PROJECT ENGINEER: _____ 7/17/13

TEST WITNESS: _____ 7/17/13   PROJECT MANAGER: _____ 07/17/13

REPRESENTING: _____ ES&S   INTERDEPARTMENTAL
                                COORDINATION: _____ N/A

QUALITY ASSURANCE: _____

(The remainder of this page intentionally left blank)

WH-1066, Rev. MAR '09   Page ___2___ of ___2___

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. A-4 of 10
Test Report No. T71013.01-01

Field Issue Resolution Process

Date Reported	7/11/2013
Report Date	9/6/2013
Who is Reporting the Issue?	Wyle Engineers
Brief Description of the Issue	Power supply damaged during test (NTS #: 3.d?)

Supplemental Information	What location is reporting the issue?	Wyle Labs
	Equipment Affected (Model & Rev Rea)	DS200, 1.3
	What Version of Software are They Running	FLEYS/1500
	Has this Issue Been Confirmed or Duplicated	Yes
	By Who	Paul Huffman
	How	Lightning Surge Test

Implement Action Plan

1. Assign Field Issue Tracking Number			
2. Notify Reg Acct Mgr/Cust Svc Mgr, Cert		Sue McKoy	
3. Assess Warehouse Inventory as required		na	
4. Categorize Issue	Software	Notify Dir	na
		Submit RCR	na
	Hardware	Notify Dir	
		Identify Product Line Manager	Paul Huffman
		Is situation fixable?	NO
5. Conference Call Dates	What are the customer expectations?	Short Term	na
		Long Term	
	Immediate customer action		
	Is info gathered sufficient to resolve?		
	Engineering site visit required?		Yes
	Arrange return of equipment?		no
6. Find Root Cause	Workmanship? ___ Wear/Handling? ___ Design? ___ Other? _Faulty Capacitor_	How to fix?	Add Tripp-Lite Spike Cube
		What prevents future occurrences?	Add to QC checklist
7. Confirm Solution		Describe how fix was verified.	Retest at Wyle was successful
		How does this solution impact the certified configuration?	Citeria testing already complete
		What additional customer testing required?	na

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. A-5 of 10
Test Report No. T71013.01-01

wyle
laboratories

NOTICE OF ANOMALY		DATE: 07/12/2013

NOTICE NO: 2   P.O. NUMBER: ES&S-MSA-TA029   CONTRACT NO: N/A

CUSTOMER: ES&S   WYLE JOB NO: 171013.01

NOTIFICATION MADE TO: Paul Halfman   NOTIFICATION DATE: 07/12/2013

NOTIFICATION MADE BY: Ryan Chambers   VIA: In person

CATEGORY: [X] SPECIMEN [ ] PROCEDURE [ ] TEST EQUIPMENT   DATE OF ANOMALY: 07/12/2013

PART NAME: DS200   PART NO. DS200

TEST: Lightning Surge Test (LST)   I.D. NO: DS0313350009

SPECIFICATION: VVSG Volume I

PARA. NO. Section 4.1.2.7

REQUIREMENTS: 2005 VVSG Volume I: Section 4.1.2.4

Vote scanning and counting equipment for paper-based systems, and all DRE equipment shall be able to withstand, without disruption of normal operation or loss of data, surges of:

    a. +2 kV AC line to line
    b. +2 kV AC line to earth
    *c. + or – 0.5 kV DC line to line >10m
    *d. + or – 0.5 kV DC line to earth >10m
    *e. + 1 kV I/O sig/control >30m

*Indicates requirements that do not apply to the Unit Under Test (UUT), due to the fact that UUT does not contain DC lines in excess of 10 Meters, nor does it contain any I/O lines greater than 30 meters.

DESCRIPTION OF ANOMALY:

After the being subjected to the Lightning Surge Test (LST) being performed on July 12, 2013 the AC Power Adapter ceased to function and as a result, the DS200 suffered a disruption of normal operation. The AC Power Adapter ceased to function, during application of 2 kV. The failure occurred at pulse 4 of 7 Sync: 0°/60Hz between the Path L1–N. Photographs were taken of the testing site.

Component Description: AC Power Adapter
Manufacturer: Power-Win Technology Corp.
Model: PW-080A2-1Y24AP

(The remainder of this page intentionally left blank)

WLI-1006 Rev MAR 10   Page 1 of 2

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. A-6 of 10
Test Report No. T71013.01-01

wyle
laboratories

NOTICE OF ANOMALY

DISPOSITION • COMMENTS • RECOMMENDATIONS:
The final disposition is pending a root cause analysis to be presented by the client.

Potential 10 CFR Part 21	☐ YES	☒ NO		
RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21:		☒ CUSTOMER		☐ WYLE
CAR Required. ☐ YES ☒ NO			CAR No.	

VERIFICATION   PROJECT ENGINEER: _____ 7/17/13

TEST WITNESS: _____ 7/17/13   PROJECT MANAGER: _____ 07/17/13

REPRESENTING: _____ ES&S   INTERDEPARTMENTAL
                                COORDINATION: _____ N/A

QUALITY ASSURANCE: _____

(The remainder of this page intentionally left blank)

WYE-006 Rev. MAR '09   Page __2__ of __2__

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 35 of 126
Certification Test Plan T71379.01

Page No. A-7 of 10
Test Report No. T71013.01-01

Field Issue Resolution Process

Date Reported	7/11/2013
Report Date	9/6/2013
Who is Reporting the Issue?	Ryan Charniers
Brief Description of the Issue	Power supply damaged during test (EUT #1 & #2)

Supplemental Information	What location is reporting the issue?	Wyle Labs
	Equipment Affected (Model & Rev Rou)	DS200, 1.3
	What Version of Software are They Running	PLEVS/500
	Has this Issue Been Confirmed or Duplicated	Yes
	By Who	Paul Huffman
	How	Lightning Surge Test

Implement Action Plan

1. Assign Field Issue Tracking Number			
2. Notify Reg Acct Mgr/Cust Svc Mgr/Cert		Sue McKay	
3. Assess Warehouse Inventory as required		na	
A: Categorize Issue	Software	Notify Dir	na
		Submit RCB	na
	Hardware	Notify Dir	
		Identify Product Line Manager	Paul Huffman
		Is situation isolated	NO
B: Conference Call (Date)	What are the customer expectations?	Short Term	na
		Long Term	
	Immediate customer action		
	Is info gathered sufficient to resolve?		
	Engineering site visit required?		Yes
	Arrange return of equipment?		no
6. Find Root Cause	Workmanship? Wear/Handling? Design? Other? _Faulty Capacitor_	How to fix?	Add Tripp-Lite Spike Cube
		What prevents future occurrences?	Add to QC checklist
7. Confirm Solution		Describe how fix was verified.	Retest at Wyle was successful
		How does this solution impact the certified configuration?	Official testing already complete
		What additional customer testing required?	na

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. A-8 of 10
Test Report No. T71013.01-01

wyle laboratories ORIGINAL

NOTICE OF ANOMALY		DATE: 08/28/2013

NOTICE NO: 4 D	P.O. NUMBER: ES&S-MSA-TAD29	CONTRACT NO: N/A
CUSTOMER: Election Systems and Software (ES&S)		WYLE JOB NO: T71013.01
NOTIFICATION MADE TO: Paul Huffman		NOTIFICATION DATE: 08/13/2013
NOTIFICATION MADE BY: Ryan Chambers		VIA: In person

CATEGORY: [x] SPECIMEN [ ] PROCEDURE [ ] TEST EQUIPMENT	DATE OF ANOMALY: 08/13/2013
PART NAME: EVS 4.5.0.0 FL	PART NO. DS200
TEST: Electromagnetic Susceptibility Test (EST)	I.D. NO. DS0313350009
SPECIFICATION: FAC 2005 VVSG, Volume 1	PARA. NO. Section 4.1.2.10

REQUIREMENTS:

Vote scanning and counting equipment for paper-based systems, and all DRE equipment, shall be able to withstand an electromagnetic field of 10 V/m modulated by a 1 kHz 80% AM modulation over the frequency range of 80 MHz to 1000 MHz, without disruption of normal operation or loss of data.

DESCRIPTION OF ANOMALY:

The EUT was oriented at 180 degrees, with the back of the EUT facing the Aantenna. The Aantenna was oriented in the Vertical position. Upon exposure to an electromagnetic field of 10 V/m modulated by a 1kHz 80% AM modulation over the frequency range of 80 MHz to 1000 MHz, the DS200 suffered disruption of normal operation. The shoeshine setup menu was available on the display and the shoeshine ballot was hanging from the front of the DS200 paper path.

DISPOSITION - COMMENTS - RECOMMENDATIONS:

The final disposition is pending a root cause analysis to be presented by ES&S.

Safety Related [ ] YES [x] NO	Potential 10 CFR Part 21 [ ] YES [ ] NO [x] N/A
RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21: [ ] CUSTOMER [ ] WYLE	
CAR Required [ ] YES [x] NO	CAR No.

VERIFICATION:	PROJECT ENGINEER: Ryan R. Clardy 08/30/2013
TEST WITNESS: N/A	PROJECT MANAGER: [signature] 7/20/13
REPRESENTING: N/A	INTERDEPARTMENTAL COORDINATION: N/A
QUALITY ASSURANCE: [signature] 8/30/13	N/A

WH 1066, Rev. March '08

Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix L, Page No. 37 of 126
Certification Test Plan T71379.01

Page No. A V of 10
Test Report No. T71013.01-01

Field Issue Resolution Process

Date Reported	4/18/2013	
Report Date	9/6/2013	
Who is Reporting the Issue?	Ryan Chambers	
Brief Description of the Issue	Short shine mode stops. (VDS-M+)	
	What location is reporting the issue?	Wyle Labs
	Equipment Affected (Model & Rev Res)	DS200, 1.3
	What Version of Software are They Running	FLEVS1600
	Has this Issue Been Confirmed or Duplicated	Yes
	By Who	Paul Huffman
	How	Electromagnetic Susceptibility Test

Implement Action Plan

1. Assign Field Issue Tracking Number			
2. Notify Reg Acct Mgr, Cust Svc Mgr, Cert		Sue McKay	
3. Assess Warehouse Inventory as required		na	
	Software	Notify Dir	na
		Submit BCR	na
	Hardware	Notify Dir	
		Identify Product Line Manager	Paul Huffman
		Is situation transit?	no
	What are the customer expectations?	Short Term	na
		Long Term	
	Immediate customer action		
	Is info gathered sufficient to resolve?		Yes
	Engineering site visit required?		Yes
	Arrange return of equipment?		na
	Workmanship? Wear/Handling? Design? Other? Facility Capacity	How to fix?	Double wrap sensor cable with ferrite near scanner board
		What prevents future occurrences?	
7. Confirm Solution	Describe how fix was verified.	Retest at Wyle was successful	
	How does this solution impact the certified configuration?	Official testing already complete	
	What additional customer testing required?		
8. Release Planning	What's planned for this	Change manufacturing process document	

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 38 of 126
Certification Test Plan T71379.01

Page No. A-10 of 10
Test Report No. T71013.01-01

wyle ORIGINAL

NOTICE OF ANOMALY		DATE: 08/28/2013

NOTICE NO: 5   P.O. NUMBER: ES&S-MSA-TA029   CONTRACT NO: N/A
CUSTOMER: Election Systems and Software (ES&S)   WYLE JOB NO: T71013.01
NOTIFICATION MADE TO: Paul Huffman   NOTIFICATION DATE: 08/16/2013
NOTIFICATION MADE BY: Ryan Chambers   VIA: In person

CATEGORY: [x] SPECIMEN [] PROCEDURE [] TEST EQUIPMENT   DATE OF ANOMALY: 08/16/2013
PART NAME: EVS 4.5.0.0 FL   PART NO. DS200
TEST: Electromagnetic Susceptibility Test (EST)   I.D. NO. DS0313350009
SPECIFICATION: EAC 2005 VVSG, Volume I   PARA. NO. Section 4.1.2.10

REQUIREMENTS:

Vote scanning and counting equipment for paper-based systems, and all DRE equipment, shall be able to withstand an electromagnetic field of 10 V/m modulated by a 1 kHz 80% AM modulation over the frequency range of 80 MHz to 1000 MHz, without disruption of normal operation or loss of data.

DESCRIPTION OF ANOMALY:

The EUT was oriented at 0 degrees, with the front of the EUT facing the Antenna. The Antenna was oriented in the Vertical position. Upon exposure to an electromagnetic field of 10 V/m modulated by a 1 kHz 80% AM modulation over the frequency range of 80 MHz to 1000 MHz, the DS200 suffered disruption of normal operation. The following error was displayed on the DS200 "1003059: Event Log Write Failed" and the shoeshine ballot was hanging from the front of the DS200 paper path. When the EUT was unplugged from AC to be removed from the test chamber, the EUT unexpectedly shut off. The EUT would not power back on when only being supplied with DC power. When the EUT was plugged back into an AC outlet outside of the chamber, the EUT successfully powered on. After 5 minutes the plug was removed from the AC outlet, the EUT successfully switched to DC and displayed 75% power for the battery status. Within 3 minutes the EUT displayed 100% power. Within 1 minute the EUT displayed 50% power. Within 1 minute the EUT displayed 100% power.

DISPOSITION • COMMENTS • RECOMMENDATIONS:

The final disposition is pending a root cause analysis to be presented by ES&S.

Safety Related □ YES ☒ NO	Potential 10 CFR Part 21 □ YES □ NO ☒ N/A
RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21:	□ CUSTOMER □ WYLE
CAR Required: □ YES ☒ NO	CAR No.

VERIFICATION: PROJECT ENGINEER: _Lyn Allen_ 08/30/2013
TEST WITNESS: N/A   PROJECT MANAGER: _____ 8/30/13
REPRESENTING: N/A   INTERDEPARTMENTAL COORDINATION: N/A
QUALITY ASSURANCE: _____ 8/30/13   N/A

WH 1096 Rev. March '09   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 39 of 126
Certification Test Plan T71379.01

Page No. A-11 of 10
Test Report No. T71013.01-01

Field Issue Resolution Process

Date Reported	4/28/2013
Report Date	9/6/2013
Who is Reporting the Issue?	Dyan Chambers
Brief Description of the Issue	Front Tag wire Label (NO#45)

	What location is reporting the issue?	Wyle Labs
Supplemental Information	Equipment Affected (Model & New Rev)	DS200, 1.3
	What Version of Software are They Running?	HLEVS1600
	Has this Issue Been Confirmed or Duplicated	Yes
	By Who	Paul Dahlman
	How	Electromagnetic Susceptibility Test

Implement Action Plan

1. Assign Field Issue Tracking Number		
2. Notify Reg Acct Mgr, Cust Svc Mgr, Cert		Sue McKay
3. Assess Warehouse Inventory as required		na
4. Categorize Issue	Software	Notify Dir	na
		Submit BCR	na
	Hardware	Notify Dir	
		Identify Product Line Manager	Paul Huffman
		Is situation trivial?	no
	What are the customer expectations?	Short Term	
		Long Term	na
	Immediate customer action		
	Is info gathered sufficient to resolve?		
		Engineering site visit required?	Yes
		Arrange return of equipment?	no
6. Find Root Cause	Workmanship? Wear/Handling? Design? Other? Faulty Capacitor	How to fix?	Copper tape shielding of paper entry
		What prevents future occurrences?	This modification will be added to the checklist to ensure application of tape
7. Confirm Solution		Describe how fix was verified.	Retest at Wyle was successful
		How does this solution impact the certified configuration?	Other testing already complete
		What additional customer testing required?	
8.	Release Planning	What's planned for this	Add copper tape during manufacturing process

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. A-12 of 10
Test Report No. T71013.01-01

wyle ORIGINAL
laboratories

NOTICE OF ANOMALY		DATE: 08/28/2013

NOTICE NO: 6   P.O. NUMBER: ES&S-MSA-1A029   CONTRACT NO: N/A

CUSTOMER: Election Systems and Software (ES&S)   WYLE JOB NO: T71013.01

NOTIFICATION MADE TO: Paul Huffman   NOTIFICATION DATE: 08/19/2013

NOTIFICATION MADE BY: Ryan Chambers   VIA: In person

CATEGORY: [x] SPECIMEN [] PROCEDURE [] TEST EQUIPMENT   DATE OF ANOMALY: 08/17/2013

PART NAME: EVS 4.5.0.0 FL   PART NO: DS200

TEST: Electromagnetic Susceptibility Test (EST)   I.O. NO. DS0313350009

SPECIFICATION: EAC 2005 VVSG, Volume I   PARA. NO. Section 4.1.2.10

REQUIREMENTS:

Vote scanning and counting equipment for paper-based systems, and all DRE equipment, shall be able to withstand an electromagnetic field of 10 V/m modulated by a 1 kHz 80% AM modulation over the frequency range of 80 MHz to 1000 MHz, without disruption of normal operation or loss of data.

DESCRIPTION OF ANOMALY:

The EUT was oriented at 0 degrees, with the back of the EUT facing the Antenna. The Antenna was oriented in the Vertical position. Upon exposure to an electromagnetic field of 10 V/m modulated by a 1kHz 80% AM modulation over the frequency range of 80 MHz to 1000 MHz, the DS200 suffered disruption of normal operation. The shoeshine setup menu was available on the display and the shoeshine ballot was hanging from the front of the DS200 paper path. When the EUT was unplugged from AC to be removed from the test chamber for ES&S representative, the EUT unexpectedly shut off. The EUT would not power back on when only being supplied with DC power. When the EUT was plugged back into an AC outlet outside of the chamber, the EUT successfully powered on. After 5 minutes the plug was removed from the AC outlet, the EUT successfully switched to DC and displayed 75% power for the battery status.

DISPOSITION - COMMENTS - RECOMMENDATIONS:

The final disposition is pending a root cause analysis to be presented by ES&S.

Safety Related	☐ YES ☒ NO	Potential 10 CFR Part 21	☐ YES ☐ NO ☒ N/A

RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21: ☐ CUSTOMER ☐ WYLE

CAR Required: ☐ YES ☒ NO   CAR No.

VERIFICATION: PROJECT ENGINEER: _Ryn A. Clark_ 08/30/2013

TEST WITNESS: N/A   PROJECT MANAGER: _Michael Walker_ 8/30/13

REPRESENTING: N/A   INTERDEPARTMENTAL COORDINATION: N/A

QUALITY ASSURANCE: _____ 8/3/10   N/A

WH 1066, Rev. March '09   Page 7 of 7

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 41 of 126
Certification Test Plan T71379.01

Page No. A-13 of 10
Test Report No. T71013.01-01

Field Issue Resolution Process

Date Reported	3/18/2013
Report Date	9/6/2014
Who is Reporting the Issue?	Ryan Destinee
Brief Description of the Issue	Unit shuts off when A/C removed. (NOA 98)

Supplemental information		
	What location is reporting the issue?	Wyle Labs
	Equipment Affected (Model & Rev/Res)	DS200, 1.3
	What Version of Software are They Running	R.EVS15UU
	Has this Issue Been Confirmed or Duplicated	Yes
	By Who	Paul Huffman
	How	Electromagnetic Susceptibility Test

Implement Action Plan

1. Assign Field Issue Tracking Number			
2. Notify Reg Acct Mgr, Cust Svc Mgr, Cert			Sue McKay
3. Assess Warehouse Inventory as required			na
4. Categorize Issue	Software	Notify Dir	na
		Submit RCR	na
	Hardware	Notify Dir	
		Identify Product Line Manager	Paul Huffman
		Is situation trivial?	yes
5. Conference Call Date:	What are the customer expectations?	Short Term	na
		Long Term	
	Immediate customer action		
	Is info gathered sufficient to resolve?		
	Engineering site visit required?		Yes
	Arrange return of equipment?		Yes
6. Root Cause Workmanship? Wear/Handling? Design? Other? Faulty Capacitor	How to fix?		Replaced battery pack
	What prevents future occurrences?		
7. Confirm Solution	Describe how fix was verified.		Retest at Wyle was successful
	How does this solution impact the certified configuration?		Official testing already complete
	What additional customer testing required?		
8. Release Planning	What's planned for this		

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 42 of 126
Certification Test Plan T71379.01

Page No. A-14 of 10
Test Report No. T71013.01-01

wyle
laboratories

ORIGINAL   NOTICE OF ANOMALY   DATE: 09/16/2013

NOTICE NO: ____ 7 (Rev A)   P.O. NUMBER: ES&S-MSA TA029   CONTRACT NO.   N/A
CUSTOMER: Election Systems and Software (ES&S)   WYLE JOB NO: T71013.01
NOTIFICATION MADE TO: ___ Paul Huffman   NOTIFICATION DATE: 08/20/2013
NOTIFICATION MADE BY: ___ Ryan Chambers   VIA: In person

CATEGORY: [] SPECIMEN   [x] PROCEDURE   [] TEST EQUIPMENT   DATE OF ANOMALY: 08/20/2013
PART NAME: ___ EVS 4.5.0.0 FI   PART NO.
TEST: ___ Low Temperature   I.D. NO.   DS0313350009
SPECIFICATION: EAC 2005 VVSG. Volume II   PARA. NO.   Section 4.6.4

REQUIREMENTS:

The low temperature test simulates stresses faced during storage of voting machines and ballot counters. All system components, regardless of type, shall meet the requirements of this test. This test is equivalent to the procedure of MIL-STD-810D, Method 502.2, Procedure I-Storage. The minimum temperature shall be -4 degrees F. As outlined in the VVSG 4.6.4.2 Procedure, the following procedure is identified in Step 5: Allow the internal temperature of the equipment to stabilize at laboratory conditions before removing it from the chamber.

DESCRIPTION OF ANOMALY:

The technician removed the EUT from the environmental chamber approximately 1 hour after the internal temperature of the thermal chamber was returned to standard laboratory conditions. The technician did not allow the internal temperature of the equipment to stabilize at laboratory conditions before removing it from the chamber. As a result the accumulated moisture on the circuit board of the scanner assembly module caused a short circuit when the EUT was powered on. This anomaly was directly caused by human error in following the VVSG standard and the Wyle Operating Procedures.

DISPOSITION • COMMENTS • RECOMMENDATIONS:

The final disposition was to council and retrain all of the Wyle technicians on the associated Wyle Operating Procedure.

Safety Related   [] YES   [x] NO   Potential 10 CFR Part 21   [] YES   [] NO   [x] N/A
RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21.   [] CUSTOMER   [] WYLE
CAR Required: [] YES   [x] NO   CAR No.

VERIFICATION: PROJECT ENGINEER: _____ 09/16/2013
TEST WITNESS: N/A   PROJECT MANAGER: _____ 9/16/13
                                         INTERDEPARTMENTAL
REPRESENTING: N/A   COORDINATION: ___ N/A
QUALITY ASSURANCE: _____ 9/16/13   N/A

WH-1060, Rev. March 09   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. A-15 of 10
Test Report No. T71013.01-01

wyle laboratories   ORIGINAL

NOTICE OF ANOMALY		DATE: 08/30/2013

NOTICE NO.: 8	P.O. NUMBER: ES&S-MSA-TA029	CONTRACT NO.: N/A
CUSTOMER: Election Systems and Software (ES&S)		WYLE JOB NO: T71013.01
NOTIFICATION MADE TO: Paul Huffman		NOTIFICATION DATE: 07/31/2013
NOTIFICATION MADE BY: Ryan Chambers		VIA: In person

CATEGORY: [x] SPECIMEN [] PROCEDURE [] TEST EQUIPMENT	DATE OF ANOMALY: 07/31/2013
PART NAME: EVS 4.5.0.0 FL	PART NO.: ---
TEST: Electrostatic Disruption (ESD)	I.D. NO.: DS0313350009
SPECIFICATION: EAC 2005 VVSG, Volume I	PARA. NO.: Section 4.1.2.8

REQUIREMENTS:

Vote scanning and counting equipment for paper-based systems, and all DRE equipment, shall be able to withstand ±15 kV air discharge and ±8 kV contact discharge without damage or loss of data. The equipment may reset or have momentary interruption so long as normal operation is resumed without human intervention or loss of data. Loss of data means votes that have been completed and confirmed to the voter.

DESCRIPTION OF ANOMALY:

Upon application of +15 kV air discharge to the top-right corner of the black plastic ballot tray cover, located closest to the front right of the DS200 screen. It was observed that the DS200 had become completely unresponsive and required human intervention, by means of a system reboot, to regain normal operation of the DS200. A clicking sound was observed during operation of the EUT, thus the shoeshine ballot was replaced with a new ballot and the clicking sound was resolved. After rebooting the EUT, the same test point was subjected to ±2,4,8,15 kV air discharge, at which time the EUT continued normal operation throughout the remainder of the test.

DISPOSITION • COMMENTS • RECOMMENDATIONS:

To ensure testing results where accumulated in accordance with the VVSG, the Electrostatic Disruption (ESD) was reperformed on 08/29/2013, for which there were no anomalies.
The final disposition is that the original observance could not be replicated.

Safety Related: ☐ YES ☒ NO	Potential 10 CFR Part 21: ☐ YES ☐ NO ☒ N/A
RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21:	☐ CUSTOMER ☐ WYLE
CAR Required: ☐ YES ☒ NO	CAR No.:

VERIFICATION:	PROJECT ENGINEER: _Ron B. Plant_ 08/30/2013
TEST WITNESS: _N/A_	PROJECT MANAGER: _Michael O'Laster_ 8/30/13
REPRESENTING: _N/A_	INTERDEPARTMENTAL COORDINATION: _N/A_
QUALITY ASSURANCE: _____ 8/30/13	_N/A_

WH 1086, Rev. March '99   Page __1__ of __1__

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-1 of 17
Test Report No. T71013.01-01

ATTACHMENT B

PHOTOGRAPHS
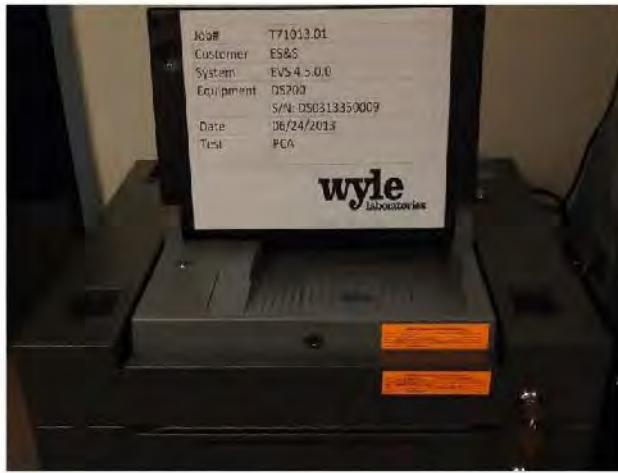
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-2 of 17
Test Report No. T71013.01-01

Photograph 1: ES&S FL EVS 4.5.0.0 PCA

Photograph 2: ES&S FL EVS 4.5.0.0 PCA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 46 of 126
Certification Test Plan T71379.01

Page No. B-3 of 17
Test Report No. T71013.01-01

Photograph 3: ES&S FL EVS 4.5.0.0 PCA

Photograph 4: ES&S FL EVS 4.5.0.0 PCA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-4 of 17
Test Report No. T71013.01-01

Photograph 5: ES&S FL EVS 4.5.0.0 PCA

Photograph 6: ES&S FL EVS 4.5.0.0 PCA

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-5 of 17
Test Report No. T71013.01-01

Photograph 7: ES&S FL EVS 4.5.0.0 PCA

Photograph 8: ES&S FL EVS 4.5.0.0 PCA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-6 of 17
Test Report No. T71013.01-01

Photograph 9: ES&S FL EVS 4.5.0.0 PCA
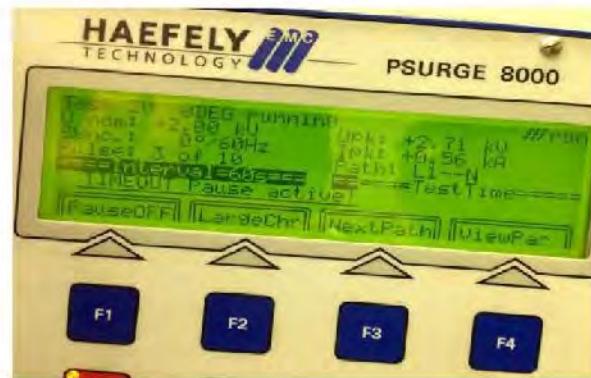
Photograph 10: ES&S FL EVS 4.5.0.0 PCA

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-7 of 17
Test Report No. T71013.01-01

Photograph 11: ES&S FL EVS 4.5.0.0 Lightning Surge

Photograph 12: ES&S FL EVS 4.5.0.0 Lightning Surge

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-8 of 17
Test Report No. T71013.01-01

Photograph 13: ES&S FL EVS 4.5.0.0 Magnetic Fields Immunity

Photograph 14: ES&S FL EVS 4.5.0.0 Magnetic Fields Immunity

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-9 of 17
Test Report No. T71013.01-01

Photograph 15: ES&S FL EVS 4.5.0.0 Electromagnetic Emissions

Photograph 16: ES&S FL EVS 4.5.0.0 Electromagnetic Emissions

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 53 of 126
Certification Test Plan T71379.01

Page No. B-10 of 17
Test Report No. T71013.01-01

Photograph 17: ES&S FL EVS 4.5.0.0 Electrostatic Disruption

Photograph 18: ES&S FL EVS 4.5.0.0 Electrostatic Disruption
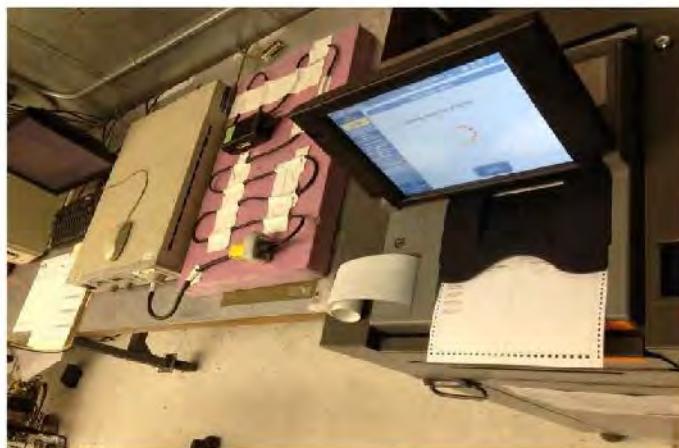
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-11 of 17
Test Report No. T71013.01-01

Photograph 19: ES&S FL EVS 4.5.0.0 Electrical Power Disturbance

Photograph 20: ES&S FL EVS 4.5.0.0 Electrical Power Disturbance

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-12 of 17
Test Report No. T71013.01-01

Photograph 21: ES&S FL EVS 4.5.0.0 Electromagnetic Susceptibility

Photograph 22: ES&S FL EVS 4.5.0.0 Electromagnetic Susceptibility

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-13 of 17
Test Report No. T71013.01-01

Photograph 23: ES&S FL EVS 4.5.0.0 Temperature and Power Variation

Photograph 24: ES&S FL EVS 4.5.0.0 Temperature and Power Variation

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 57 of 126
Certification Test Plan T71379.01

Page No. B-14 of 17
Test Report No. T71013.01-01

Photograph 25: ES&S FL EVS 4.5.0.0 Bench Handling

Photograph 26: ES&S FL EVS 4.5.0.0 Bench Handling

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-15 of 17
Test Report No. T71013.01-01

Photograph 27: ES&S FL EVS 4.5.0.0 Humidity

Photograph 28: ES&S FL EVS 4.5.0.0 Humidity

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-16 of 17
Test Report No. T71013.01-01

Photograph 29: ES&S FL EVS 4.5.0.0 Low Temperature


Photograph 30: ES&S FL EVS 4.5.0.0 Low Temperature

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-17 of 17
Test Report No. T71013.01-01

Photograph 31: ES&S FL EVS 4.5.0.0 High Temperature

Photograph 32: ES&S FL EVS 4.5.0.0 High Temperature

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-1 of 25
Test Report No. T71013.01-01

ATTACHMENT C

NON-OPERATING ENVIRONMENTAL TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 62 of 126
Certification Test Plan T71379.01

Page No. C 2 of 25
Test Report No. T71013.01-01
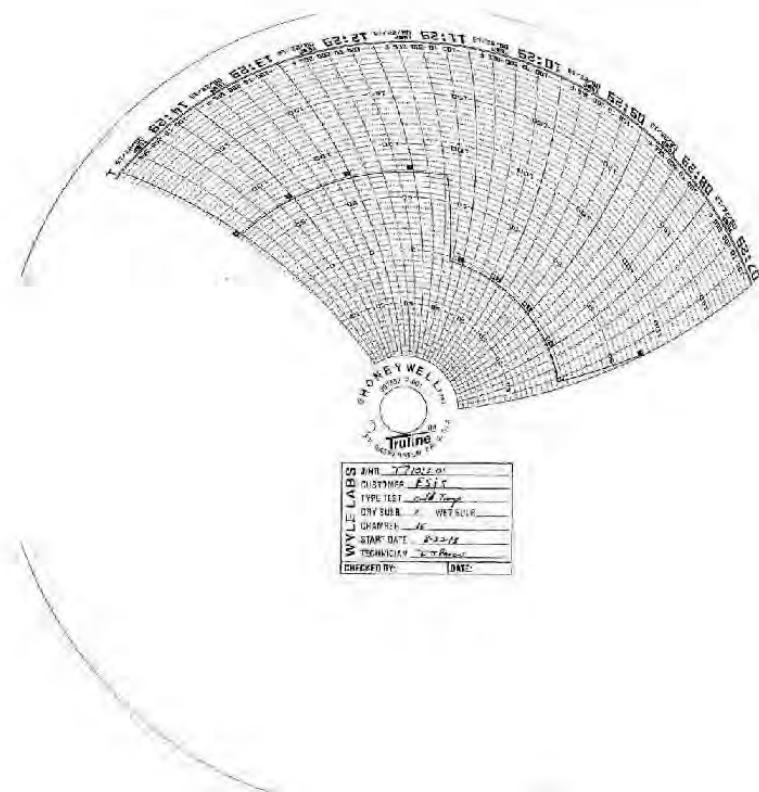
LOW TEMPERATURE TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-3 of 25
Test Report No. T71013.01-01

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 64 of 126
Certification Test Plan T71379.01

Page No. C-4 of 25
Test Report No. T71013.01-01
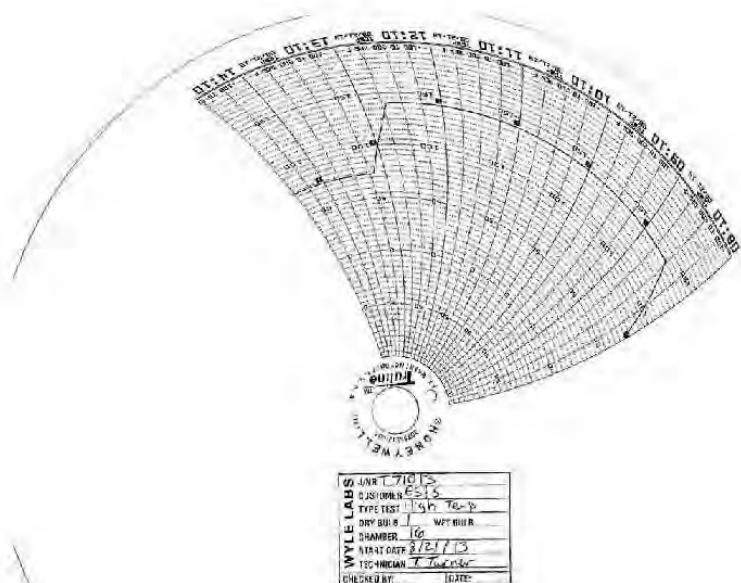
HIGH TEMPERATURE TEST DATA

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-5 of 25
Test Report No. T71013.01-01

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-6 of 25
Test Report No. T71013.01-01

VIBRATION TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 67 of 126
Certification Test Plan T71379.01

Page No. C-7 of 25
Test Report No. T71013.01-01

VIBRATION TEST DATA SHEET

Customer ES&S

Job No. T71013.01

GSI: Yes ☐ No ☒ Precedure _____

Spec. _____   Method _____

Specimen DS200 Hardshell & DS200 Plastic Case

Part No. _____   S/N _____

Specimen Temp. Ambient

Photo Yes ☒ No ☐

Test Title _____

Date	Time	Axis	Temp (F) Amb	SINUSOIDAL Freq (cps)	Disp (in)	Accel (g)	RANDOM Freq (cps)	PSD (g²/Hz)	Slope (dB/Oct)	TOTAL Accel (grms)	Test Time (min)	TEST REQUIREMENT / COMMENTS
10/24/13	13:40	Tran	Amb				10	0.013				Run#: Basic Transportation
							73-170	0.0002				Common Carrier Vibration
							73	0.0065				
							500	0.0001		0.55	30	
10/24/13	14:12	Long	Amb				10-50	0.0055				Run#2: Basic Transportation
							120	0.0015				Common Carrier Vibration
							170-200	0.0055				
							240	0.0062				
							440	0.0083		0.749	30	
							900	0.0015				

Signed _____   Approved _____

KVH-1105A

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 68 of 126
Certification Test Plan T71379.01

Page No. C-8 of 25
Test Report No. T71013.01-01
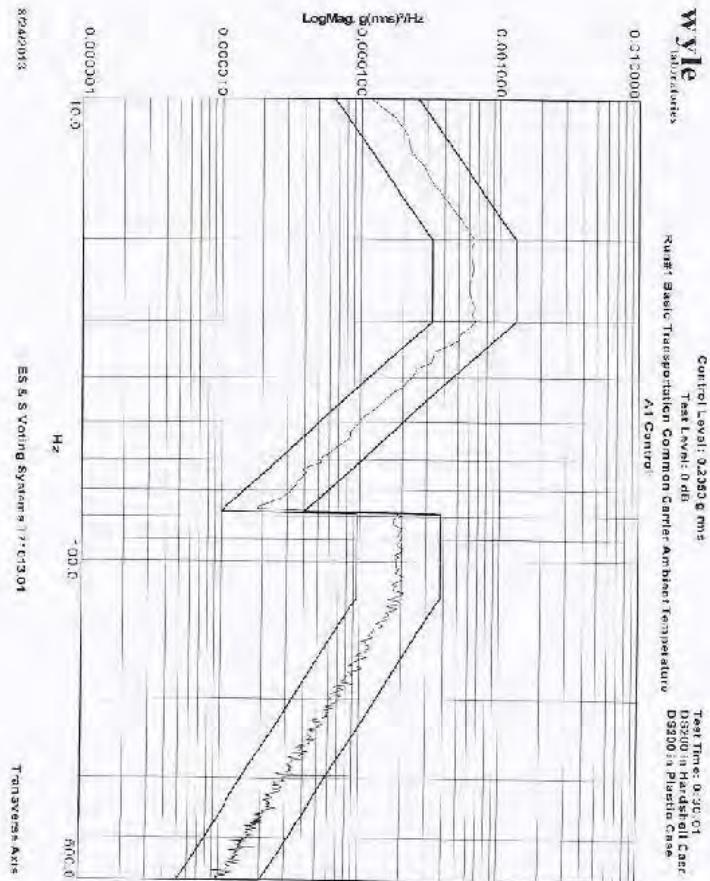
VIBRATION TEST DATA SHEET

Date	Time	Axis	Temp (°F)	SINUSOIDAL			RANDOM			TOTAL		TEST REQUIREMENT	COMMENTS	I.D No.
				Freq (cps)	Disp. (inch)	Accel (±g)	Freq (cps)	PSD (g²/Hz)	Slope (±dB/oct)	Accel (grms)	Test Time (min)			
2/6/2013	1612	Y/V	Amb				10-40	≤1800		1.06	30	Run #3 Basic Transportation Common Carrier Vibration		N/A/NF

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 69 of 126
Certification Test Plan T71379.01

Page No. C-9 of 25
Test Report No. T71013.01-01
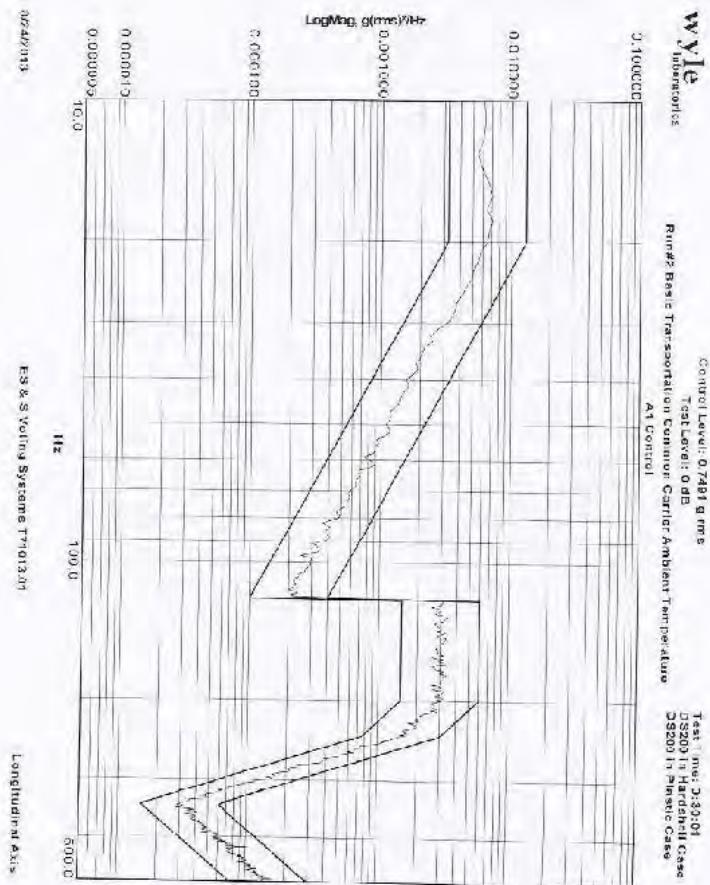
WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-10 of 25
Test Report No. T71013.01-01
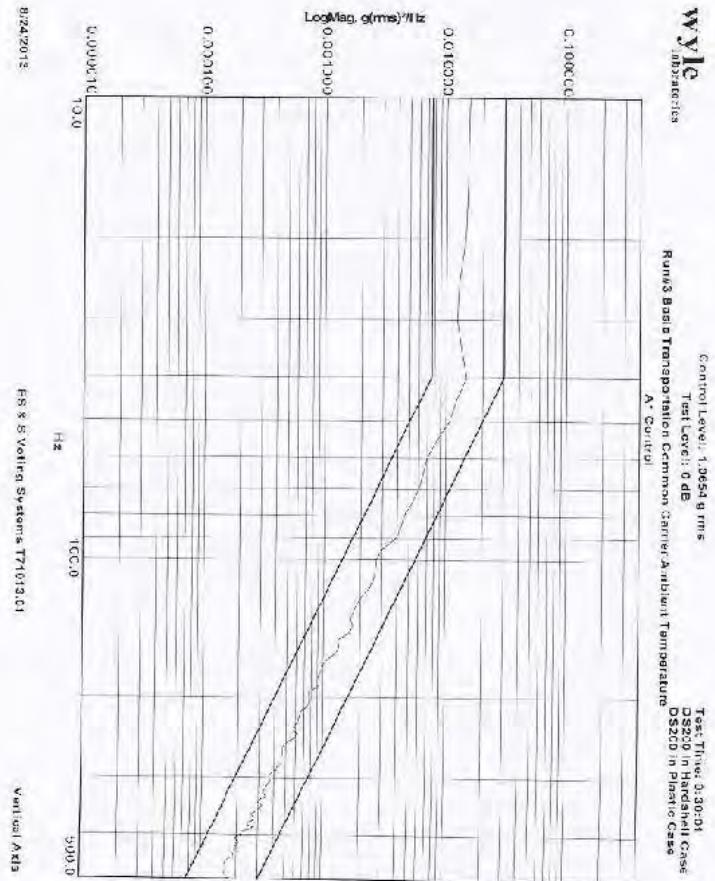
WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-11 of 25
Test Report No. T71013.01-01

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 72 of 126
Certification Test Plan T71379.01

Page No. C 12 of 25
Test Report No. T71013.01-01

BENCH HANDLING TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-13 of 25
Test Report No. T71013.01-01

wyle
laboratories

DATA SHEET

Customer ___ES&S___

Specimen ___EVS 4500___

Part No. ___DS200___	Amb. Temp. ___~75°F___	Job No. ___T71013___
Spec. ___EAC 2005 VVSG___	Photo ___Yes___	Report No. ___T71013-01___
Para. ___4.6.2___	Test Med. ___Air___	Start Date ___8-28-13___
S/N ___DS0313350010 & DS0313350006___	Specimen Temp. ___Ambient___	

Test Title ___Bench Handling___

Drop Height: 4"

	EUT1	EUT2
Edge 1: Drops 1-6	✓	✓
Edge 1: Drops 7-12	✓	✓
Edge 1: Drops 13-18	✓	✓
Edge 1: Drops 19-24	✓	✓

Post-Test Inspection: *Post-DT Status check Completed on both units under test without issue*

Test Passed & completed 8/26/13 10:25 A.M.

Tested By _(signature)_ Date 8/26/13

Sheet No. ___1___ of ___1___

Notice of Anomaly ___N/A___

Approved _Michael L Walker_
Project Engineer

Wyle Form WH-614A, Rev. Jun 03

National Technical Systems
Huntsville Facility

Page No. C-14 of 25
Test Report No. T71013.01-01
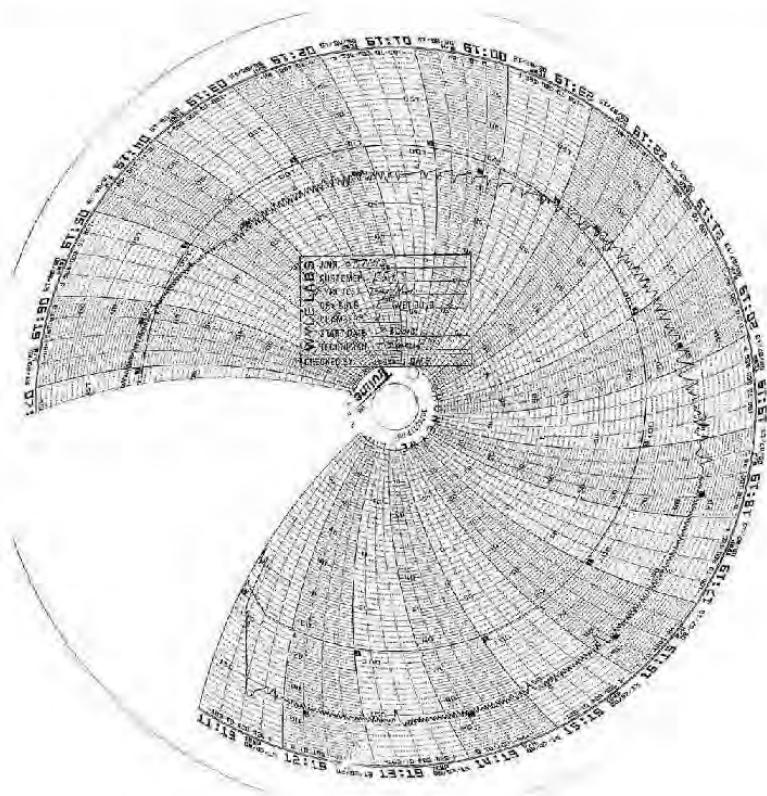
HUMIDITY TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-15 of 25
Test Report No. T71013.01-01
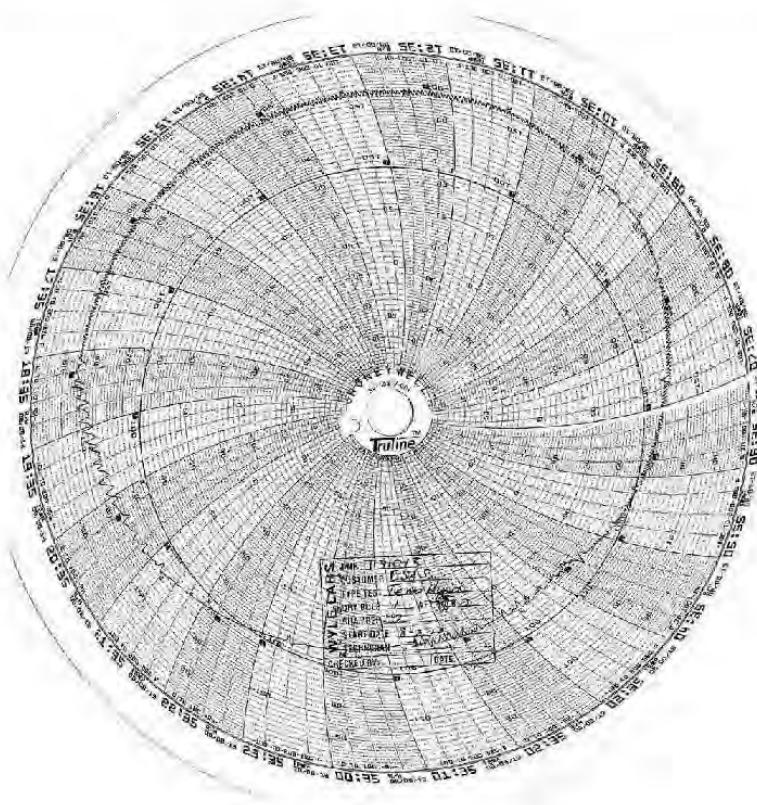
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-16 of 25
Test Report No. T71013.01-01
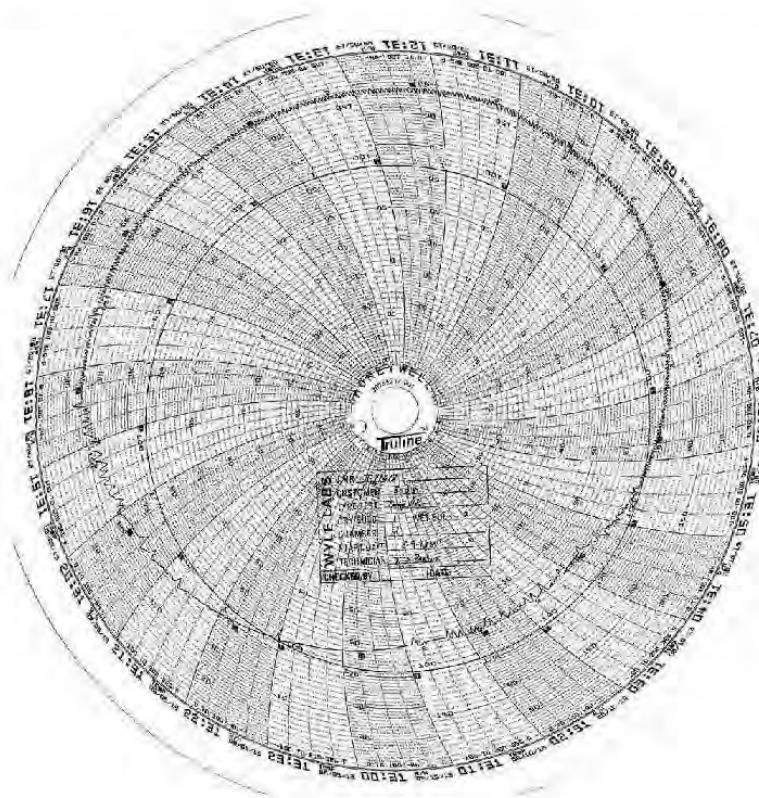
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-17 of 25
Test Report No. T71013.01-01
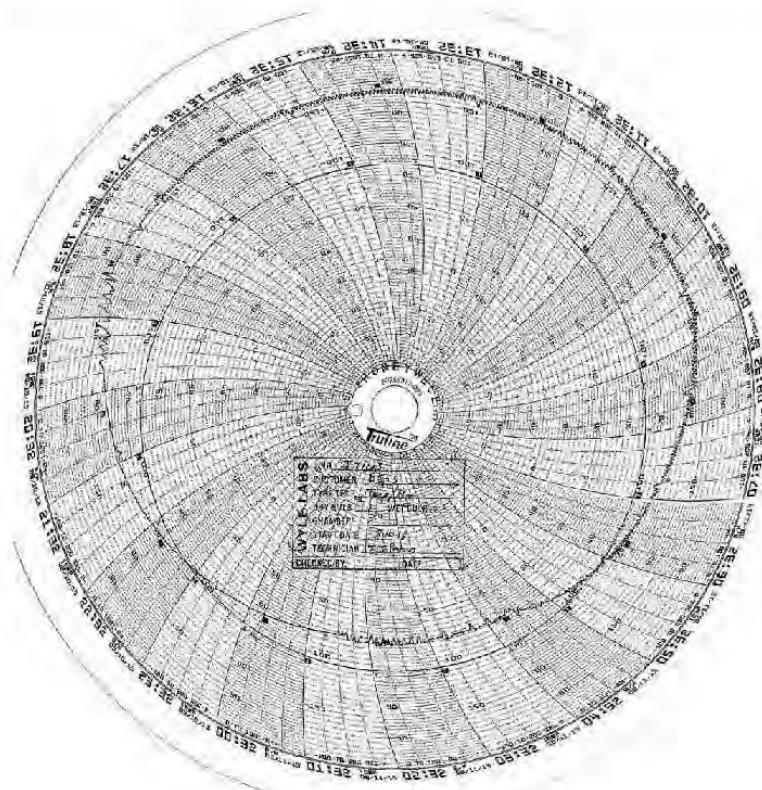
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 78 of 126
Certification Test Plan T71379.01

Page No. C-18 of 25
Test Report No. T71013.01-01

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-19 of 25
Test Report No. T71013.01-01
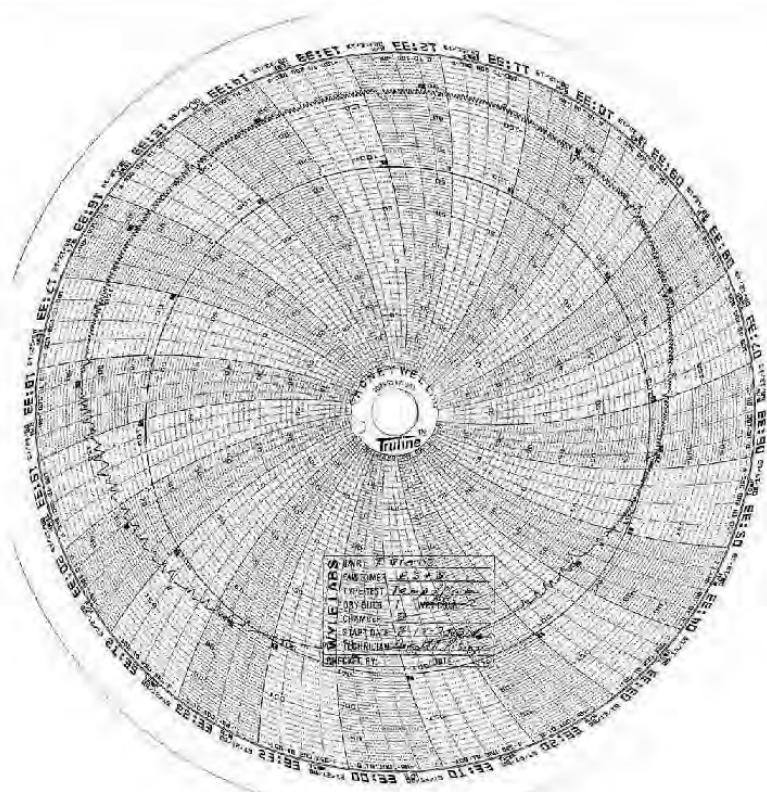
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-20 of 25
Test Report No. T71013.01-01
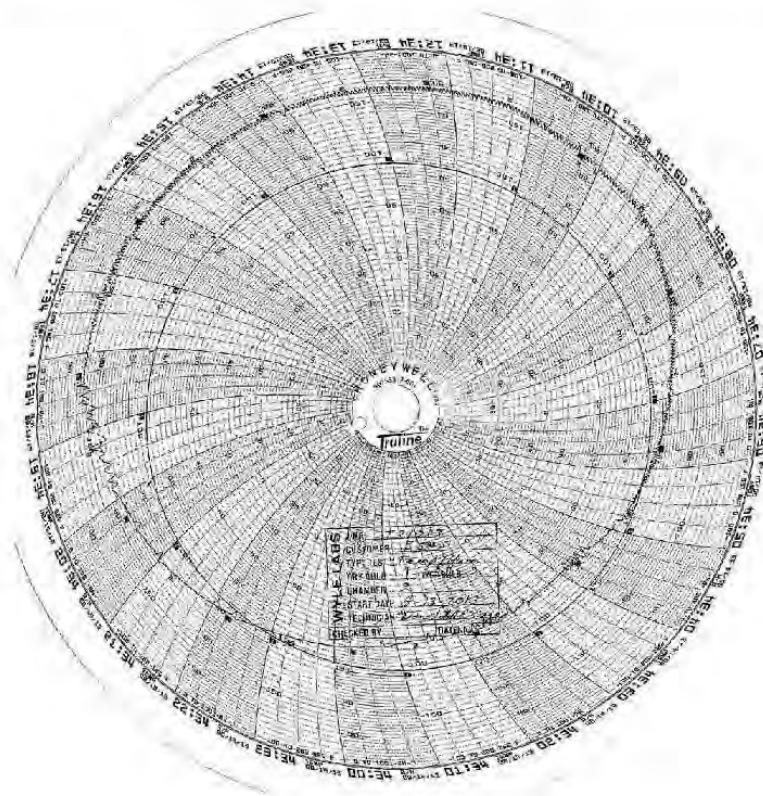
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-21 of 25
Test Report No. T71013.01-01
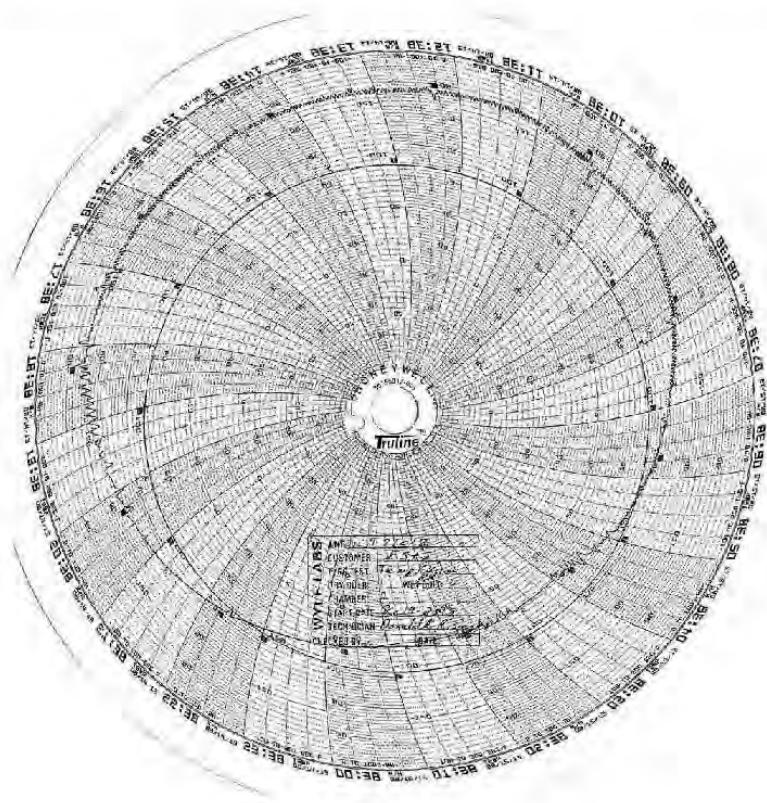
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-22 of 25
Test Report No. T71013.01-01

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-23 of 25
Test Report No. T71013.01-01
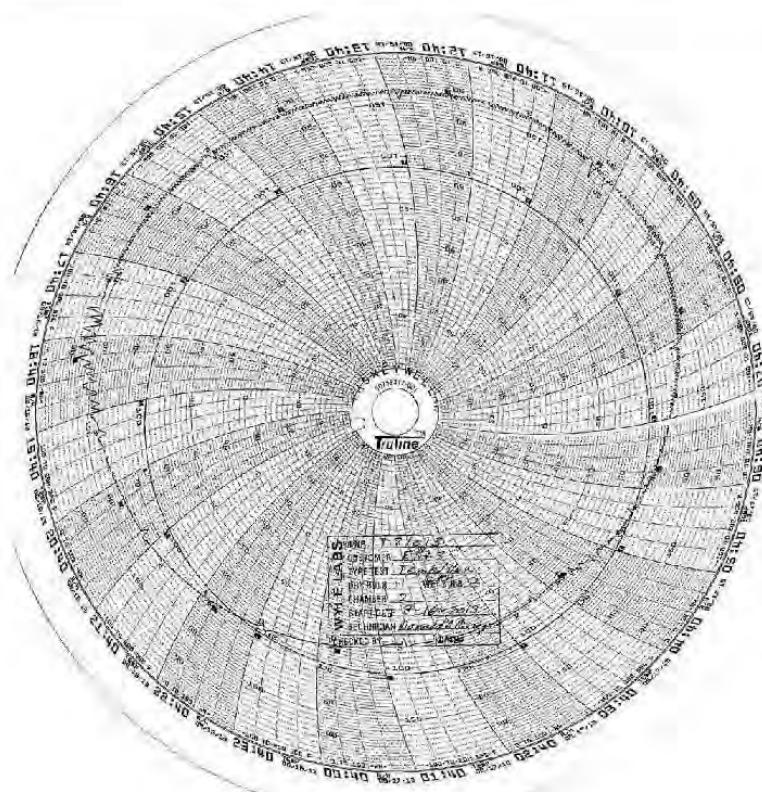
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-24 of 25
Test Report No. T71013.01-01
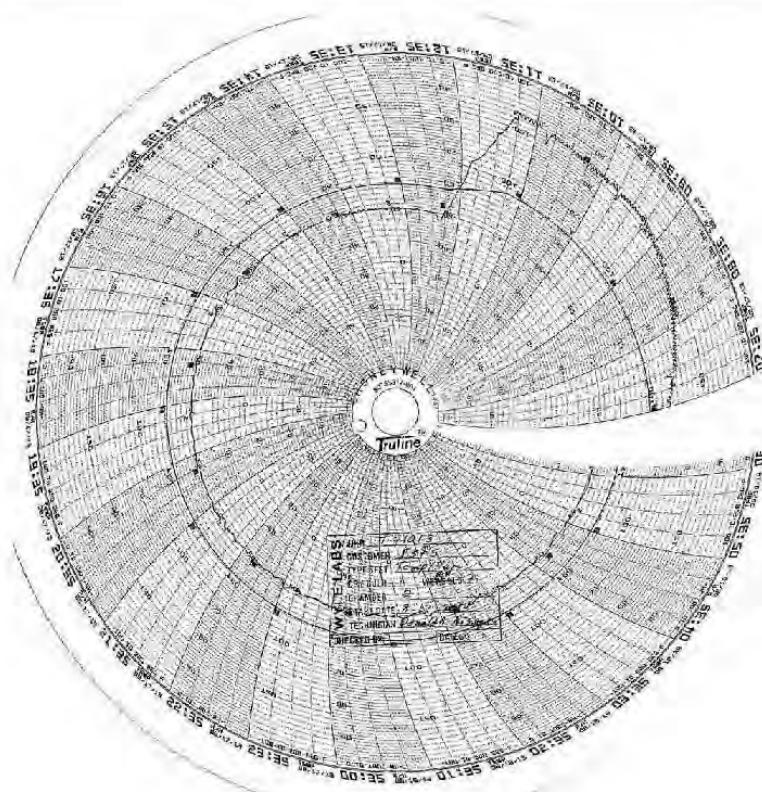
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-25 of 25
Test Report No. T71013.01-01

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 86 of 126
Certification Test Plan T71379.01

Page No. D-1 of 20
Test Report No. T71013.01-01

ATTACHMENT D

ELECTRICAL TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 87 of 126
Certification Test Plan T71379.01

Page No. D 2 of 20
Test Report No. T71013.01-01

ELECTROSTATIC DISRUPTION

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-3 of 20
Test Report No. T71013.01-01

wyle laboratories — DATA SHEET

Job No.:	171013.01
Start Date:	8-29-2013
Humidity:	56%

Customer:	ES&S (page 1 of 2)	Temperature:	22.4°F
EUT:	4500	Measurement Prime:	See Test Points Below
Model No.:	DS200	Interference Signal:	See Applied Signal
Serial No.:		Frequency Range:	N/A
Test Title:	Electrostatic Disruption		

Test Points	Meets Limit Yes	Meets Limit No	Applied Level (KV)	Discharge Type	Times Tested	Comments
TP001: Vertical Coupling Plane	✓		±2, 4, 8	Contact	10	Back Side of EUT
TP002: DS200 USB Well keyhole	✓		±2, 4, 8	Contact	10	Engineering log not obtained TP002 to TP001
TP003: DS200 Front keyhole	✓		±2, 4, 8	Contact	10	
TP004: Metal Ballot Box Front Upper Right Keyhole	✓		±2, 4, 8	Contact	10	
TP005: Metal Ballot Box Front Lower Right Keyhole	✓		±2, 4, 8	Contact	10	
TP006: Metal Ballot Box Top Right Rear Keyhole	✓		±2, 4, 8	Contact	10	
TP007: Metal Ballot Box Right Front Box Door Keyhole	✓		±2, 4, 8	Contact	10	
TP008: Metal Ballot Box Above Right Ballot Door	✓		±2, 4, 8	Contact	10	
TP009: Metal Ballot Box Front Above the Auxiliary Slot	✓		±2, 4, 8	Contact	10	
TP010: Metal Ballot Box Back Upper Center	✓		±2, 4, 8	Contact	10	
TP011: Metal Ballot Box Above Left Ballot Box Door	✓		±2, 4, 8	Contact	10	
TP012: Metal Ballot Box Left Ballot Box Door Keyhole	✓		±2, 4, 8	Contact	10	
TP013: DS200 Modem Door Keyhole	✓		±2, 4, 8	Contact	10	
TP014: DS200 Track Cover Left Rear	✓		±2, 4, 8, 15	Air	10	
TP015: DS200 Track Cover Left Front	✓		±2, 4, 8, 15	Air	10	
TP016: DS200 Track Cover Right Rear	✓		±2, 4, 8, 15	Air	10	
TP017: DS200 Track Cover Right Rear	✓		±2, 4, 8, 15	Air	10	
TP018: DS200 Ballot Track Front Center	✓		±2, 4, 8, 15	Air	10	
TP019: DS200 Screen Frame Front Face Left Top Corner Interior	✓		±2, 4, 8, 15	Air	10	

Notice of Anomaly: ○

Witness: _____
WH-1443, Rev Dec 2004

Tested By: _[signature]_   Technician   Date: 08/29/2013

Approved: _[signature]_   Project Engineer   Date: 08/29/2013

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. D-4 of 20
Test Report No. T71013.01-01

wyle
laboratories

DATA SHEET

Job No.:	T71013.01
Start Date:	8-20-2013
Humidity:	56%

Customer: ES&S (Page 2 of 2)
EUT: 4500
Model No.: DS200
Serial No.:
Test Title: Electrostatic Disruption

Temperature: 22.4F
Measurement Point: See Test Points Below
Interference Signal: See Applied Signal
Frequency Range: N/A

Test Points	Meets Limit		Applied Level (kV)	Discharge Type	Times Tested	Comments
	Yes	No				
TP020: DS200 Screen Frame Front-face Left Top Corner Exterior	✓		±2, 4, 8, 15	Air	10	
TP021: DS200 Screen Frame Front-face Top Space	✓		±2, 4, 8, 15	Air	10	
TP022: DS200 Screen Frame Front-face Top Right Corner	✓		±2, 4, 8, 15	Air	10	
TP023: DS200 Screen Top Right Center	✓		±2, 4, 8, 15	Air	10	
TP024: DS200 Screen Top Right Center	✓		±2, 4, 8, 15	Air	10	
TP025: DS200 Screen Top Left Center	✓		±2, 4, 8, 15	Air	10	
TP026: DS200 Screen Top Left Corner	✓		±2, 4, 8, 15	Air	10	
TP027: DS200 Screen Middle Left Side	✓		±2, 4, 8, 15	Air	10	
TP028: DS200 Screen Middle Left-Center	✓		±2, 4, 8, 15	Air	10	
TP029: DS200 Screen Middle Right-Center	✓		±2, 4, 8, 15	Air	10	
TP030: DS200 Screen Middle Right Side	✓		±2, 4, 8, 15	Air	10	
TP031: DS200 Screen Lower Right Corner	✓		±2, 4, 8, 15	Air	10	
TP032: DS200 Screen Lower Middle Right	✓		±2, 4, 8, 15	Air	10	
TP033: DS200 Screen Lower Left Corner	✓		±2, 4, 8, 15	Air	10	
TP034: DS200 USB Door Rear	✓		±2, 4, 8, 15	Air	10	
TP035: DS200 Screen Frame Left-face	✓		±2, 4, 8, 15	Air	10	
TP036: DS200 Modem Door Rear	✓		±2, 4, 8, 15	Air	10	
TP037: DS200 Rear Cover Front Corner	✓		±2, 4, 8, 15	Air	10	
TP038: DS200 Rear Cover Right Front	✓		±2, 4, 8, 15	Air	10	
TP039: DS200 Rear Cover Back	✓		±2, 4, 8, 15	Air	10	

Notice of Anomaly: CD

Witness:
WH-1472, Rev. Dec. 2004

Tested By: _____ Date: 08/23/2013
Technician
Approved: _____ Date: 08/29/2013
Project Engineer

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. D 5 of 20
Test Report No. T71013.01-01

ELECTRICAL POWER DISTURBANCE TEST DATA

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-6 of 20
Test Report No. T71013.01-01

California Instruments Corp.
Data entry mode: Absolute

No.	Type	Time (s)	Volt
1	V Step	60.000	120.0
2	V Step	0.020	84.0
3	V Step	60.000	120.0
4	V Step	0.100	48.0
5	V Step	60.000	120.0
6	V Step	1.000	48.0
7	V Step	60.000	120.0
8	V Step	5.000	6.0
9	V Step	60.000	120.0
10	V Step	1.000	102.0
11	V Step	60.000	120.0
12	V Step	1.000	138.0
13	V Step	60.000	120.0
14	V Step	14400.000	129.0
15	V Step	60.000	120.0
16	V Step	14400.000	105.0
17	V Step	60.000	120.0
18	Empty		

Transient List: <NEW>
Printed on: Friday, July 26, 2013 9:50:02 AM

Page #1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-7 of 20
Test Report No. T71013.01-01
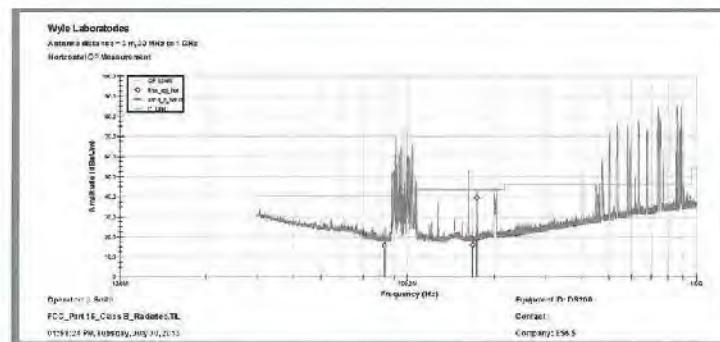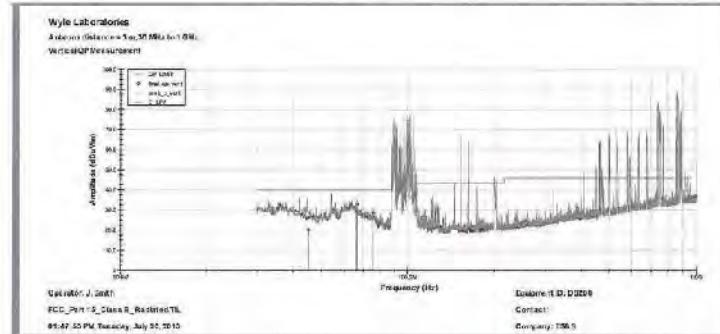
ELECTROMAGNETIC EMISSIONS: RADIATED EMISSIONS TEST DATA

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-8 of 20
Test Report No. T71013.01-01

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D 9 of 20
Test Report No. T71013.01-01

ELECTROMAGNETIC EMISSIONS: CONDUCTED EMISSIONS TEST DATA

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-10 of 20
Test Report No. T71013.01-01

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D 11 of 20
Test Report No. T71013.01-01

ELECTROMAGNETIC SUSCEPTIBILITY TEST DATA

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-12 of 20
Test Report No. T71013.01-01

wyle
laboratories

DATA SHEET

Job No.:	T71013.01
Start Date:	23 Aug 13

Customer:	LS&S	Temperature:	21.7° C	Humidity:	49.9%
EUT:	DS200	Measurement Point:	EUT @ All Four Sides		
Model No.:	DS200	Interference Signal:	1Khz @ 80% AM		
Serial No.:	DS031235000#	Frequency Range:	80Mhz to 1Ghz		

Test Title _____ EN 61000-4-3 (Electromagnetic Susceptibility)

Test Frequency ( )kHz (X)MHz ( )GHz	Meets Limit Yes	Meets Limit No	Susceptibility Threshold Level ( )A ( )V ( )kV (X)V/m ( )Vrms ( )dBµA ( )dBµV ( )dBµV/m ( )dBµT	Maximum Signal Applied	Comments
80	X		>10	10	Vertical and Horizontal
↓	↓		↓	↓	↓
1,000	X		>10	10	Vertical and Horizontal

Notice of Anomaly: _____

Witness: _____

Tested By: _____ Date: 8/23/13
Technician

Approved: _____ Date: 08/28/2013
Project Engineer

Page ____ of ____

WYL-1632, Rev. Dec 2008

Page No. D 13 of 20
Test Report No. T71013.01-01

ELECTRICAL FAST TRANSIENT TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-14 of 20
Test Report No. T71013.01-01

wyle
laboratories

DATA SHEET

Job No.:	T71013.01
Start Date:	24 Jul 13

Customer:	ES&S	Temperature:	21.7° C	Humidity:	50.1%
EUT:	DS200	Measurement Point:	See Comments Below		
Model No.:	DS200	Interference Signal:	Test Signal Applied @ 5/50nS		
Serial No.:	DS0313350009	Frequency Range:	See Test Frequencies Below		

Test Title ___ EN 61000-4-4 (Electrical Fast Transient)

Test Frequency	Meets Limit		Susceptibility Threshold Level	Maximum Signal Applied	Comments
(X)kHz ()MHz ()GHz	Yes	No	()A ()V (X)kV ()W/m ()Vrms ()dBµA ()dBµV ()dBµV/m ()dBpT		
.060	X		>1	1	Line to Neutral
.060	↓		↩	↓	Line to Ground
.060	X		>1	1	Neutral to Ground

Notice of Anomaly: _____

Witness: _____

Tested By: _____ Date: 7/24/13
Technician

Approved: _____ Date: 07/24/2013
Project Engineer

Page ___ of ___

WYL 1424, Rev. Dec. 2004

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 100 of 126
Certification Test Plan T71379.01

Page No. D 15 of 20
Test Report No. T71013.01-01

LIGHTNING SURGE TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 101 of 126
Certification Test Plan T71379.01

Page No. D-16 of 20
Test Report No. T71013.01-01

wyle
laboratories

DATA SHEET

Job No.:	T71013.01
Start Date:	22 Jul 13

Customer:	ES&S	Temperature:	21.9°C	Humidity: 53.6%
EUT:	DS200	Measurement Point:	See Comments Below	
Model No.:	DS200	Interference Signal:	Test Signal Applied @ 1.2/50uS	
Serial No.:	DS0J13350009	Frequency Range:	See Test Frequencies Below	

Test Title: EN 61000-4-5 (Lightning Surge Test)

Test Frequency (X)kHz ()MHz ()GHz	Meets Limit Yes	Meets Limit No	Susceptibility Threshold Level ()A ()V (X)kV ()V/m ()Vrms ()dBuA ()dBμV ()dBμV/m ()dBpT	Maximum Signal Applied	Comments
.060	X		>.5	.5	Line to Neutral @ 0°, 90°, 180°, and 270°
.060	↓		↓	↓	Line to Ground @ 0°, 90°, 180°, and 270°
.060	X		>.5	.5	Neutral to Ground @ 0°, 90°, 180°, and 270°
.060	X		>1	1	Line to Neutral @ 0°, 90°, 180°, and 270°
.060	↓		↔	↓	Line to Ground @ 0°, 90°, 180°, and 270°
.060	X		>1	1	Neutral to Ground @ 0°, 90°, 180°, and 270°
.060	X		>2	2	Line to Neutral @ 0°, 90°, 180°, and 270°
.060	↔		↓	↓	Line to Ground @ 0°, 90°, 180°, and 270°
.060	X		>2	2	Neutral to Ground @ 0°, 90°, 180°, and 270°

Notice of Anomaly: _NOA: 1 & 7_

Witness: _Ryan Alley_ 07/22/2013

Tested By: _____ Date: 07/22/13
Technician

Approved: _Ryan Alley_ Date: 07/22/2013
Project Engineer

Page _1_ of _1_

WH 1432, Rev. Dec. 2008

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 102 of 126
Certification Test Plan T71379.01

Page No. D 17 of 20
Test Report No. T71013.01-01

CONDUCTED RF IMMUNITY TEST DATA

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 103 of 126
Certification Test Plan T71379.01

Page No. D-18 of 20
Test Report No. T71013.01-01

wyle
laboratories

DATA SHEET

Job No.: T71013.01
Start Date: 29 Jul 13

Customer:	ES&S	Temperature:	22.4°C Humidity: 44.5%
EUT:	DS200	Measurement Point:	See Comments Below
Model No.:	DS200	Interference Signal:	1Khz @ 80% AM
Serial No.:	DS031338000)	Frequency Range:	150Khz to 80Mhz

Test Title: EN 61000-4-6 (Conducted RF Immunity)

Test Frequency ( )kHz (X)MHz ( )GHz	Meets Limit		Susceptibility Threshold Level ( )A (X)V ( )kV ( )V/m ( )Vrms ( )dBµA ( )dBµV ( )dBµV/m ( )dBgT	Maximum Signal Applied	Comments
	Yes	No			
.150	X		>10	10	AC Input
↓	↓		↓	↓	↓
80	X		>10	10	AC Input

Notice of Anomaly: Ø

Witness: N/A

Tested By: _____ Date: 07/29/13
                                Technician
Approved: _____ Date: 07/29/2013
                                Project Engineer

Page 1 of 1

WH-1412, Rev. Dec 2004

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 104 of 126
Certification Test Plan T71379.01

Page No. D 19 of 20
Test Report No. T71013.01-01

MAGNETIC FIELDS IMMUNITY TEST DATA

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-20 of 20
Test Report No. T71013.01-01

wyle
laboratories

DATA SHEET

Job No.:	T71013.01	
Start Date:	29 Jul 13	

Customer:	ES&S	Temperature:	22.1° C Humidity: 49.9%
RUT:	DS200	Measurement Point:	See Comments Below
Model No.:	DS200	Interference Signal:	CW for a Period of 5 Minutes
Serial No.:	DS0313350004	Frequency Range:	See Test Frequencies Below

Test Title: EN 61000-4-8 (Magnetic Field Immunity)

Test Frequency	Meets Limit		Susceptibility Threshold Level	Maximum Signal Applied	Comments
(X)kHz ( )MHz ( )GHz	Yes	No	(X)A ( )V ( )kV ( )V/m ( )Vrms ( )dBµA ( )dBµV ( )dBµV/m ( )dBpT		
.060	X		>30 A/m	30 A/m	EUT on X, Y, and Z Axis

Notice of Anomaly: ∅

Witness: N/A

Tested By: _____ Date: 07/29/13
Technician

Approved: _____ Date: 07/29/2013
Project Engineer

Page _____ of _____

WEL-1437, Rev. Dec. 2009

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix E, Page No. 106 of 126
Certification Test Plan T71379.01

Page No. E-1 of 5
Test Report No. T71013.01-01

ATTACHMENT E

OPERATING ENVIRONMENTAL TEST DATA

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 107 of 126
Certification Test Plan T71379.01
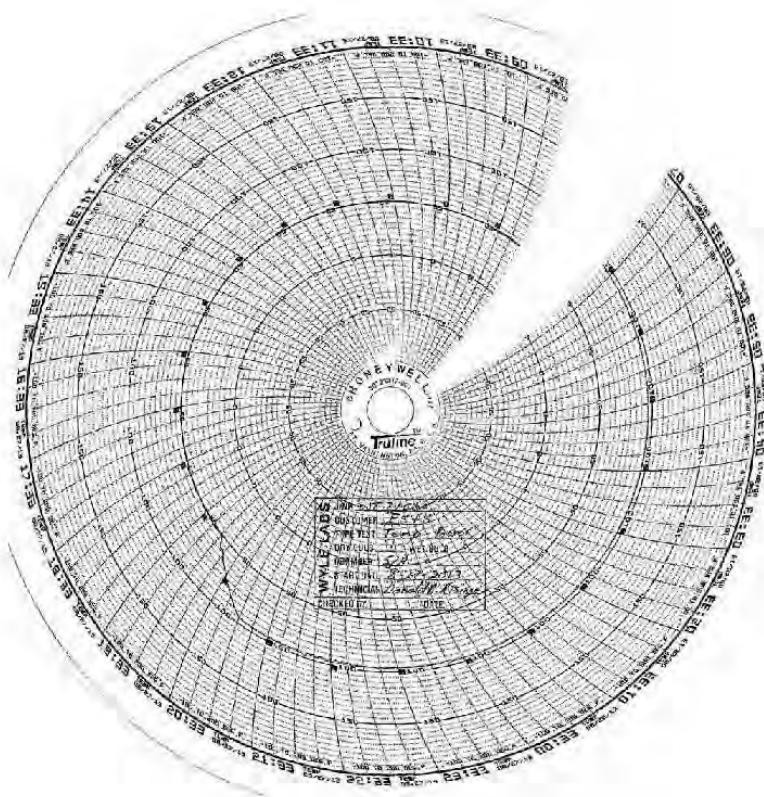
Page No. E 2 of 5
Test Report No. T71013.01-01

TEMPERATURE/POWER VARIATION TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. E-3 of 5
Test Report No. T71013.01-01
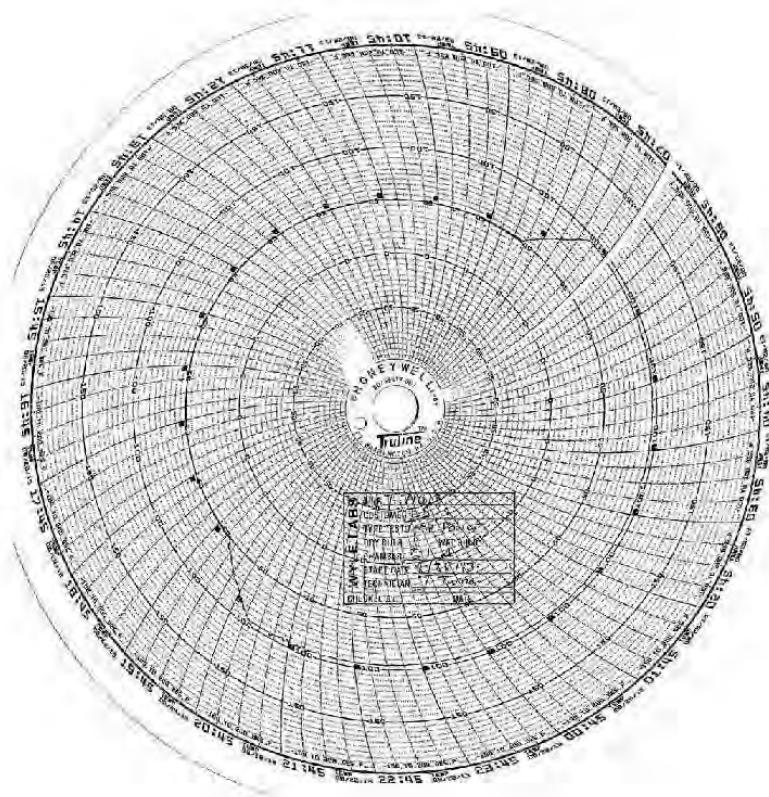
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. E-4 of 5
Test Report No. T71013.01-01
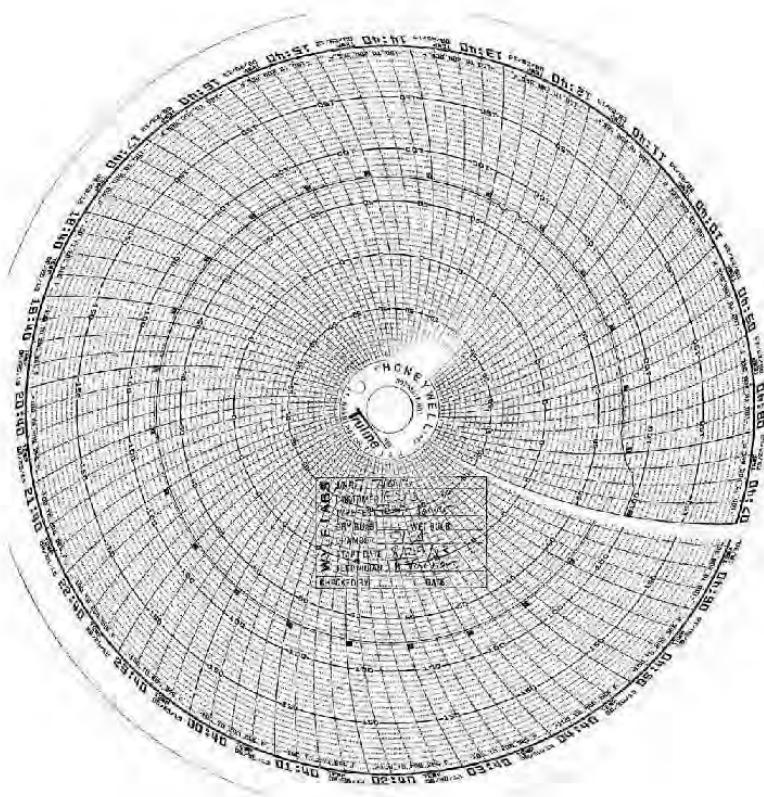
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. E-5 of 5
Test Report No. T71013.01-01

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 111 of 126
Certification Test Plan T71379.01

Page No. F 1 of 3
Test Report No. T71013.01-01

ATTACHMENT F

PRODUCT SAFETY CERTIFICATE OF CONFORMANCE

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. F-2 of 3
Test Report No. T71013.01-01

wyle
laboratories

7800 Highway 20 West
Huntsville, Alabama 35800
Phone (256) 837-4411
Fax (256) 721-0144
www.wylelabs.com

CERTIFICATE OF CONFORMANCE

Product Safety Review

Wyle Project No.	T71013-05
Customer PO	ES&S-MSA-TA029
Issue Date	17 September 2013

The device exhibited below has been reviewed in accordance with the particular requirements of applicable sections of UL60950-1, Standard for Safety for Information Technology Equipment, Second Edition, and the Recommended Practice for Unlabeled Electrical Equipment Evaluation, First Edition, (developed by the American Council for Electrical Safety), and has been found to be in compliance.

Product Identification	
Device Description	Voting Scanner/Tabulator
Manufacturer	Election Systems & Software
Device Model No.	DS200
Device Serial No.	DS0313350009
Electrical Ratings	Input 24 VDC – 2A - 80W Max.
Hardware Revision	1.3
Power Supply	
Power Supply Description	ITE Power Supply
Manufacturer	Power-Win Technology Corporation
Model No.	PW080A2-1Y24AP
Input	100-240 VAC – 2A
Output	24 VDC – 3.34A (80W max)
UL Listed ITE PS	UL File No. E156513

This report is valid for the equipment model and serial indicated in the product identification table above. Wyle makes no endorsement of the equipment reviewed, nor does this evaluation constitute approval of similar equipment. This evaluation does not constitute an product listing.

Brian Coppock NCT, Product Safety Supervisor   Robert D. Hardy, Department Manager
INARTE Certified Product Safety Technician No. PS-60438-NCT   EMI/EMC/FCC, Product Safety, Election Systems, & Packaging

Cert. No. 845.01

COPYRIGHT BY WYLE LABORATORIES. THE RIGHT TO REPRODUCE, COPY, EXHIBIT OR OTHERWISE UTILIZE ANY OF THE MATERIAL CONTAINED HEREIN WITHOUT THE EXPRESS PRIOR PERMISSION OF WYLE LABORATORIES IS PROHIBITED. THE ACCEPTANCE OF A PURCHASE ORDER IN CONNECTION WITH THE MATERIAL CONTAINED HEREIN SHALL BE EQUIVALENT TO EXPRESS PRIOR PERMISSION. WYLE SHALL HAVE NO LIABILITY FOR DAMAGES OF ANY KIND TO PERSON OR PROPERTY, INCLUDING SPECIAL OR CONSEQUENTIAL DAMAGES, RESULTING FROM WYLE'S PROVIDING THE SERVICES COVERED BY THIS REPORT.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. G-1 of 14
Test Report No. T71013.01-01

ATTACHMENT G

INSTRUMENTATION EQUIPMENT SHEETS

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. G-2 of 14
Test Report No. T71013.01-01

wyle laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 7/31/2013   JOB NUMBER: T71013   TYPE OF TEST: VVSG 4.1.2.1; CRFI

TECHNICIAN: R.CHAMBERS   CUSTOMER: ES&S   TEST AREA: EMI CHAMBER J

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	AMPLIFIER	AR	2500A225	0342801	03485	MFG	NCR	7/24/2013	7/26/2020
2	ATTEN	BIRD	25-T-MN	0129	03142	50 OHMS 25 W.	MFG	6/24/2013	6/24/2014
3	ATTENUATOR	NARDA	759-6	03180	04860	DC to 6GHz	MFG	3/25/2013	3/25/2014
4	DATALOGGER	EXTECH	42280	G051839	04026	-4°F to 144°F/0-	±1°F / 13%RH	5/14/2013	5/14/2014
5	DIR COUPLER	AMP RESEARCH	DC3010	304002	11250X	.01-1000MHz	±0.8dB	5/15/2013	5/15/2014
6	DMM	FLUKE	87V	18290046	01474	6VDC	±0.1%+1	12/6/2012	12/5/2013
7	PASS IMP ADAPT	FISHER CC	FCC-801-150-50-CDN	9784	11035X	150KHz-230MH	MFG	6/24/2013	6/24/2014
8	PASSIVE	FISHER CC	FCC-801-150-50-CDN	04009/04050	11040X	150KHZ - 230M	MFG	7/20/2012	7/20/2014
9	SIG GEN	MARCONI	2023	112224/092	L12224	9kHz-1.2GHz	±0.8dB	2/11/2013	2/11/2014
10	SPEC ANAL	AGILENT	E4446A/H70	US44020335	03123	MFG	MFG	5/10/2013	5/10/2014
11	SPEC ANAL	HP	E6446a	US44020311	01447	44GHz	MFG	8/6/2012	8/6/2013
12	TAPE MEASURE	LUFKIN	HV1048CME	NSN	02705	8meter	±1mm	4/24/2012	4/24/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 7/31/13   CHECKED & RECEIVED BY: _____ 07/31/2013

WTI-1029A,REV.APR 09   7/31/13   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-3 of 14
Test Report No. T71013.01-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| | DATE: | 7/30/2013 | JOB NUMBER: | T71013 | | TYPE OF TEST | VVSG 4.1.2.8 ESD |
| TECHNICIAN: | J.GALBONE | CUSTOMER: | ES&S | | TEST AREA: | ESD TEST LAB |

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	DISCHARGE	EMC-PARTNER	ESD3000DMF	849	03229	150pF	MFG	7/30/2012	7/30/2014
2	DMM	FLUKE	87V	82500l6	01474	4VDC	±0.1%+1	12/6/2012	12/6/2013
3	ESD GUN	EMC-PARTNER	ESD3000	859	04446	16.5 KV	±10%	10/1/2012	10/1/2013
4	ESD TARGET	HAEFELY TRENCH	2620311	187461	110794	15KV	±5%	12/6/2011	12/6/2013
5	OSCILLOSCOPE	TEKTRONIX	DPO5104	C012091	01737	MFG	MFG	10/23/2012	10/23/2013
6	TAPE MEASURER	LUFKIN	10V104RCME	NSN	02708	8meters	±1mm	4/24/2012	4/24/2014
7	TEMP/HUM/BAR	EXTECH	SD700	Q590477	21539	MULTI	MFG	2/27/2013	2/27/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 7/30/13 Q.A.   CHECKED & RECEIVED BY: _____ 07/30/2013 _____ 7/30/13

WH-1029A,REV,APR'99   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-4 of 14
Test Report No. T71013.01-01

wyle laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE:	7/24/2013	JOB NUMBER:	T71013		TYPE OF TEST	VVSG SECTION 4.1.2.6		
TECHNICIAN:	R.CHAMBERS	CUSTOMER:	ES&S		TEST AREA:	EMI LAB - CHAMBER 3		

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	ATTEN	HAEFELY TRENCH	2520111/00	153823 153801	04590	MFG	MFG	3/14/2012	3/14/2014
2	DMM	FLUKE	87 V	18290046	01474	4VDC	±0.1%+1	12/6/2012	12/6/2013
3	EFT JUNIOR TSTR	HAEFELY TRENCH	093204.1	83762-14	12575	5NS/50NS	30%	12/28/2012	12/28/2014
4	OSCILLOSCOPE	TEKTRONIX	DPO7104	C012051	01737	MFG	MFG	10/23/2012	10/23/2013
5	TAPE MEASURER	LUFKIN	HV1048CME	NSN	02703	8meters	±1mm	4/24/2012	4/24/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology

INSTRUMENTATION: _(signature)_ 9/24/13   CHECKED & RECEIVED BY: _(signature)_ 07/24/2013

WH-1029A,REV.APR99   Q.A.: _(signature)_ 7/24/13   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-5 of 14
Test Report No. T71013.01-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| DATE: | 7/30/2013 | JOB NUMBER: T71013 | | TYPE OF TEST | FCC PART 15 |
| TECHNICIAN: | J.SMITH | CUSTOMER: | RS&S | TEST AREA: | OATS 2 |

No.	Description	Manufacture	Model	Serial #	WYLE#	RANGE	ACCURACY	Cal Date	Cal Due
1	ATTENUATOR	NARDA	766-20	740582	01444	DC-4 GHz	MFG	3/25/2012	3/25/2014
2	DMM	FLUKE	87	64440452	112518	MULTI	+0.1%+1	5/14/2013	6/14/2014
3	EMI TEST RCVR	ROHDE SCHWARZ	ESCI	100388	117803	MULTI	MFG	4/1/2013	4/1/2014
4	LISN	SOLAR	21107-50-TS-50-N	1125366	91686	MFG	MFG	8/7/2012	8/7/2014
5	LISN	SOLAR	21107-50-TS-50-N	1125367	91687	MFG	MFG	8/7/2012	8/7/2014
6	TAPE MEASURER	LUFKIN	EL158D	116893	116893	15meter	±1mm	7/12/2011	7/12/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 7/30/2013   CHECKED & RECEIVED BY: _____ 7/30/13

WH-1029A, REV. APR'99   Q.A.: _____ 7/30/13

Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-6 of 14
Test Report No. T71013.01-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 7/29/2013 JOB NUMBER: T71013 TYPE OF TEST: VVSG 4.1.2.12 MFI

TECHNICIAN: J.GALBONE CUSTOMER: ES&S TEST AREA: CHAMBER 3

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	AMPLIFIER	TECHRON	7560	015075	04556	600W	NCR	7/8/2003	7/8/2030
2	DMM	FLUKE	87V	18290046	01474	4VDC	±0.1%+1	12/6/2012	12/6/2013
3	METER	HOLADAY	HOL-TB3604	76286	11750?	30-3KHz	MFG	5/24/2012	2/24/2014
4	STOP WATCH	HARHART	XTRATEST	110131	110131	10HR	3 sec/day	6/24/2013	6/24/2014
5	TAPE MEASURE	LUFKIN	HV1048CME	MSM	C2705	3meters	±1mm	4/2/2012	9/24/2014
6	WAVE GEN	AGILENT	33250A	SG40007026	C14181	MULTI	CERT	12/18/2012	12/28/2013

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 7/29/13 CHECKED & RECEIVED BY: _____ 07/24/2013

WH-1029A,REV.APR'99 Q.A. Brenda Mark Tholio Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-7 of 14
Test Report No. T71013.01-01
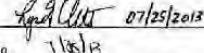
wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 7/25/2013 JOB NUMBER: T71013 TYPE OF TEST: VVSG SEC.4.1 2.5 RFID

TECHNICIAN: R.CHAMBERS CUSTOMER: ES&S TEST AREA: EMI LAB - CHAMBER 5

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	DATALOGGER	EMTECH	4228C	90S1859	04926	-4°F to 144°F/0-	±1°F / ±3%RH	5/14/2013	5/14/2014
2	DMM	FLUKE	87V	18290045	01474	4VDC	±0.1%+1	12/6/2012	12/6/2013
3	POWER SOURCE	CALIFORNIA INST	1251RP/IF	U6361	117347	0-270VAC RMS	1%	2/20/2013	2/20/2014
4	TAPE MEASURER	LUFKIN	HV1048CME	N8N	02708	8meters	±1mm	4/24/2012	4/24/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _[signature]_ 7/25/13 CHECKED & RECEIVED BY: _[signature]_ 07/25/2013

WH-1029A.REV.APR.99 Ronda Moore 7/8/B Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. G-8 of 14
Test Report No. T71013.01-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| | DATE: | 8/19/2013 | JOB NUMBER: | T71013 | | | TYPE OF TEST | WYSG4.12.10 LST W7011 |
| | TECHNICIAN: | R.CHAMBERS | CUSTOMER: | ES&S | | | TEST AREA: | EMI CHAMBER #3 |

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	AMPLIFIER	AMP RESEARCH	500W1000A	25561	03141	80MHz to 1GHz	NCR	8/22/2012	8/22/2013
2	DATALOGGER	EXTECH	42280	915/959	04925	-4° to 144°F/0	-1.8°F +86RH	5/14/2013	5/14/2014
3	DIR COUPLER	AMP RESEARCH	DC3100	374022	117238	0-1000MHz	0.5dB	5/15/2013	5/15/2014
4	ISOTROPIC PROBE	AMP RESEARCH	FT2090	1765Y	LU603	10 KHz - 1 GHz	2.0 dB	11/06/2012	11/06/2013
5	SIG GEN	AEROFLEX	3025A	202306058	B20230	9KHz 2.2GHz	APG	11/23/2012	11/23/2013
6	SPECT ANAL	AGILENT	1544-5A	1341170108	110948	44 GHz	CERT	7/8/2013	7/8/2014
7	TAPE MEASURER	LUFKIN	HV1048CME	NSN	03705	8meters	1mm	4/24/2013	4/24/2014

This is to certify that the above instruments were calibrated using state of the art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION _____ 8/19/13

CHECKED & RECEIVED BY: _____ 08/19/2013

WH-1029A REV APR99 _____ 8/19/2013

Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-9 of 14
Test Report No. T71013.01-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE:	7/22/2013	JOB NUMBER:	T71013		TYPE OF TEST:	VVSG SECTION 4.1.2.7		
TECHNICIAN:	J.GALEONE	CUSTOMER:	ES&S		TEST AREA:	EMI LAB - CHAMBER 3		

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	COUPL NETWK	HAEFELY TRENCI	PCD150	149869	R90540	MFG	MFG	7/10/2013	7/10/2015
2	DATALOGGER	EXTECH	42280	9051859	64926	-4°F to 144°F/0-	1°F / 4596RH	3/14/2013	3/14/2014
3	IMPULSE MODULE	HAEFELY TRENCI	PIM100	1103	R90538	6kv	MFG	7/10/2013	7/10/2015
4	OSCILLOSCOPE	TEKTRONIX	DPO5104	C012001	61757	MFG	MFG	10/23/2012	10/23/2013
5	STOP WATCH	HANHART	STRATOS1	110131	110131	10HR	3 sec/day	6/24/2013	6/24/2014
6	SURGE TSTR	HAEFELY TRENCI	PSURGE6000	150270	R90537	MULTI	MFG	7/10/2013	7/10/2015

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is
traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 7/22/13 CHECKED & RECEIVED BY: _____ 7/22/13

WH-1029A.REV.APR'99   QA: Brenda Moore 7/22/13   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-10 of 14
Test Report No. T71013.01-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE:	8/23/2013		JOB NUMBER:	T71013		TYPE OF TEST	VIBRATION	
TECHNICIAN:	D. MEDLEY		CUSTOMER:	ES&S VOTING SYSTEMS		TEST AREA:	DYNAMICS	

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	ACCELEROMETER	ENDEVCO	7704A-50	13073	02600	50 pC/g / 20-5k1	±5%	8/14/2013	2/14/2014
2	ACCELEROMETER	ENDEVCO	7704A-50	12615	04867	50pC/g	±5%	8/14/2013	2/14/2014
3	CHARGE	ENDEVCO	2775A	EE24	112652	GAIN	1.5%	8/20/2013	2/18/2014
4	CHARGE	ENDEVCO	2775A	ED75	112653	GAIN	1.5%	8/20/2013	2/18/2014
5	DMM	FLUKE	45	5095173	104297	MULTI	CERT	6/25/2013	6/25/2014
6	DYN SIG	DATA PHYSICS CO	70499	1000404S	02760	MULTI	MFG	9/12/2012	9/12/2013

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _signature_ 8/16/13   CHECKED & RECEIVED BY: _signature_ 8/23/13

Q.A.: Bonda Mass 8/23/13

WH-1029A REV APR 99   Page 1 of 1

Appendix E, Page No. 123 of 126
Certification Test Plan T71379.01

Page No. C-11 of 14
Test Report No. T71013.01-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 8/19/2013 JOB NUMBER: T71013 TYPE OF TEST: TEMP

TECHNICIAN: T TURNER CUSTOMER: ES&S TEST AREA: CHAMBER 16

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	CHART RECORDER	HONEYWELL	DR45AT-1111	0549Y568906	110980	32 TO 131°F	0.5% FS	8/8/2013	8/8/2014
2	TEMP ALARM	THERMOTRON	THERM-ALARM	non	03379	TYPE T	±1°C	8/8/2013	8/8/2014
3	TEMP	THERMOTRON	4800	non	03378	-123-375°F	.25%	8/8/2013	8/8/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _Terance Turner_ 8/19/13 CHECKED & RECEIVED BY: _____ 08/19/2013

Q.A: _____ 8/19/2013

WH-1029A REV APR'99 Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-12 of 14
Test Report No. T71013.01-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| DATE | 8/21/2013 | JOB NUMBER: | T71013.01 | | TYPE OF TEST | COLD TEMP |
| TECHNICIAN: | T.J.PARCUS | CUSTOMER: | ES&S | | TEST AREA: | CHAMBER#16 |

No	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	CHART RECORDER	HONEYWELL	DR45AT-1111	0549Y55B906I	110980	32 TO 131°F	0.5% FS	8/8/2013	8/8/2014
2	TEMP ALARM	THERMOTRON	THERM-ALARM	030	03379	TYPE T	±1°C	8/8/2013	8/8/2014
3	TEMP	THERMOTRON	4800	030	03378	-128.32°F	25%	8/8/2013	8/8/2014

This is to certify that the above instruments were calibrated using state of the art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 8/21/2013   CHECKED & RECEIVED BY: _____ 8/2/15

WH-1029A,REV,APR'99   Q.A.: _____ 8/21/2013   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-13 of 14
Test Report No. T71013.01-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 8/7/2013 JOB NUMBER: T71013 TYPE OF TEST: TEMP-HUM
TECHNICIAN: T.J.PARCUS CUSTOMER: ES&S TEST AREA: CHAMBER#2

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	HUMIDITY/TEMP	VAISALA	HMT315	K1410005	E1610	MULTI	MFG	3/6/2013	9/4/2013
2	TEMP	THERMOTRON	SE12005	28117	104758	-70-180°C	0.3°C	3/13/2013	3/13/2014
3	TEMP RECORDER	HONEYWELL	DR45009A	0629Y8369820	114837	-184-871°C	35°C	3/13/2013	3/13/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

8-7-2013

INSTRUMENTATION: CHECKED & RECEIVED BY: 8/7/2013

WH-1029A REV APR 99   Q.A.   8/7/13   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-14 of 14
Test Report No. T71013.01-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| | DATE: | 8/26/2013 | JOB NUMBER: | T71013 | | TYPE OF TEST: | TEMP POWER |
| | TECHNICIAN: | LARRY IVEY | CUSTOMER: | ES&S | | TEST AREA: | ENV CHAMBER 51A |

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	POWER SOURCE	CALIFORNIA INST	I251RMP	L06361	117347	0-279VAC RMS	1%	2/20/2013	2/20/2014
2	TEMP	MICRISTAR	828-B11	10035	108416	-45/700°F	1%FS	12/5/2012	12/5/2013
3	TEMP IND	NEWPORT	Q2021TC	N/A	116533	TYPE T	±1.5%	12/5/2012	12/5/2013
4	TEMP RECORDER	HONEYWELL	DR430T	02448305000	109830	-200-600°F	.4°F	12/5/2012	12/5/2013

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _Langohney 8/26/13_   CHECKED & RECEIVED BY: _Michael L Walker 8/26/13_

WII-1009A,RCV,AFR'99   Q.A: _____ 8/26/13

Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F

FL EVS 4.5.0.0 ExpressVote Test Report

wyle laboratories

Wyle Laboratories, Inc.
7800 Highway 20 West
Huntsville, Alabama 35806
Phone (256) 837-4411 • Fax (256) 721-0144
www.wyle.com

REPORT NO.: T71013.02-01

WYLE JOB NO.: T71013.02

CLIENT P.O. NO.: EX&S-MSA-TA029

CONTRACT: N/A

TOTAL PAGES (INCLUDING COVER): 128

TEST REPORT

DATE: November 18, 2013

HARDWARE COMPLIANCE TESTING
OF THE
ELECTION SYSTEMS & SOFTWARE
FL EVS 4.5.0.0 VOTING SYSTEM
EXPRESSVOTE HARDWARE VERSION 1.0

for

Election Systems & Software, LLC
11208 John Galt Boulevard
Omaha, NE 68137

STATE OF ALABAMA
COUNTY OF MADISON

Robert Bridges, Director being duly sworn, deposes and says: The information contained in this report is the result of complete and carefully conducted testing and is to the best of his knowledge true and correct in all respects.

SUBSCRIBED and sworn to before me this 19 day of Nov 20 13

SEAL Sandra A. Daniel
Notary Public in and for the State of Alabama at Large

My Commission expires June 2, 2015

Wyle shall have no liability for damages of any kind to person or property, including special or consequential damages, resulting from Wyle's providing the services covered by this report.

PREPARED BY: _Ryan D. Chambers_ 11-19-2013
Ryan D. Chambers, Project Engineer   Date

APPROVED BY: _Frank Padilla_ 11-19-13
Frank Padilla, Voting Systems Manager   Date

WYLE Q.A.: _Rick Davis_ 11-19-13
Rick Davis, Q.A. Manager   Date

NVLAP
NVLAP LAB CODE 200777-0

VSTL
EAC Lab Code 0704

National Technical Systems
Huntsville Facility

Page No. i of i
Test Report No. T71013.02-01

		Revisions	REVISION	Original Release
			REPORT NO.	T71013.02-01
wyle laboratories			DATE	November 18, 2013

REV	DATE	PAGE OR PARAGRAPH AFFECTED	DESCRIPTION OF CHANGES
—	11-18-13	Entire Document	Original Release

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. TOC 1 of 2
Test Report No. T71013.02-01

TABLE OF CONTENTS

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. TOC 2 of 2
Test Report No. T71013.02-01

TABLE OF CONTENTS (Continued)

Page No.

ATTACHMENTS

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 1 of 28
Test Report No. T71013.02-01

1.0 INTRODUCTION

1.1 Scope

This report documents the test procedures followed and the results obtained from the Environmental and Electrical Testing performed on the Florida Election Voting System (FL EVS) 4.5.0.0 ExpressVote Hardware Revision 1.0 for Election Systems & Software (ES&S). Upon receipt by Wyle Laboratories, the systems were inspected and subjected to a Physical Configuration Audit (PCA). All testing was performed at Wyle Laboratories' Huntsville, Alabama, Test Facility.

1.2 Objective

The ES&S FL EVS 4.5.0.0 Voting System was tested in reference to the United States Federal Election Commission (FEC) 2002 Voting System Standards (VSS) and all applicable EAC 2005 Voluntary Voting Systems Guidelines (VVSG).

1.3 Test Report Overview

This test report consists of four main sections and attachments:

- 1.0 Introduction – Provides the architecture of the National Certification Test Report (hereafter referred to as Test Report); a brief overview of the testing scope of the Test Report; a list of documentation, customer information, and references applicable to the voting system hardware, software, and this test report.

- 2.0 System Identification and Overview – Provides information about the equipment tested.

- 3.0 Test Background – Contains information about the certification test process and a list of terms and nomenclature pertinent to the Test Report and system tested.

- 4.0 Test Findings and Recommendations – Provides a summary of the results of the testing process.

- Attachments – Information supporting reviews and testing of the voting system are included as attachments to this report.

1.4 Customer

Election Systems & Software, LLC
11208 John Galt Boulevard
Omaha, NE 68137

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 2 of 28
Test Report No. T71013.02-01

1.0   INTRODUCTION (Continued)

1.5   References

The documents listed were utilized to perform certification testing.

- Election Assistance Commission 2005 Voluntary Voting System Guidelines, Volume I, Version 1.0, "Voting System Performance Guidelines," and Volume II, Version 1.0, "National Certification Testing Guidelines," dated December 2005

- United States Federal Election Commission Voting System Standards Volume I, "Performance Standards" and Volume II, "Test Standards," dated April 2002

- Election Assistance Commission Testing and Certification Program Manual, Version 1.0, effective date January 1, 2007

- Election Assistance Commission Voting System Test Laboratory Program Manual, Version 1.0, effective date July 2008

- Florida Voting System Standards, Form DS-DE 101, 1-12-05

- National Voluntary Laboratory Accreditation Program NIST Handbook 150, 2006 Edition, "NVLAP Procedures and General Requirements (NIST Handbook 150)," dated February 2006

- National Voluntary Laboratory Accreditation Program NIST Handbook 150-22, 2008 Edition, "Voting System Testing (NIST Handbook 150-22)," dated May 2008

- United States 107th Congress Help America Vote Act (HAVA) of 2002 (Public Law 107-252), dated October 2002

- Wyle Laboratories' Test Guidelines Documents: EMI-001A, "Wyle Laboratories' Test Guidelines for Performing Electromagnetic Interference (EMI) Testing," and EMI-002A, "Test Procedure for Testing and Documentation of Radiated and Conducted Emissions Performed on Commercial Products"

- Wyle Laboratories' Quality Assurance Program Manual, Revision 5

- ANSI/NCSL Z540-1, "Calibration Laboratories and Measuring and Test Equipment, General Requirements"

- ISO 10012-1, "Quality Assurance Requirements for Measuring Equipment"

- EAC Requests for Interpretation (listed on www.eac.gov)

- EAC Notices of Clarification (listed on www.eac.gov)

- MIL-STD-810D, "Environmental Test Methods and Engineering Guidelines," 19 July 1983.

- MIL-STD-498, "Software Development and Documentation Standard," 27 May 1998

- (PCA/FCA) MIL-STD-1521, "

- MIL-STD-882, "Systems Safety Program Requirements".

- MIL-STD-973, "Configuration Management, 30 September 2000.

- MIL-HDBK-454, "Standard General Requirements for Electronics Equipment"

(The remainder of this page intentionally left blank.)

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 3 of 28
Test Report No. T71013.02-01

2.0 SYSTEM IDENTIFICATION AND OVERVIEW

2.1 System Overview

The ES&S FL EVS 4.5.0.0 Voting System is a new system that contains the ExpressVote hardware version 1.0. The ExpressVote is a voter interface device designed to be used at the polling place. This was a new piece of equipment so a full hardware testing suite was performed at Wyle Laboratories. For the ES&S FL EVS 4.5.0.0 Voting System, Wyle Laboratories subjected the ExpressVote to: non-operating environmental tests, operating environmental tests and Electromagnetic Compatibility (EMC) tests. The ElectionWare EMS was only utilized to generate election media and verify results. Wyle Laboratories only documented the configuration used during testing conducted at Wyle Laboratories.

2.2 System Identification

The materials required for testing of the ES&S FL EVS 4.5.0.0 Voting System included software, hardware, test materials, and deliverable materials shipped directly to Wyle Laboratories by ES&S. The materials documented in the following sections are the materials used during Wyle Laboratories' testing of only the ExpressVote and the interface with an optical scanning device and the EMS.

2.2.1 Hardware

This subsection categorizes the equipment the manufacturer submitted for testing and is listed in Table 2-1. Each test element is included in the list of the equipment required for testing of that element, including system hardware, general purpose data processing and communications equipment and any required test instrumentation.

Table 2-1 ES&S FL EVS 4.5.0.0 Test Equipment

Equipment	Description		Serial Numbers
ExpressVote (Hardware Revision 1.0)	Voter Interface Device		EV0113350029 (EMI)
DS200 (Hardware Revision 1.3)	Precinct Count Digital Scanner		ES0108340567 (Used for Tabulation Only)
Voting card Box	Plastic Voting card Box/Plastic Transport Case		T71013-BB-002
Dell Latitude Laptop	CPU: Intel Core i5-2540M 2.60Ghz RAM: 4.00 GB HDD: 250 GB – ST250LT007-9ZV14C OS: Windows 7 Professional SP1 – 64 Bit		39CMJS1
Transport Media/ Memory Device/ USB Flash Drive	Approved Manufacturer List: Delkin	Approved Capacity List: 512 MB 1 GB 2 GB 4 GB 8GB	Wyle Laboratories-assigned TM-XXX*

*Wyle Laboratories uniquely labels each media device with the information (election, results, test utilized for) loaded on the device.

Page No. 4 of 28
Test Report No. T71013.02-01

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.2   System Identification (Continued)

2.2.2   Software

The software evaluated was limited to ElectionWare, Election Reporting Manager (ERM), and the firmware build for the ExpressVote. Only the changes incorporated since the EVS 5.0.0.0 test campaign were evaluated by Wyle Laboratories. Wyle Laboratories utilized an EMS setup with new versions of ElectionWare and ERM to load election information onto transport media. Wyle Laboratories did not test the EMS for any other functionality.

Table 2-2 Software Required for Testing

Software Identification	Version
ExpressVote Firmware Version	1.2.0.0zv/1.2.0.0zze

2.3   Test Support Materials

This subsection enumerates any and all test materials needed to perform voting system testing. The scope of testing determines the quantity of a specific material required.

The following test materials were required to support the ES&S FL EVS 4.5.0.0 test campaign:

Table 2-3 Test Support Equipment

Test Material	Quantity
14" ExpressVote Voting card Activation Cards	4500
19" ExpressVote Voting card Activation Cards	200

2.4   Vendor Technical Data Package

The Technical Data Package (TDP) contains information about requirements, design, configuration management, quality assurance, and system operations. A sealed version of the TDP was submitted for this campaign due to only Hardware Testing being performed. The table below provides the TDP documents submitted and reviewed for the ES&S FL EVS 4.5.0.0 campaign.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 5 of 28
Test Report No. T71013.02-01

2.0   SYSTEM IDENTIFICATION AND OVERVIEW (Continued)

2.4   Vendor Technical Data Package (Continued)

Table 2-4 ES&S FL EVS 4.5.0.0 Voting System TDP

ES&S FL EVS 4.5.0.0 TDP Documents	Version	Doc No.	Document Code
System Hardware Specification			
System Hardware Specification – ExpressVote	1.0	03-10	ExpressVoteHW_M_SPC_0310_HWSpec
System Test/Verification Specification			
System Operations Procedures – ExpressVote	1.0	N/A	FLEVS4500_SOP00_ExpressVote
System Maintenance Manuals			
System Maintenance Manual – ExpressVote	1.0	N/A	FLEVS4500_SMM_ExpressVote

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 6 of 28
Test Report No. T71013.02-01

3.0 TEST BACKGROUND

Wyle Laboratories is an independent testing laboratory for systems and components under harsh environments, including dynamic and climatic extremes as well as the testing of electronic voting systems. Wyle Laboratories holds the following accreditations:

- ISO-9001:2000
- NVLAP Accredited ISO 17025:2005
- EAC Accredited VSTL, NIST 150,150-22
- A2LA Accredited (Certification No.'s 845.01, 845.02, and 845.03)
- FCC Approved Contractor Test Site (Part 15, 18, 68)

3.1 General Information about the Test Process

All testing performed as part of the test effort was performed at the Wyle Laboratories' Huntsville, AL facility. Conformance testing was limited to the ES&S FL EVS 4.5.0.0 Voting System component previously identified in this report.

All hardware used during testing for this test campaign was configured "As Used" for voting. The ES&S FL EVS 4.5.0.0 EMS suite was loaded on a COTS PC. Each ExpressVote was placed on a voting booth and loaded with the proper firmware. Each voting card output from the ExpressVote was input into the DS200 tabulator, or a DS850 to tabulate the results from the ExpressVote. A single DS200 was placed on a voting card box or a DS850 and loaded with the proper firmware for tabulating purposes only. All media used during testing was loaded from the EMS PC. All hardware used to build the ExpressVote firmware was configured by Wyle Laboratories.

3.2 Wyle Quality Assurance

All work performed on this program was in accordance with Wyle Laboratories' Quality Assurance Program and Wyle Laboratories' Quality Program Manual, which conforms to the applicable portions of International Standard Organization (ISO) Guide 17025.

The Wyle Laboratories, Huntsville Facility, Quality Management System is registered in compliance with the ISO-9001 International Quality Standard. Registration has been completed by Quality Management Institute (QMI), a Division of Canadian Standards Association (CSA).

3.3 Test Equipment and Instrumentation

All instrumentation, measuring, and test equipment used in the performance of this test program was calibrated in accordance with Wyle Laboratories' Quality Assurance Program, which complies with the requirements of ANSI/NCSL 2540-1, ISO 10012-1, and ISO/IEC 17025. Standards used in performing all calibrations are traceable to the National Institute of Standards and Technology (NIST) by report number and date. When no national standards exist, the standards are traceable to international standards, or the basis for calibration is otherwise documented.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 7 of 28
Test Report No. T71013.02-01

3.0   TEST BACKGROUND (Continued)

3.4   Terms and Abbreviations

Table 3-1 in this subsection defines all terms and abbreviations applicable to this Test Report.

Table 3-1 Terms and Abbreviations

Term	Abbreviation	Definition
Americans with Disabilities Act of 1990	ADA	ADA is a wide-ranging civil rights law that prohibits, under certain circumstances, discrimination based on disability.
Configuration Management	CM	A system engineering process for establishing and maintaining a system's requirements, design and function throughout the life of the system
Commercial Off the Shelf	COTS	Commercial, readily available hardware or software.
Direct-Recording Electronic	DRE	A voting system that records votes by means of a voting card display provided with mechanical or electro-optical components that can be activated by the voter; that processes data by means of a computer program; and that records voting data and voting card images in memory components.
United States Election Assistance Commission	EAC	Commission created per the Help America Vote Act of 2002 assigned the responsibility for setting voting system standards and providing for the voluntary testing and certification of voting systems
Election Management System	EMS	—
Equipment Under Test	EUT	—
Help America Vote Act	HAVA	Act created by United States Congress in 2002.
National Institute of Standards and Technology	NIST	Government organization created to promote U.S. innovation and industrial competitiveness by advancing measurement science, standards, and technology in ways that enhances economic security and improves our quality of life.
Physical Configuration Audit	PCA	Review by accredited test laboratory to compare voting system components submitted for certification testing to the manufacturer's technical documentation, and confirmation the documentation meets national certification requirements. A witnessed build of the executable system is performed to ensure the certified release is built from tested components.
Quality Assurance	QA	—
Technical Data Package	TDP	Manufacturer documentation related to the voting system required to be submitted as a precondition of certification testing
Voting System Standards	VSS	Published by the FEC, second iteration of national level voting system standards.
Voluntary Voting System Guidelines	2005 VVSG	Published by the EAC, the third iteration of national level voting system standards.
Wyle Laboratories' Operating Procedure	WOP	Wyle Laboratories' Test Method or Test Procedure

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 8 of 28
Test Report No. T71013.02-01

4.0 TEST FINDINGS AND RECOMMENDATIONS

The ES&S FL EVS 4.5.0.0 Voting System component, as listed in Section 2.0, was subjected to the tests described in Section 3.2 of this report. The results of those tests are summarized in the sections below. All hard copy data generated by the performance of these tests is retained by Wyle Laboratories as raw data.

4.1 System Level Baseline

A System Level Baseline was performed to evaluate the system being submitted for testing in comparison to the system TDP. A Physical Configuration Audit was performed on the ES&S FL EVS 4.5.0.0 submitted for Hardware Testing.

4.1.1 Physical Configuration Audit

A focused Physical Configuration Audit (PCA) of the ES&S FL EVS 4.5.0.0 Voting System was performed in accordance with Section 6.6 of Volume II of the VVSG. The PCA compares the voting system components submitted for certification with the vendor's technical documentation and confirms that the documentation submitted meets the requirements of the Guidelines. The purpose of the PCA is to: establish a configuration baseline (both hardware and software) of the system to be tested; verify that the reviewed source code conforms to the vendor's specification; and assess the adequacy of user acceptance test procedures and data.

The PCA performed on the ES&S FL EVS 4.5.0.0 Voting System consisted of inspecting the ExpressVote scanner, firmware/software, and the TDP used in the ES&S FL EVS 4.5.0.0 Voting System.

Summary Findings: A focused PCA was performed to baseline the system's hardware and software components prior to commencement of the test campaign. During the PCA, one anomaly was encountered (reference Notice of Anomaly No. 3 in Attachment A for further reference).

4.2 Technical Data Package Review

The ES&S FL EVS 4.5.0.0 Voting System Technical Data Package (TDP) was not reviewed to the 2005 VVSG. The three supplied TDP documents were only utilized as reference material for: the hardware portion of the PCA, EUT configuration and test setup.

Summary Findings: A TDP review was not performed.

4.3 Hardware Testing

Hardware testing included: the inspection and evaluation of voting system documentation; tests of voting system under conditions simulating the intended storage, operation, and transportation; and operational tests verifying system performance and function under normal and abnormal conditions. Hardware testing was limited to the ES&S FL EVS 4.5.0.0 Voting System. Hardware Testing Data can be located in Attachments A through G of this document for additional information.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 9 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.3   Hardware Testing (Continued)

The ExpressVote was subjected to hardware tests as summarized in Table 4-1.

Table 4-1 Test Program Requirements

Report Section	VVSG Vol. I Section	VVSG Vol. II Section	Test Description
4.5.1	4.1.2.14 (a)	4.6.4	Low Temperature Test
4.5.1	4.1.2.14 (a)	4.6.5	High Temperature Test
4.5.1	4.1.2.14 (c)	4.6.3	Vibration Test
4.5.1	4.1.2.14 (b)	4.6.2	Bench Handling Test
4.5.1	4.1.2.14 (d)	4.6.6	Humidity Test
4.5.2	4.1.2.13	4.7.1	Temperature and Power Variation Test
4.6.1	4.1.2.5	4.8	Electrical Power Disturbance Test
4.6.2	4.1.2.9	4.8	Electromagnetic Radiation Test
4.6.3	4.1.2.8	4.8	Electrostatic Disruption Test
4.6.4	4.1.2.10	4.8	Electromagnetic Susceptibility Test
4.6.5	4.1.2.6 (a)	4.8	Electrical Fast Transient Test
4.6.6	4.1.2.7 (a)(h)	4.8	Lightning Surge Test
4.6.7	4.1.2.11 (a)	4.8	Conducted RF Immunity Test
4.6.8	4.1.2.12	4.8	Magnetic Fields Immunity Test
4.6.9	4.3.8	2.2.2	Product Safety Review, UL60950-1

4.4   Environmental Tests

Environmental tests were performed to ensure that the EUT and associated machine resident firmware were in compliance with the VVSG.

During test performance, the EUT was configured as it would be for use in an election precinct.

4.4.1   Non-Operating Environmental Tests

The EUT was subjected to various Non-Operating Environmental Tests. Prior to and immediately following each test environment, the EUT was powered on and subjected to operability functional checks to verify continued proper operation. The EUT was not powered on during the performance of any of the non-operating tests.

Low Temperature Test

The EUT was subjected to a Low Temperature Test in accordance with Section 4.6.4 of Volume II of the VVSG. The purpose of this test is to simulate stresses associated with the storage of voting machines and voting card counters. This test is equivalent to the procedure of MIL-STD-810D, Method 502.2, Procedure I-Storage, with a minimum temperature of -4°F.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 10 of 28
Test Report No. T71013.02-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4 Environmental Tests (Continued)

4.4.1 Non-Operating Environmental Tests (Continued)

Prior to test initiation, the EUT was subjected to a baseline operability checkout to verify system readiness. The EUT was then placed in an environmental test chamber and the chamber temperature was lowered to -4°F and allowed to stabilize. Upon temperature stabilization, the temperature was maintained for an additional four hours. The temperature was then returned to standard laboratory ambient conditions at a rate not exceeding 10°F per minute.

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

The EUT successfully completed the requirements of the Low Temperature Test. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, C, and G of this report.

High Temperature Test

The EUT was subjected to a High Temperature Test in accordance with Section 4.6.5 of Volume II of the VVSG. The purpose of this test is to simulate stresses associated with the storage of voting machines and voting card counters. This test is equivalent to the procedure of MIL-STD-810D, Method 501.2, Procedure I-Storage, with a maximum temperature of 140°F.

Prior to test initiation, the EUT was subjected to a baseline operability checkout to verify system readiness. The EUT was then placed in an environmental test chamber and the chamber temperature was raised to 140°F and allowed to stabilize. Upon temperature stabilization, the temperature was maintained for an additional four hours. The temperature was then returned to standard laboratory ambient conditions at a rate not exceeding 10°F per minute.

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

The EUT successfully completed the requirements of the High Temperature Test. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, C, and G of this report.

Vibration Test

The EUT was subjected to a Vibration Test in accordance with section 4.6.3 of Volume II of the VVSG. The purpose of this test is to simulate stresses faced during transport of voting machines and voting card counters between storage locations and polling places. This test is equivalent to the procedure of MIL-STD-810D, Method 514.3, Category I-Basic Transportation, Common Carrier.

Prior to test initiation, the EUT was subjected to a baseline operability checkout to verify system readiness. Upon completion, the EUT was secured to an electro dynamics shaker. One control accelerometer was affixed to the shaker table. The EUT was subjected to the Basic Transportation, Common Carrier profile as depicted in MIL-STD-810D, Method 514.3, Category I, with a frequency range from 10 to 500 Hz and an overall rms level of 1.04, 0.74, and 0.20 G for durations of 30 minutes in each orthogonal axis.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 11 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4   Environmental Tests (Continued)

4.4.1   Non-Operating Environmental Tests (Continued)

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

The ExpressVote successfully completed the requirements of the Vibration Test. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, C, and G of this report.

Bench Handling Test

The EUT was subjected to a Bench Handling Test in reference with section 4.6.2 of Volume II of the VVSG. The purpose of this test is to simulate stresses faced during maintenance and repair of voting machines and voting card counters. This test is equivalent to the procedure of MIL-STD-810D, Method 516.3, Procedure VI.

Prior to performance of the test, the EUT was subjected to a baseline operability checkout. Following the checkout, the EUT was inserted into the carrying case, and each edge of the base of the machine was raised to a height of four inches above the surface and allowed to drop freely onto the ground. This was performed six times per edge, for a total of 24 drops.

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

The EUT successfully completed the requirements of the Bench Handling Test. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, C, and G of this report.

Humidity Test

The EUT was subjected to a Humidity Test in accordance with section 4.6.6 of Volume II of the VVSG. The purpose of the test was to simulate stresses encountered during storage of voting machines and voting card counters. This test is similar to the procedure of MIL-STD-810D, Method 507.2, Procedure I-Natural Hot-Humid.

The EUT was subjected to a baseline operability checkout to verify system readiness. Upon completion, the EUT was placed in an environmental test chamber and was subjected to a 10-day humidity cycle in accordance with the 24-hour cycle values as shown in Table 4-2.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 12 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4   Environmental Tests (Continued)

4.4.1   Non-Operating Environmental Tests (Continued)

Table 4-2 Humidity Test Cycle Values

Time	Hot-Humid (Cycle 1)			Time	Hot-Humid (Cycle 1)		
	Temperature		RH		Temperature		RH
	°F	°C	%		°F	°C	%
0000	88	31	88	1200	104	40	62
0100	88	31	88	1300	105	41	59
0200	88	31	88	1400	105	41	59
0300	88	31	88	1500	105	41	59
0400	88	31	88	1600	105	41	59
0500	88	31	88	1700	102	39	65
0600	90	32	85	1800	99	37	69
0700	93	34	80	1900	97	36	73
0800	96	36	76	2000	94	34	76
0900	98	37	73	2100	97	33	85
1000	100	38	69	2200	90	32	85
1100	102	39	65	2300	89	32	88

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

The EUT successfully completed the requirements of the Humidity Test. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, C, and G of this report.

Florida Sand and Dust Exposure Test

All systems and components that are to be transported from place to place within a normal cycle of use, such as precinct tabulation equipment, will meet the requirements of this test. This test was similar to the procedure of the MIL-STD-810D, Method 510.2, Procedure I, Blowing Dust. This test was intended to evaluate the ability of the equipment to survive exposure to Dust and Fine Sand that may penetrate into cracks crevices, switches, display surfaces, and Electromechanical parts. The equipment was in a non-operating, stowed configuration, and protective covers were in place as the system configuration included one.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 13 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4   Environmental Tests (Continued)

4.4.1   Non-Operating Environmental Tests (Continued)

Table 4-3 Procedure Florida Sand and Dust Exposure Test

Step No. 1	Arrange the system for normal operation.
Step No. 2	Turn on power, and allow the system to reach design-operating temperature.
Step No. 3	Perform any servicing and make any adjustments necessary to achieve operational status.
Step No. 4	Operate the equipment in all modes, demonstrating all functions and features that would be utilized during election operations.
Step No. 5	Verify that all system functions have been correctly executed.
Step No. 6	Install the equipment in a test facility that meets the requirements of MIL-STD-810D, Method 510.2, Section II, and Subsection II-1.1.1.
Step No. 7	Adjust the test section temperature to 23 degrees C. (73 degrees F.) and the relative humidity to less than 30 percent. Maintain this relative humidity throughout the remainder of the test.
Step No. 8	Adjust the air velocity to 1.5 meters per second (300 feet per minute).
Step No. 9	Adjust the dust feed control for a dust concentration of 10.6 ± 7 grams per cubic meter (0.3 ± 0.2 grams per cubic foot).
Step No. 10	Maintain the conditions of Steps 2 through 4 for at least 6 hours.
Step No. 11	Stop the dust feed and increase the test section air temperature to 32 degrees C. (90 degrees F.) Maintain this condition until the internal temperature of the equipment has stabilized.
Step No. 12	Adjust the air velocity as in Step 3. Restart the dust feed to maintain the dust concentration as in Step 4.
Step No. 13	Continue the exposure for at least 6 hours.
Step No. 14	Turn off all chamber controls and allow the equipment to return to room temperature.
Step No. 15	Remove accumulated dust from the equipment by brushing, wiping, or shaking, taking care to avoid introducing additional dust into the equipment. Do not remove dust by air blast or vacuum cleaning.
Step No. 16	Inspect the interior of the equipment for evidence of dust intrusion and damage.
Step No. 17	Arrange the system for normal operation.
Step No. 18	Turn on power, and allow the system to reach design-operating temperature.
Step No. 19	Perform any servicing and make any adjustments necessary to achieve operational status.
Step No. 20	Operate the equipment in all modes, demonstrating all functions and features that would be utilized during election operations.
Step No. 21	Verify that all system functions have been correctly executed.

Summary of Findings. Despite the exterior of the carrying case showing some wear as an effect of the dust test, no dust was noted in the carrying case except what resulted from opening up the carrying case. The carrying case and plastic bag alone seemed to isolate the EUT from the dust. The plastic bag appears untouched except for the small amount of dust that fell into the carrying case during opening. No dust appeared to reach the EUT. The EUT operated as expected after being removed from the packaging.

The EUT successfully completed the requirements of the Florida Sand and Dust Exposure Test. Photographs and Test Data Sheets are contained in Attachments B and C of this report.

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 14 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4   Environmental Tests (Continued)

4.4.1   Non-Operating Environmental Tests (Continued)

Florida Rain Exposure Test

All systems and components which are designed to be transported from place to place within a normal cycle of use, such as precinct tabulation equipment, met the requirements of this test to evaluate the ability of the equipment to survive exposure to falling water from condensation, to leakage from upper surfaces, and to rain for a brief period of time incidental to transportation between a storage facility or polling place and a covered vehicle.

This test was similar to the procedure of MIL-STD-810D, Method 506.2, Procedure II - Drip. The equipment was in a non-operating, transportable configuration, and protective covers were in place as the system configuration included one.

Table 4-4 Procedure Florida Rain Exposure Test

Step No. 1	Arrange the system for normal operation.
Step No. 2	Turn on power, and allow the system to reach design-operating temperature.
Step No. 3	Perform any servicing and make any adjustments necessary to achieve operational status.
Step No. 4	Operate the equipment in all modes, demonstrating all functions and features that would be utilized during election operations.
Step No. 5	Verify that all system functions have been correctly executed.
Step No. 6	Install the equipment in the test facility. Provide a means of dispensing water at a rate of 7 gallons per square foot per hour, as illustrated in MIL-STD-810D, Figure 506.2-1.
Step No. 7	Subject the equipment to water falling from a height of approximately 3 feet for a period of 15 minutes.
Step No. 8	At the conclusion of the 15-minute exposure, remove the equipment from the test facility. Open or remove panels as necessary to allow the interior to be inspected.
Step No. 9	Inspect the test item for evidence of water intrusion.
Step No. 10	Arrange the system for normal operation.
Step No. 11	Turn on power, and allow the system to reach design-operating temperature.
Step No. 12	Perform any servicing and make any adjustments necessary to achieve operational status.
Step No. 13	Operate the equipment in all modes, demonstrating all functions and features that would be utilized during election operations.
Step No. 14	Verify that all system functions have been correctly executed.

Summary of Findings: Despite the exterior of the carrying case showing some wear as an effect of the rain test, no water was noted in the carrying case except what resulted from opening the carrying case. The carrying case and plastic bag alone seemed to isolate the EUT from the water. The plastic bag appeared untouched except for the small amount of water that fell into the carrying case during opening. No water appeared to reach the EUT. The EUT operated as expected after being removed from the packaging.

The EUT successfully completed the requirements of the Florida Rain Exposure Test. The Test Photographs are contained in Attachments B this report.

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 15 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4   Environmental Tests (Continued)

4.4.2   Operating Environmental Tests

Temperature/Power Variation Test

The ExpressVote was subjected to a Temperature and Power Variation Test in accordance with section 4.7.1 of Volume II of the VVSG. The purpose of this test was to evaluate system operation under various environmental conditions. The cumulative duration of at least 163 hours was achieved by utilizing three units for a period of 64 hours based on the (EAC RFI 2008-01), with 48 hours in the environmental test chamber. For the remaining hours, the equipment was operated at room temperature. This test is similar to the low temperature and high temperature tests of MIL-STD-810-D, Method 502.2 and Method 501.2.

To perform the test, the EUT was placed inside an environmental walk-in test chamber and connected to a variable voltage power source. The temperature inside the chamber and the voltage supplied to the hardware varied from 50°F to 95°F and from 105 VAC to 129 VAC (as depicted in Figures 4-1 through 4-4). During test performance, the operational functions were continuously exercised by the scanning of voting cards.
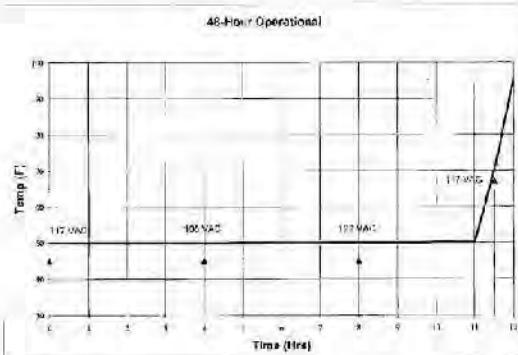
Figure 4-1 Temperature/Power Variation Profile Hours 0-12

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 16 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4   Environmental Tests (Continued)

4.4.2   Operating Environmental Tests (Continued)
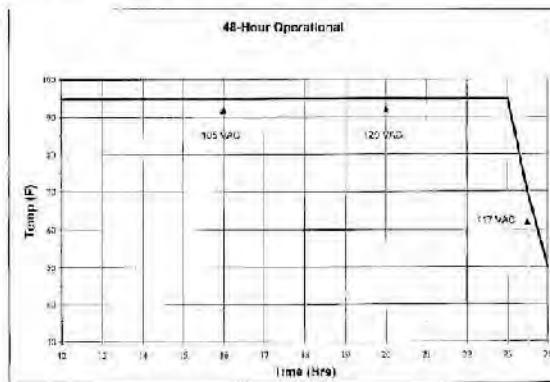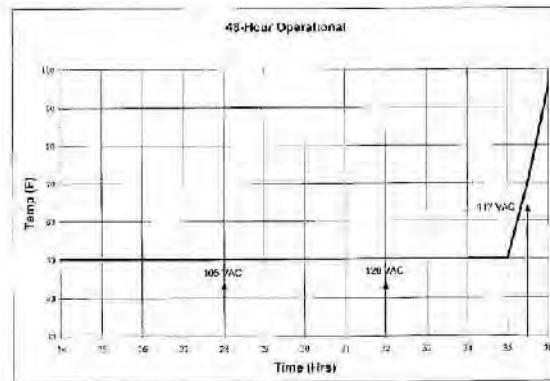
Temperature/Power Variation Test (Continued)

Figure 4-2 Temperature/Power Variation Profile Hours 12-24

Figure 4-3 Temperature/Power Variation Profile Hours 24-36

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 17 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.4.2   Operating Environmental Tests (Continued)

Temperature/Power Variation Test (Continued)
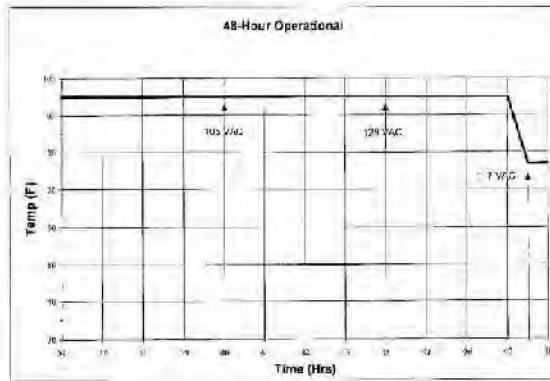
Figure 4-4 Temperature/Power Variation Profile Hours 36-48

Temperature/Power Variation Test (Continued)

Summary of Findings: During the Temperature/Power Variation Test, there were two anomalies encountered (reference Notice of Anomaly Nos. 3 and 4 in Attachment A for further reference).

The EUT successfully met the requirements of the Temperature/Power Variation Test on the third attempt. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, E, and G of this report.

4.5   Electrical Tests

Electrical tests were performed to ensure that the EUT and associated machine resident firmware were in compliance with the VVSG. Prior to each electrical test, an operation status check was performed.

During test performance, the EUT was configured as it would be for use in an election precinct.

The EUT was subjected to various electrical tests to ensure continued system operation and reliability in the presence of abnormal electrical events. The EUT was powered and actively processing voting cards during all electrical tests.

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 18 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   Electrical Tests (Continued)

4.5.1   Electrical Power Disturbance

Electrical Power Disturbance testing was performed in accordance with Sections 4.1.2.5 of Volume I and 4.8 of Volume II of the VVSG. This testing was performed to ensure that the EUT was able to withstand electrical power line disturbances (dips/surges) without disruption of normal operation or loss of data.

The EUT was configured to run in an automated test mode, where continual voting card processing would occur during the testing, and subjected to the voltage dips and surges over periods ranging from 20ms to four hours.

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

The EUT successfully met the requirements of the Electrical Power Disturbance Test. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.2   Electromagnetic Radiation Test (FCC Part 15 Class B - Emissions)

Electromagnetic Radiation emissions measurements were performed in accordance with Sections 4.1.2.9 of Volume I and 4.8 of Volume II of the VVSG. This testing was performed to ensure that emissions emanating from the unit do not exceed the limits of 47 CFR Part 15, Subpart B, Class B Limits.

The EUT was configured to run in an automated test mode, where continual voting card processing would occur during the testing. The ExpressVote was subjected to the test requirements detailed in Table 4-5.

Table 4-5 Conducted and Radiated Emissions Requirements

Conducted Emissions			Radiated Emissions	
Frequency Range (MHz)	Limits (dBµV)		Frequency Range (MHz)	3 Meter Test Limit (dBµV)
	Quasi-peak	Average		
0.15 to 0.50	66 to 56	56 to 46	30 to 88	40.0
0.50 to 5.0	56	46	88 to 216	43.5
5.0 to 30.0	60	50	216 to 960	46.0
			960 to 1000	54.0

Page No. 19 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   Electrical Tests (Continued)

4.5.2   Electromagnetic Radiation Test (FCC Part 15 Class B Emissions) (Continued)

Testing was performed at the Wyle Laboratories' Open Air Test Site 2 (OATS-2) located on the Intergraph Complex in Huntsville, AL. The OATS-2 is fully described in reports provided to the Federal Communication Commission (FCC) (FCC Reference 98597). The site was tested and complies with the requirements of ANSI C63.4-2003.

To perform the Conducted Emissions portion of the test, the ExpressVote was set up as depicted in Figure 4-5.

Figure 4-5 Conducted Emissions Test Setup

The ExpressVote was then subjected to the following test procedure:

1.   The ExpressVote was placed on a non-metallic table 0.8 meters above the turntable and reference ground plane at the Open-Area Test Site.

2.   The ExpressVote AC/DC Power Adapter was connected to the power mains through a Line Impedance Stabilization Network (LISN). Other support units were connected to the power mains through another LISN. The LISN provided 50 ohm/50 μH of coupling impedance for the measuring instrument.

3.   The ExpressVote was placed in an active state and monitored for functionality throughout testing.

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 20 of 28
Test Report No. T71013.02-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5 Electrical Tests (Continued)

4.5.2 Electromagnetic Radiation Test (FCC Part 15 Class B Emissions) (Continued)

    4. Both Line and Neutral of the power mains connected to the ExpressVote were checked for maximum conducted interference.

    5. The frequency range from 150 kHz to 30 MHz was evaluated and recorded. Emissions levels below −20 dB were not recorded.

To perform the Radiated Emissions portion of the test, the ExpressVote was set up as depicted in Figure 4-6.
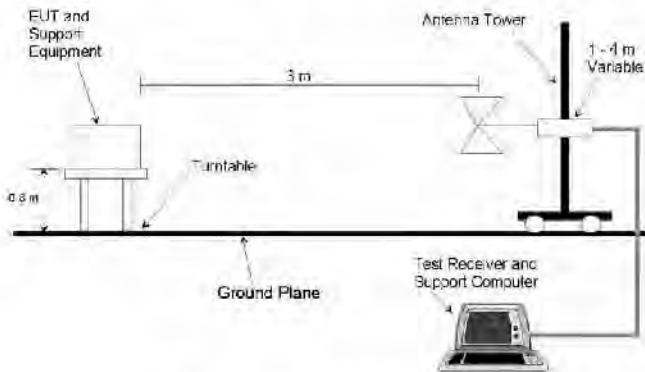
Figure 4-6 Radiated Emissions Test Setup

The ExpressVote was then subjected to the following test procedure:

    1. The ExpressVote was placed on a non-metallic turn-table 0.8 meters above the reference ground plane at the Open-Area Test Site.

    2. The ExpressVote was placed 3 meters away from the interference-receiving antenna, which was mounted on a variable-height antenna tower. The interference-receiving antenna used was a broadband antenna.

    3. For each suspected emissions point, the ExpressVote was arranged in a worst case configuration. The table was rotated from 0 to 360 degrees and the antenna height was varied from one (1) to four (4) meters to identify the maximum reading.

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 26 of 129
Certification Test Plan T71379.01

Page No. 21 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   Electrical Tests (Continued)

4.5.2   Electromagnetic Radiation Test (FCC Part 15 Class B Emissions) (Continued)

4.   All emissions points identified within 20 dB of the specified limit were tested individually using the quasi-peak method as specified and then reported in the tabular data.

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

The EUT was found to comply with the required emissions limits. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.3   Electrostatic Disruption

Electrostatic Disruption testing was performed in accordance with Sections 4.1.2.8 of Volume I and 4.8 of Volume II of the VVSG to ensure that should an electrostatic discharge event occur during equipment setup and/or voting card processing, the EUT would continue to operate normally. A momentary interruption is allowed so long as normal operation is resumed without human intervention or loss of data.

The EUT was configured to run in an automated test mode, where continual voting card processing would occur during the testing without operator intervention. The EUT was then subjected to electrostatic discharges of +/- 8 kV contact and +/- 15 kV air as shown in Table 4-6. Discharges were performed at areas typical of those which might be touched during normal operation, including the touch screen, user buttons, and other likely points of contact. The ExpressVote was then setup per the following conditions:

1.   Power lines and power line returns were configured as required by the system configuration.

2.   The EUT was raised approximately 10 cm from the ground using isolated stand-offs.

3.   Signal/control test cables were positioned approximately 5 cm (2 in.) above the ground.

Table 4-6 Electrostatic Discharge Transients

Characteristic	Requirements		
	Capacitance	Resistance	Value
Pulse Wave Shape (RC Network)	150	330	pf / Ω
Test Levels	Discharge Types		Value
	Air Gap	Direct Contact	
	±15	±8	KV
Rise Time	≤1		nanosecond
Pulse Decay Time	≤30 at 50% height		nanosecond

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 22 of 28
Test Report No. T71013.02-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5 Electrical Tests (Continued)

4.5.3 Electrostatic Disruption (Continued)

Table 4-6 Electrostatic Discharge Transients (Continued)

Characteristic	Requirements		
	Capacitance	Resistance	Value
Pulse Repetition	≥1		per second
Total Injected Pulse at each Test Point	10		per polarity (±)
Temperature	≥15 to ≤35		°C
Relative Humidity	≥30 to ≤60		%

Summary of Findings: During the ESD Test, there were two anomalies encountered (reference Notice of Anomaly Nos. 1 and 2 in Attachment A for further reference).

After the third attempt, the EUT successfully met the requirements of the ESD Test. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.4 Electromagnetic Susceptibility

Electromagnetic Susceptibility testing was performed in accordance with sections 4.1.2.10 of Volume 1 and 4.8 of Volume II of the 2005 VVSG. This testing was performed to ensure that the EUT was able to withstand a moderate level of ambient electromagnetic fields without disruption of normal operation or loss of data.

The EUT was configured to run in an automated test mode, where continual voting card processing would occur during the testing without operator intervention. The ExpressVote was then subjected to ambient electromagnetic fields at 10 V/m over a range of 80 MHz to 1000 MHz, as shown in Figure 4-7. Testing was conducted utilizing both horizontally and vertically polarized waves. The limits were measured with a maximum scan rate of 1% of the fundamental frequency and the dwell duration was three seconds.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 23 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   Electrical Tests (Continued)

4.5.4   Electromagnetic Susceptibility (Continued)
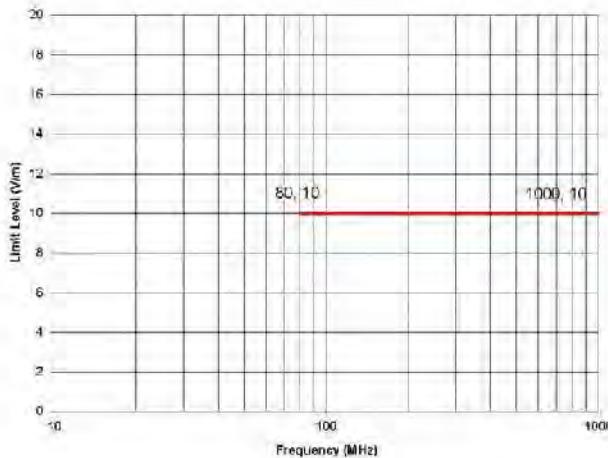
Figure 4-7 Radiated Susceptibility Limit

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

During the Susceptibility Test, the EUT successfully met the requirements of the Electromagnetic Susceptibility Test. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 24 of 28
Test Report No. T71013.02-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5 Electrical Tests (Continued)

4.5.5 Electrical Fast Transients

Electrical Fast Transients (EFT) testing was performed in accordance with Sections 4.1.2.6 (a) of Volume I and 4.8 of Volume II of the 2005 VVSG to ensure that, should an electrical fast transient event occur on a power line, the EUT would continue to operate without disruption of normal operation of loss of data. Section 4.1.2.6 (b) of Volume I is not applicable because there are no I/O lines greater than three meters.

The EUT was configured to run in an automated test mode, where continual voting card processing would occur during the testing without operator intervention. The EUT was then subjected to electrostatic fast transients of 2 kV applied to its AC power lines. The pulse characteristics are listed in Table 4-7.

Table 4-7 EFT Pulse Characteristics

Pulse Description	Requirements	Units
Pulse Amplitude	+/-2.0	kV peak to peak
Pulse Rise Time	5 +30%	nanoseconds
Pulse Width	50 ±30%	nanoseconds
Pulse Repetition Rate	100	kHz
Pulse Shape	Double exponential	N/A
Burst Duration	15	milliseconds
Burst Period	300	milliseconds
Test Duration	60	seconds

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

There was no loss of normal operation or loss of data as a result of the applied transients. The EUT successfully met the requirements of the Electrical Fast Transients Test. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.6 Lightning Surge

Lightning Surge testing was performed in accordance with Sections 4.1.2.7 (a), (b) of Volume I and 4.8 of Volume II of the 2005 VVSG to ensure that, should a surge event occur on a power line due to a lightning strike, the EUT will continue to operate without disruption of normal operation or loss of data. Sections 4.1.2.7 (c), (d), and (e) are not applicable because there are no DC lines greater than 10 meters and no I/O lines greater than 30 meters.

The EUT was configured to run in an automated test mode, where continual voting card processing would occur during the testing. The EUT power input lines were then subjected to a lightning surge test level of 2 kV applied to its AC power line per the surge characteristics listed in Table 4-8.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 25 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   Electrical Tests (Continued)

4.5.6   Lightning Surge (Continued)

Table 4-8 Surge Characteristics

Test I.D.	Cable Type	Number of Interfacing Cables	Description	Injection Signals Summary Characteristics
Surge	Line (L) to Neutral (N)	1	120 VAC Power Lines	Injection at Power Input. Sinewave: 0°, 90°, and 270°
	Line (L) to Ground (G)	1		
	Neutral (N) to Ground (G)	1		Combination Wave Test Levels: ±2.0 kV and Ring Wave Test Level ±2.0 kV
	Line (L) & Neutral (N) to Ground (G)	1		

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

The EUT successfully met the requirements of the Lightning Surge Test. Photographs, The Test Data Sheet, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.5.7   Conducted RF Immunity

Conducted RF Immunity testing was performed in accordance with Sections 4.1.2.11 (a) of Volume I and 4.8 of Volume II of the 2005 VVSG. Section 4.1.2.11 (b) of Volume I is not applicable because there are no signal/control lines greater than three meters. This testing was performed to ensure that the EUT was able to withstand conducted RF energy onto its power lines without disruption of normal operation or loss of data.

The EUT was configured to run in an automated test mode, where continual voting card processing would occur during the testing without operator intervention. The EUT was then subjected to conducted RF energy of 10 V rms applied to its power lines over a frequency range of 150 kHz to 80 MHz.

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

There was no loss of normal operation or loss of data as a result of the applied conducted RF energy. The EUT successfully met the requirements of the Conducted RF Immunity Test. Photographs, Test Data Sheets, Photographs, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 26 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.5   Electrical Tests (Continued)

4.5.8   Magnetic Fields Immunity

Magnetic Fields Immunity testing was performed in accordance with Sections 4.1.2.12 of Volume I and 4.8 of Volume II of the 2005 VVSG. This testing was performed to ensure that the EUT was able to withstand AC magnetic fields without disruption of normal operation or loss of data.

The EUT was configured to run in an automated test mode, where continual voting card processing would occur during the testing. The EUT was then subjected to AC magnetic fields of 30 A/m at a 60 Hz power line frequency.

Summary of Findings: Upon test completion, the EUT was inspected for any obvious signs of degradation and/or damage. None were observed. The EUT was subjected to a post-test operability checkout and continued operability verified.

The EUT successfully met the requirements of the Magnetic Fields Immunity Test. Photographs, Test Data Sheets, and Instrumentation Equipment Sheet are contained in Attachments B, D, and G of this report.

4.6   Product Safety Review

The VVSG states that all voting systems shall meet the following requirements for safety:

1.   All voting systems and their components shall be designed to eliminate hazards to personnel or to the equipment itself.

2.   Defects in design and construction that can result in personal injury or equipment damage must be detected and corrected before voting systems and components are placed into service.

3.   Equipment design for personnel safety shall be equal to or better than the appropriate requirements of the Occupational Safety and Health Act, Code of Federal Regulations, Title 29, Part 1910.

To satisfy these requirements, the EUT was subjected to a Product Safety Review in accordance with the applicable requirements of UL Standard for Safety for Information Technology Equipment, UL 60950-1, Second Edition.

Non-performance evaluation of the accompanying documentation and unit construction were also performed. No anomalies were discovered during these evaluations.

Summary of Findings: The EUT was found to be in compliance with the applicable requirements of the Standard for Safety for Information Technology Equipment, UL 60950-1, 2nd Edition. The Product Safety Certificate of Conformance is contained in Attachments F of this report.

(The remainder of this page intentionally left blank)

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 27 of 28
Test Report No. T71013.02-01

4.0   TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.7   Anomalies and Resolutions

Three Notices of Anomalies were issued during the test campaign. A Notice of Anomaly (NOA) is generated upon occurrence of a verified failure, an unexpected test result, or any significant unsatisfactory condition. The Notices of Anomaly generated during testing are presented in their entirety in Attachment A and are summarized below:

Notice of Anomaly No. 1: Electrostatic Disruption
Wyle engineers applied -15 kV air discharge to the bottom-right corner of the EUT, on the inside of the recessed handle. It was observed that the ExpressVote had become completely unresponsive and required human intervention, by means of a system reboot, to regain normal operation. The following onscreen observation was made, the count began to cycle up by approximately 30 counts within approximately five seconds, at which time the following error was displayed on the screen: "*System Error; ExpressVote General Error; Audio Playback Thread encountered and error. Please contact election official. An error has occurred. Power off and contact a technician for repair.*" It was also observed that there was no audio output

Notice of Anomaly No. 2: Electrostatic Disruption
Wyle engineers applied +8 kV contact discharge to the back of the EUT, on the metal plate for which the AC power adapter connection is established. It was observed that the ExpressVote had become completely unresponsive and required human intervention, by means of a system reboot, to regain normal operation. The following onscreen observation was made, the count stopped incrementing and audio was immediately lost. The EUT was observed for an additional seven minutes whereby the shoeshine mode continued to cycle, however the count was not incremented. After seven minutes the EUT began to cycle up by approximately 30 counts within approximately five seconds, at which time the following error was displayed on the screen: "*System Error; ExpressVote UI Application Error. Missing audio file; Prompt_1_98.wav. Please contact election official. An error has occurred. Power off and contact a technician for repair.*" After rebooting the EUT, the same test point was subjected to +8 kV contact discharge, at which time this issue was replicated.

Resolution to Notice of Anomaly Nos. 1 & 2
ES&S acknowledged the nonconformance observation. Root cause analysis provided by ES&S documented that power cord was missing earth ground path. This cord was replaced by ES&S and testing was restarted.

Notice of Anomaly No. 3: Temperature/Power Variation Test
During the 22nd hour of testing, Wyle observed that ExpressVote, serial number, EVO113350022, began to operate at a slower rate. During the 24th hour of testing, Wyle observed that ExpressVote, serial number, EVO113350025 began to operate at a slower rate. During the 24th hour of testing, Wyle observed that ExpressVote, serial number, EVO113350025 ceased to be fully functional, the audio stopped working. At this time, the test was halted.

Resolution to Notice of Anomaly No. 3
ES&S acknowledged the nonconformance observation. Root cause analysis provided by ES&S documented the audio playback code was being accessed by multiple threads; and was set to "below normal" priority. This caused audio playback corruption and audio thread to enter into a continuous loop and consuming nearly 100% CPU processing. The audio playback code has been synchronized to prevent threading corruption, and the audio playlist thread priority has been set to "Normal". Testing was restarted after code corrections and build.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. 28 of 28
Test Report No. T71013.02-01

4.0 TEST FINDINGS AND RECOMMENDATIONS (Continued)

4.7 Anomalies and Resolutions (Continued)

Notice of Anomaly No. 4: Temperature/Power Variation Test
During testing Wyle engineers observed that ExpressVote, serial numbers EVO113350022 and EVO113350025, printed a card with data missing in a vertical line across the length of the ballot. The tabulator would not read the card. All races and candidates were present and correct on the card, but the test was halted because the card would not scan.

Resolution to Notice of Anomaly No. 4
The printer platen had become dirty. A buildup of material on the printer platen interfered with the heat transfer from the printer platen to the vote summary card. Through cleaning of the printer platen every 12 hours of operation or before each election will eliminate this issue.

4.8 Test Summary and Conclusion

Wyle Laboratories performed hardware compliance testing on all modifications submitted for the ES&S FL EVS 4.5.0.0 Voting System. Wyle Laboratories only performed hardware compliance testing on the ExpressVote. The ExpressVote met the applicable hardware requirements of this test campaign to the EAC 2005 VVSG.

This report is valid only for the system identified in Section 2 of this report. Any changes, revisions, or corrections made to the system after this evaluation shall be submitted to Wyle Laboratories to determine the scope of testing for the modified system. The scope of testing required will be determined based upon the degree of modification.

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 34 of 129
Certification Test Plan T71379.01

Page No. A-1 of 5
Test Report No. T71013.02-01

ATTACHMENT A

NOTICES OF ANOMALY

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 35 of 129
Certification Test Plan T71379.01

Page No.A-2 of 5
Test Report No. T70013.02-01

wyle
laboratories

NOTICE OF ANOMALY		DATE: 10/01/2013

NOTICE NO. 1   P.O. NUMBER: ES&S-MSA-TA029   CONTACT NO: N/A

CUSTOMER: Election Systems and Software (ES&S)   WYLE JOB NO: T71379.01

NOTIFICATION MADE TO: Mike Dominion   NOTIFICATION DATE: 09/26/2013

NOTIFICATION MADE BY: Ryan Chambers   VIA: In Person

CATEGORY: [X] SPECIMEN [ ] PROCEDURE [ ] TEST EQUIPMENT   DATE OF ANOMALY: 09/26/2013

PART NAME: EL EVS 4.5.0.0   PART NO: —

TEST: Electrostatic Disruption (ESD)   I.D. NO: EV0112350029

SPECIFICATION: EAC 2005 VVSG, Volume 1   PARA. NO: Section 4.1.2.8

REQUIREMENTS:

Vote scanning and counting equipment for paper-based systems, and all DRE equipment, shall be able to withstand ±15 kV air discharge and ±8 kV contact discharge without damage or loss of data. The equipment may reset or have momentary interruption so long as normal operation is resumed without human intervention or loss of data. Loss of data means votes that have been completed and confirmed to the voter.

DESCRIPTION OF ANOMALY:

Wyle engineers applied -15 kV air discharge to the bottom right corner of the EUT, on the inside of the recessed handle. It was observed that the ExpressVote had become completely unresponsive and required human intervention, by means of a system reboot, to regain normal operation. The following moment observation was made, the count began to cycle up to approximately 30 counts within approximately five seconds at which time the following error was displayed on the screen: "System Error: ExpressVote General Error: Audio Playback Thread encountered and error. Please contact election official. An error has occurred. Power off and contact a technician for repair." It was also observed that there was no audio output.

DISPOSITION • COMMENTS • RECOMMENDATIONS:

The final disposition is pending a root cause analysis to be presented by the client.

Safety Related: [ ] YES [X] NO   Related to CFR Part 21 [ ] YES [ ] NO [X] N/A

RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21 [ ] CUSTOMER [ ] WYLE

CAR Required [ ] YES [X] NO   CAR NO.

VERIFICATION:

TEST WITNESS: N/A   PRODUCT ENGINEER: _(signature)_ 10/01/13

REPRESENTING: N/A   PROJECT MANAGER: _(signature)_ 10/01/13

   INTERDEPARTMENTAL COORDINATION: N/A

QUALITY ASSURANCE: _(signature)_ 10/01/13

WH-1080, Rev. March '09   Page 1 of 1

CONTROLLED DOCUMENT

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 36 of 129
Certification Test Plan T71379.01

Page No.A-2 of 5
Test Report No. T71013.02-01

wyle
laboratories

NOTICE OF ANOMALY		DATE: 10/01/2013

NOTICE NO: 2　　P.O. NUMBER: ESAS-MSA-TA020　CONTRACT NO: N/A

CUSTOMER: Election Systems and Software (ES&S)　　WYLE JOB NO: T71013.02

NOTIFICATION MADE TO: Mike Deminger　　NOTIFICATION DATES: 09/26/2013

NOTIFICATION MADE BY: Ryan Chambers　　VIA: In person

CATEGORY: [X] SPECIMEN [] PROCEDURE [] TEST EQUIPMENT　DATE OF ANOMALY: 09/26/2013

PART NAME: EL EVS 4 unit 1　　PART NO:

TEST: Electrostatic Disruption (ESD)　　I.D. NO: EV011326002

SPECIFICATION: EAC 2005 VVSG, Volume 1　PARA. NO: Section 4.1.2.8

REQUIREMENTS:

Vote scanning and counting equipment, for paper-based systems, and all DRE equipment, shall be able to withstand 115 kV air discharge and ±8 kV surface discharge without damage or loss of data. The equipment may reset or have momentary interruption so long as normal operation is resumed without human intervention or loss of data. Loss of data means votes that have been scanned, tabulated and confirmed to the voter.

DESCRIPTION OF ANOMALY:

Wyle engineers applied ±8 kV contact discharge to the back of the EUT, on the metal plate for which the AC power adapter connection is established. It was observed that the ExpressVote had become completely unresponsive and required human intervention, by means of a system reboot, to regain normal operation. The following customer observation was made, the count stopped incrementing and audio was immediately lost. The EUT was observed for an additional seven minutes whereby the election mode continued to cycle, however the count was not incremented. After seven minutes the EUT began to cycle up by approximately 30 counts within approximately five seconds at which time the following error was displayed on the screen: "System Error: ExpressVote UI Application Error, Missing media file. Prompt 1 Sel wav. Please contact election official. An error has occurred. Power off and contact a technician for repair." After rebooting the EUT, the same test point was applied to ±8 kV air discharge, at which time this item was replicated.

DISPOSITION - COMMENTS - RECOMMENDATIONS:

The final disposition is pending a root cause analysis to be conducted by the client.

Safety Related [] YES [X] NO　　Found in CFR Part 21 [] YES [] NO [X] N/A

RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21　[X] CUSTOMER　[] WYLE

CAR Required: [] YES [X] NO　　CAR No.

VERIFICATION:　　PROJECT ENGINEER: _____ 10/01/2013

TEST WITNESS: N/A　　PROJECT MANAGER: _____ 10/1/13

REPRESENTING: N/A　　INTERDEPARTMENTAL COORDINATION: N/A

QUALITY ASSURANCE: _____

WH 1050, Rev. March 98　　Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. A-4 of 5
Test Report No. T71013.02-01

wyle
Laboratories

NOTICE OF ANOMALY		DATE: 10/18/2013

NOTICE NO: _____ 3 _____ P/O NUMBER: ES&S-MSA-TA029 CONTRACT NO. _____ N/A _____
CUSTOMER: Election Systems and Software (ES&S) WYLE JOB NO: _____ T71013.02 _____
NOTIFICATION MADE TO: _____ Mike Dummann & Mike Dvorsok _____ NOTIFICATION DATE: 10/16/2013
NOTIFICATION MADE BY: _____ Alan Slimmont _____ VIA: _____ In person _____

CATEGORY: [X] SPECIMEN [ ] PROCEDURE [ ] TEST EQUIPMENT DATE OF ANOMALY: 10/16/2013
PART NAME: _____ ES&S ExpressVote _____ PART NO: _____ ExpressVote _____
TEST: Environmental Control – Operating Environment Temp/Power ID. NO. _____ EVO113350025 _____
SPECIFICATION: EAC 2005 VVSG, Volume I PARA. NO. _____ Section 4.1.2.14 & = 7.1 _____

REQUIREMENTS: 2005 VVSG, Volume I Section 4.1.2.14

Test item shall be capable of simulated temperature and power variation that would be encountered in normal operating environments for voting systems using an environmental chamber and an adjustable power supply equivalent to the procedure in MIL-STD-810D, Method 502.2 and Method 501.2.

DESCRIPTION OF ANOMALY:

During the 22nd hour of testing, Wyle observed that ExpressVote, serial number EVO113350022, began to operate at a slower rate.

During the 24th hour of testing, Wyle observed that ExpressVote serial number EVO113350015 began to operate at a slower rate.

During the 34th hour of testing, Wyle observed that ExpressVote, serial number EVO113350025 ceased to be fully functional, the audio stopped working. At this time, the test was halted.

DISPOSITION • COMMENTS • RECOMMENDATIONS:

The final disposition is pending a root cause analysis to be presented to the client.

Safety Related: [ ] YES [X] NO   Internal 10 CFR Part 21: [ ] YES [ ] NO [X] N/A
RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21:   [ ] CUSTOMER   [ ] WYLE
CAR Required: [ ] YES [X] NO   CAR No.

VERIFICATION:
TEST WITNESS: _____ N/A _____   PROJECT ENGINEER: _____ 10/18/13
REPRESENTING: _____ N/A _____   PROJECT MANAGER: _____ 10/18/2013
   I&E DEPARTMENTAL COORDINATION: _____ N/A _____
QUALITY ASSURANCE: _____   _____ N/A _____

WP 1066, Rev March 03   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. A 5 of 5
Test Report No. T71013.02-01

wyle
laboratories

ORIGINAL	NOTICE OF ANOMALY	DATE: 10/18/2013

NOTICE NO: 4	P.O. NUMBER: ES&S-MSA-TA029	CONTRACT NO: N/A	
CUSTOMER: Election Systems and Software (ES&S)		WYLE JOB NO: 171013.02	
NOTIFICATION MADE TO: Mike Darmman & Mike Dvorack		NOTIFICATION DATE: 10/14/2013	
NOTIFICATION MADE BY: Alan Simmons		VIA: In person	

CATEGORY: [x] SPECIMEN [ ] PROCEDURE [ ] TEST EQUIPMENT	DATE OF ANOMALY: 10/14/2013	
PART NAME: ES&S ExpressVote	PART NO. ExpressVote	
TEST: Environmental Control – Operating Environment – Temp/Power	I.D. NO. EVO113350025	
SPECIFICATION: EAC 2005 VVSG, Volume I	PARA. NO. Section 4.1.2.14 & 4.7.1	

REQUIREMENTS: 2005 VVSG Volume I Section 4.1.2.14

Test item shall be capable of simulated temperature and power variation that would be encountered in normal operating environments for voting systems using an environmental chambers and an adjustable power supply equivalent to the procedure in MIL-STD-810D, Method 502.2 and Method 501.2.

DESCRIPTION OF ANOMALY:

During testing Wyle engineers observed that ExpressVote, serial numbers, EVO113350022 and EVO113350025, printed a ballot with printed data missing in a vertical line across the length of the ballot. The ballot would not scan into the scanner to become validated. All races and candidates were present on the ballot and correct, but pass/fail criteria was that the ballot be scanned successfully.

DISPOSITION • COMMENTS • RECOMMENDATIONS:

The final disposition is pending a root cause analysis to be presented by the client.

Safety Related: ☐ YES ☒ NO		Potential 10 CFR Part 21: ☐ YES ☐ NO ☒ N/A	
RESPONSIBILITY TO ANALYZE ANOMALIES AND COMPLY WITH 10 CFR PART 21:		☐ CUSTOMER ☐ WYLE	
CAR Required: ☐ YES ☒ NO		CAR No.	

VERIFICATION:	PROJECT ENGINEER: _____ 10-18-13
TEST WITNESS: None	PROJECT MANAGER: _____ 10-18-2013
REPRESENTING: None	INTERDEPARTMENTAL COORDINATION: _____
QUALITY ASSURANCE: _____	11/18/2013

WH 1086, Rev. March '09   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-1 of 20
Test Report No. T71013.02-01

ATTACHMENT B

PHOTOGRAPHS

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-2 of 20
Test Report No. T71013.02-01

Photograph No. 1: ES&S FL EVS 4.5.0.0 PCA

Photograph No. 2: ES&S FL EVS 4.5.0.0 PCA
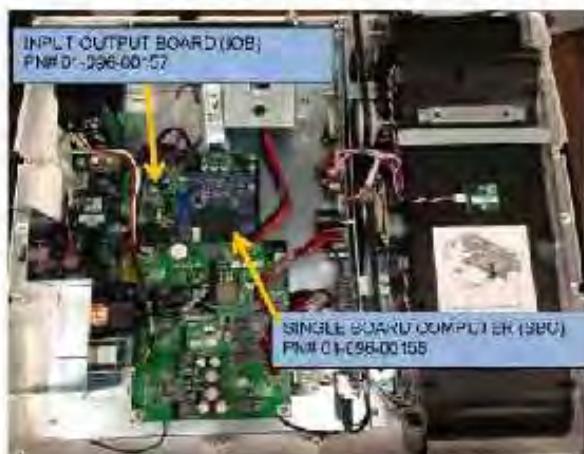
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-3 of 20
Test Report No. T71013.02-01

Photograph No. 3: ES&S FL EVS 4.5.0.0 PCA
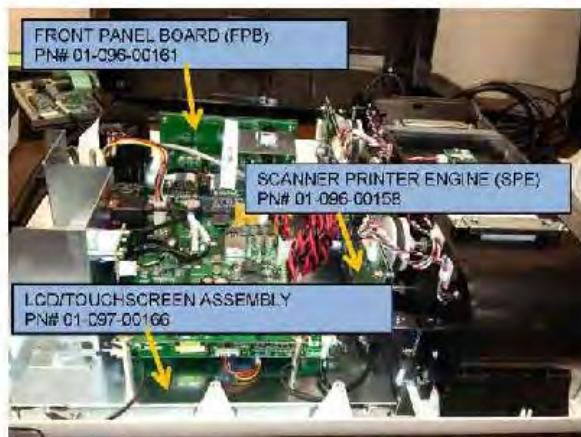
Photograph No. 4: ES&S FL EVS 4.5.0.0 PCA
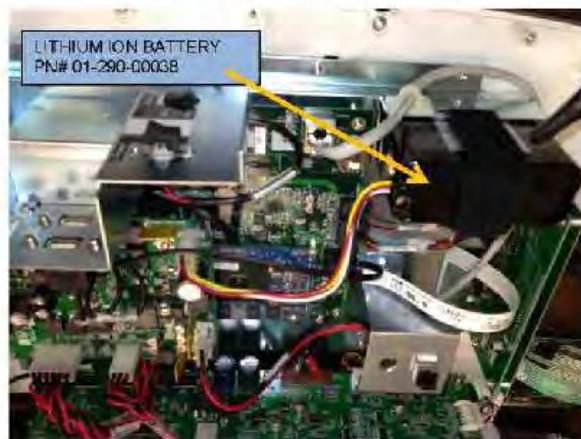
WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-4 of 20
Test Report No. T71013.02-01

Photograph No. 5: ES&S FL EVS 4.5.0.0 PCA

Photograph No. 6: ES&S FL EVS 4.5.0.0 PCA
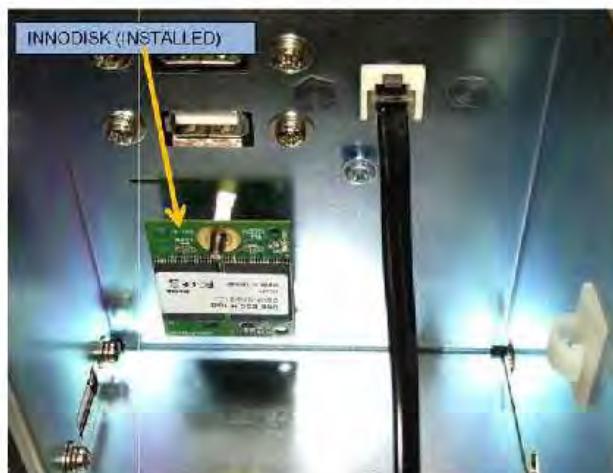
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-5 of 20
Test Report No. T71013.02-01

Photograph No. 7: ES&S FL EVS 4.5.0.0 PCA
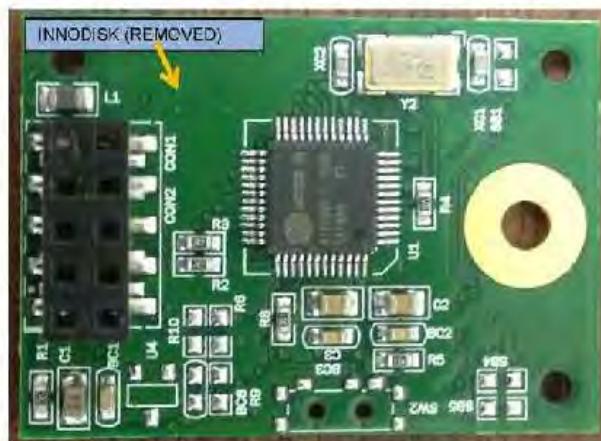
Photograph No. 8: ES&S FL EVS 4.5.0.0 PCA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-6 of 20
Test Report No. T71013.02-01

Photograph No. 9: ES&S FL EVS 4.5.0.0 PCA

Photograph No. 10: ES&S FL EVS 4.5.0.0 PCA
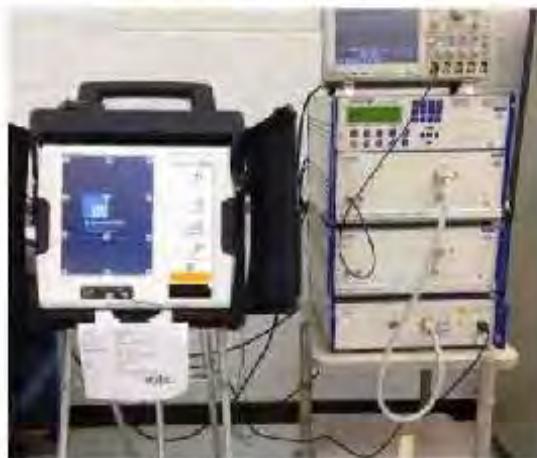
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-7 of 20
Test Report No. T71013.02-01

Photograph No. 11: ES&S EL-EVS 4.5.0.0 Lightning Surge

Photograph No. 12: ES&S EL-EVS 4.5.0.0 Lightning Surge

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-8 of 20
Test Report No. T71013.02-01

Photograph No. 13: ES&S FL EVS 4.5.0.0 Magnetic Fields Immunity

Photograph No. 14: ES&S FL EVS 4.5.0.0 Magnetic Fields Immunity

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-9 of 20
Test Report No. T71013.02-01

Photograph No. 15: ES&S FL EVS 4.5.0.0 Electromagnetic Emissions
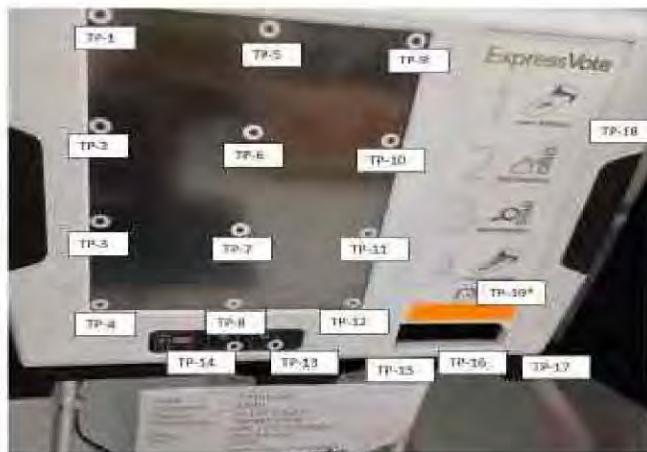
Photograph No. 16: ES&S FL EVS 4.5.0.0 Electromagnetic Emissions

WYLE LABORATORIES, INC.
Huntsville Facility
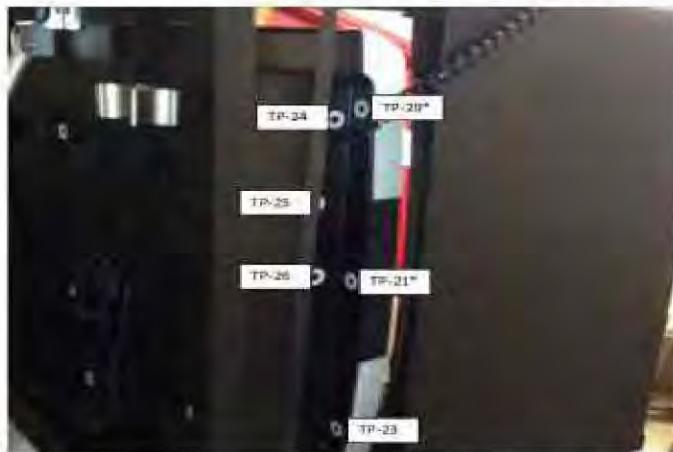
National Technical Systems
Huntsville Facility

Page No. B-10 of 20
Test Report No. T71013.02-01

Photograph No. 17: ES&S FL EVS 4.5.0.0 Electrostatic Disruption
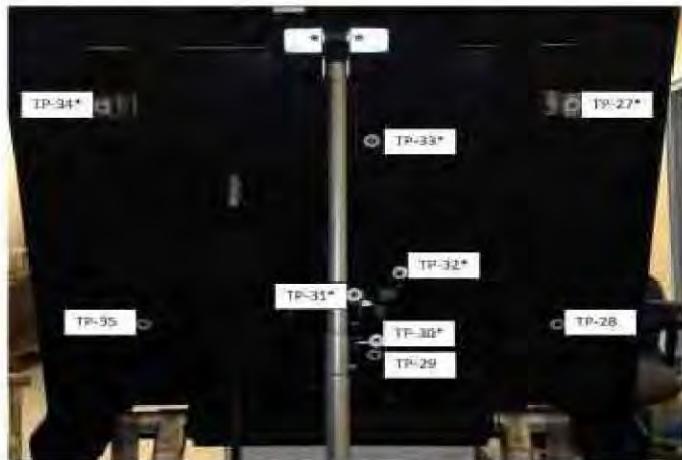
Photograph No. 18: ES&S FL EVS 4.5.0.0 Electrostatic Disruption

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-11 of 20
Test Report No. T71013.02-01

Photograph No. 19: ES&S FL EVS 4.5.0.0 Electrostatic Disruption

Photograph No. 20: ES&S FL EVS 4.5.0.0 Electrostatic Disruption

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-12 of 20
Test Report No. T71013.02-01

Photograph No. 21: ES&S FL EVS 4.5.0.0 Electrical Power Disturbance

Photograph No. 22: ES&S FL EVS 4.5.0.0 Electrical Power Disturbance

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-13 of 20
Test Report No. T71013.02-01

Photograph No. 23: ES&S FL EVS 4.5.0.0 Electromagnetic Susceptibility

Photograph No. 24: ES&S FL EVS 4.5.0.0 Electromagnetic Susceptibility

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-14 of 20
Test Report No. T71013.02-01

Photograph No. 25: ES&S FL EVS 4.5.0.0 Temperature and Power Variation

Photograph No. 26: ES&S FL EVS 4.5.0.0 Temperature and Power Variation

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-15 of 20
Test Report No. T71013.02-01

Photograph No. 27: ES&S FL EVS 4.5.0.0 Bench Handling

Photograph No. 28: ES&S FL EVS 4.5.0.0 Bench Handling

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. B-16 of 20
Test Report No. T71013.02-01

Photograph No. 29: ES&S FL EVS 4.5.0.0 Humidity

Photograph No. 30: ES&S FL EVS 4.5.0.0 Humidity

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. B-17 of 20
Test Report No. T71013.02-01

Photograph No. 31: ESAS FL EVS 4.5.1.6 Low Temperature

Photograph No. 32: ESAS FL EVS 4.5.1.6 Low Temperature

WYLE LABORATORIES, INC.
HUNTSVILLE FACILITY

Page No. B-15 of 20
Test Report No. T7.003.02-01

Photograph No. 3b: 15&S FL EVS 4.5.00 High Temperature

Photograph No. 3b: 15&S FL EVS 4.5.06 High Temperature

WYLE LABORATORIES, INC
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. 11-19 of 20
Test Report No. T71012452-01

Photograph No. 35: ES-8S FL EVS 4.5.0.0 Sand and Dust

Photograph No. 36: ES-8S FL EVS 4.5.0.0 Sand and Dust

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. II-20 of 20
Test Report No. T73013.02-01

Photograph No. 37: ES&S FL EVS 4.5.0.0 Rain

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 59 of 129
Certification Test Plan T71379.01

Page No. C-1 of 27
Test Report No. T71013.02-01

ATTACHMENT C

NON-OPERATING ENVIRONMENTAL TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 60 of 129
Certification Test Plan T71379.01

Page No. C 2 of 27
Test Report No. T71013 02-01
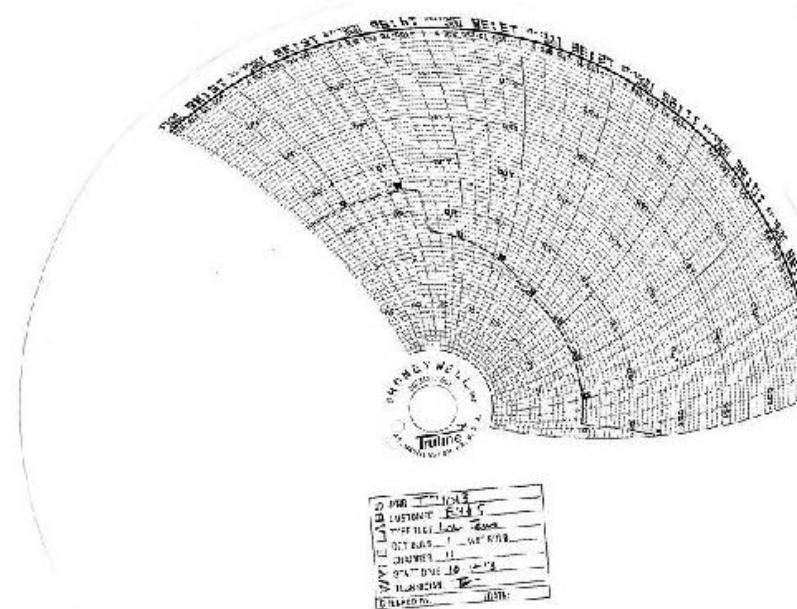
LOW TEMPERATURE TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C 3 of 27
Test Report. No. T71013.03-01

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 62 of 129
Certification Test Plan T71379.01

Page No. C-4 of 27
Test Report No. T71013-02-01

HIGH TEMPERATURE TEST DATA
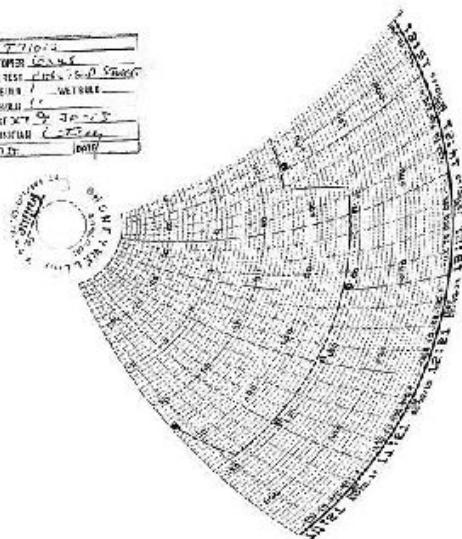
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-5 of 27
Test Report No. T71013.02-01

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 64 of 129
Certification Test Plan T71379.01

Page No. C 6 of 27
Test Report No. T71013.02-01

VIBRATION TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 65 of 139
Certification Test Plan T71379.01

Page No. C-7 of 27
Test Report No. T71013.02-01

VIBRATION TEST DATA SHEET

Customer	E&S VOTING SYSTEMS	Spec:		Specimen	ES&S EXPRESS VOTE		Ambient
Job No.	T71013	Method	514.3 CATEGORY 1	Part No			Social Sci Temp.
G&I Yes ☐	No ☒	Procedure	MIL-STD-810D	S/N			Rheo Yes ☒ No ☐

Test Title BASIC TRANSPORTATION COMMON CARRIER RANDOM VIBRATION

| | | | | SINUSOIDAL | | | | RANDOM | | | TOTAL | | | |
Date	Time	Axis	Temp (F)	Freq (cps)	Disp. (in)	Accel (g's)	Freq (cps)	PSD (g²/Hz)	Slope (dB/Oct)	Accel (grms)	Test Time (min)	COMMENTS	NAME
												TEST REQUIREMENT	
9/28/13	8:23	TRANS	AMB				10	0.00013				RUN 1	C.T.
							20	0.00005					
							30	0.00065					
							78	0.00002					
							79	0.00019					
							120	0.00010					
							500	0.00001	0.005	21			
9/28/13	8:32	LONG	AMB				10	0.00050				RUN 2	
							20	0.00050					
							100	0.00060					
							121	0.00200					
							200	0.00350					
							250	0.00140					
							300	0.00003					

WH-028A

Signed C. Thomason 10-5-13   Approved _____ 10-5-2013

Job No.	T71013
Report No.	
Date	9/28/2013
Page No.	1 of 2

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 66 of 129
Certification Test Plan T71379.01

Page No. C-8 of 27
Test Report No. T71013.02-01
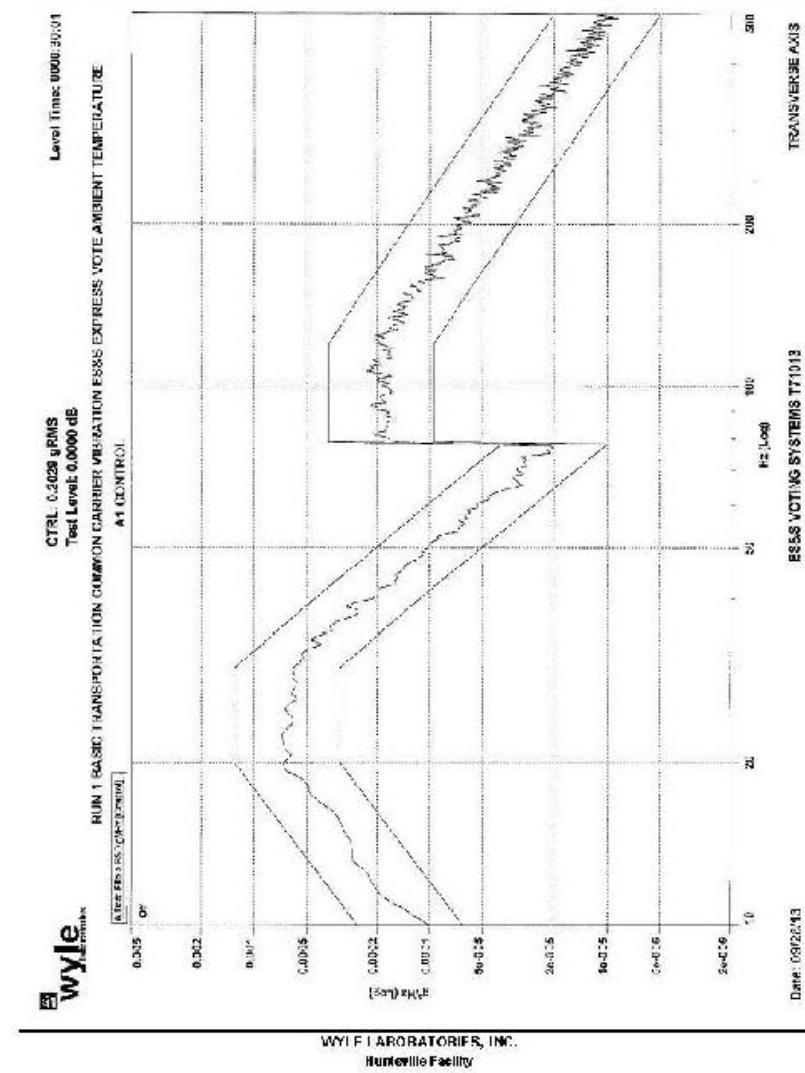
VIBRATION TEST DATA SHEET

Job No. T71013
Record
Date 9/28/2013
Page No. 2 of 3

Date	Time	Axis	Temp (F)	SINUSOIDAL Freq. (cps)	Disp. (ins)	Accel. (g's)	RANDOM Freq. (cps)	PSD (g²/Hz)	Slope (dB/Oct)	TOTAL Accel. (grms)	Test Time (min)	COMMENTS				NAME
												TEST REQUIREMENT				
9/28/13				500				0.2019		0.7697	53	RUN 2 CONTINUED				
9/28/13	1103	VERT	AMB				10	0.01520				RUN 2				C.T.
								0.01520								
							500	0.0015		7.3411	53					

Signed C. Summers 10-8-13

Approved [signature] 10-8-2013

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility
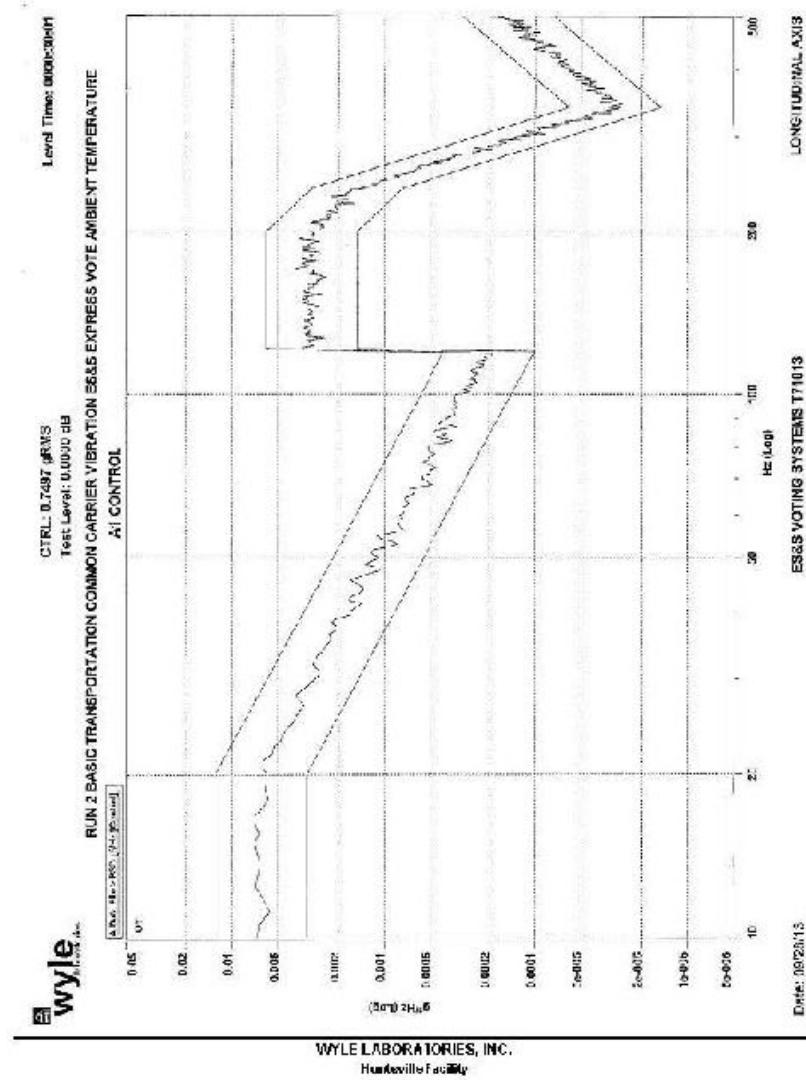
Page No. C-9 of 27
Test Report No. T71013.02-01

WYLE LABORATORIES, INC.
Huntsville Facility
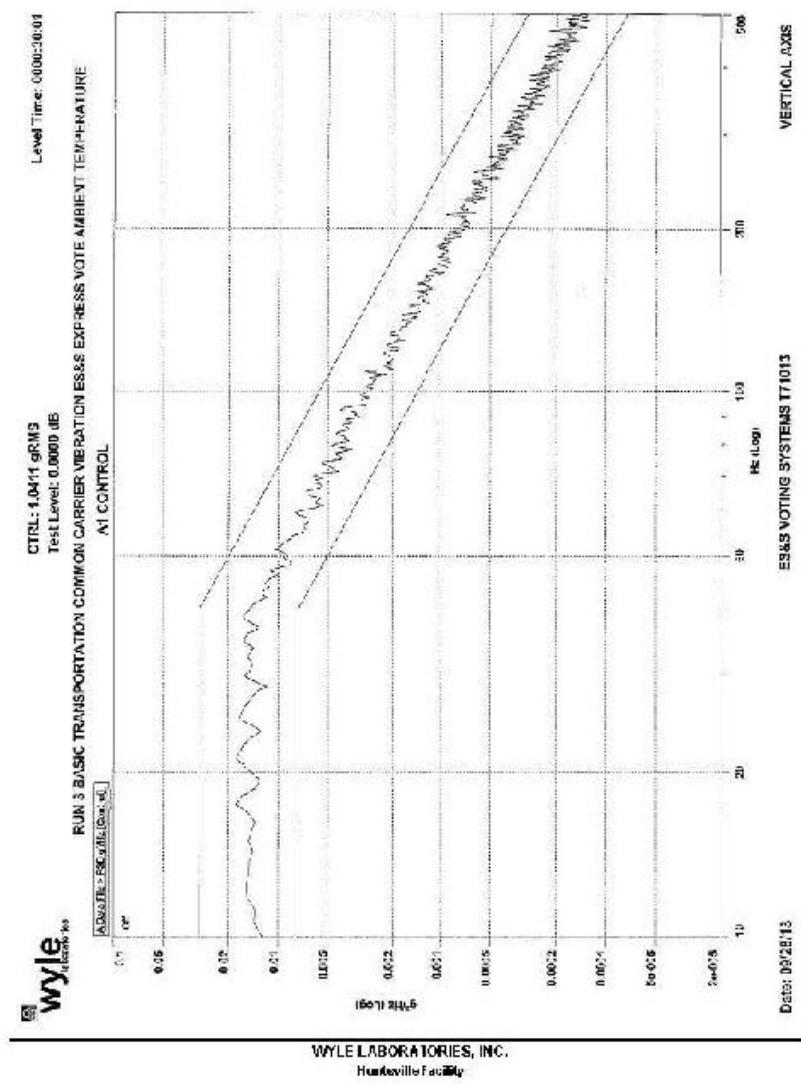
Page No. C-10 of 27
Test Report No. T71013.02-01

Level Time: 00:00:00:00

CTRL: 0.7497 gRMS
Test Level: 0.0000 dB

RUN 2 BASIC TRANSPORTATION COMMON CARRIER VIBRATION E&S EXPRESS VOTE AMBIENT TEMPERATURE
A1 CONTROL

ES&S VOTING SYSTEMS T71013

LONGITUDINAL AXIS

Hz (Log)

Date: 09/28/15

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-11 of 27
Test Report No. T71013.02-01

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 70 of 129
Certification Test Plan T71379.01

Page No. C 12 of 27
Test Report No. T71013.02-01

BENCH HANDLING TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-13 of 27
Test Report No. T71013.02-01

wyle

DATA SHEET

Customer _____ ES&S _____
Specimen ___ DVS 4000 ___
Part No. _____ Express Vote _____   Amb. Temp. +75°F _____   Job No. ___ T71013.02 ___
Spec. _____ EAC 2005 VVSG _____   Photo: Yes _____   Report No. ___ T71013.02-01 ___
Para. _____ 4.1.2 _____   Test Mod. Air _____   Start Date ___ 10/3/13 ___
S/N ___ EVS113350021 ___   Specimen Temp. Ambient _____

Test Title _____ Bench Handling _____

Drop Height: 4"			
Edge 1: Drops 1-6	✓	ok	
Edge 2: Drops 7-12	✓	ok	
Edge 3: Drops 13-18	✓	ok	
Edge 4: Drops 19-24	✓	ok	
Post-Test Inspection:	Post op stable check completed		
	no crk on unit best further issue		
	Test Passed + completed 10/3/13		
	9:15 am		

Tested By _____ [signature] _____ Date 10-3-13
Technician

Sheet No. ___ 1 ___ of ___ 1 ___

Notice of
Anomaly ___ N/A ___   Approved ___ [signature] ___ 10-3-13
Project Engineer

Wyle Form WI-014A, Rev. Jun 03

Appendix F, Page No. 72 of 129
Certification Test Plan T71379.01

Page No. C 14 of 27
Test Report No. T71013.02-01
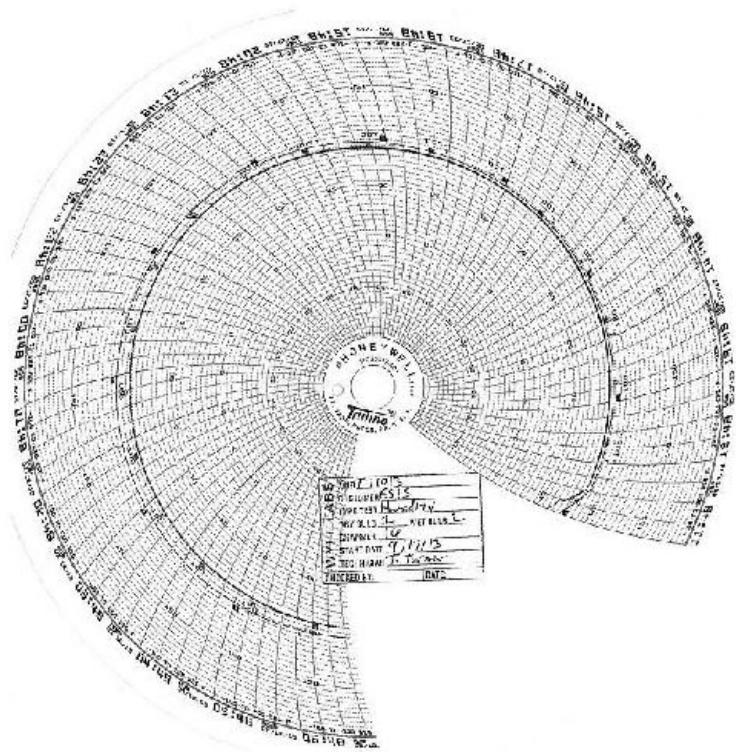
HUMIDITY TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-15 of 27
Test Report No. T71013.02-01
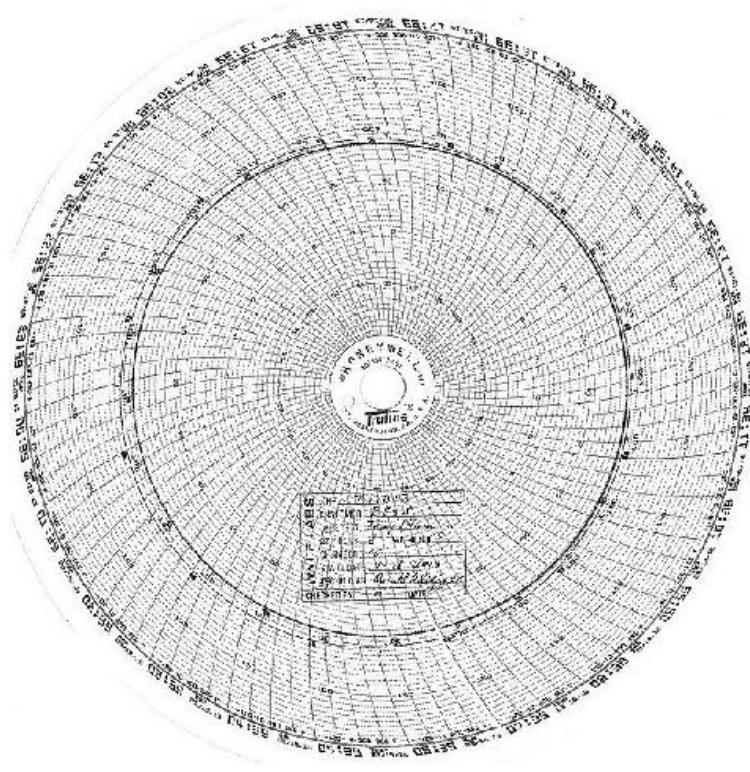
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-16 of 27
Test Report No. T71013.02-01
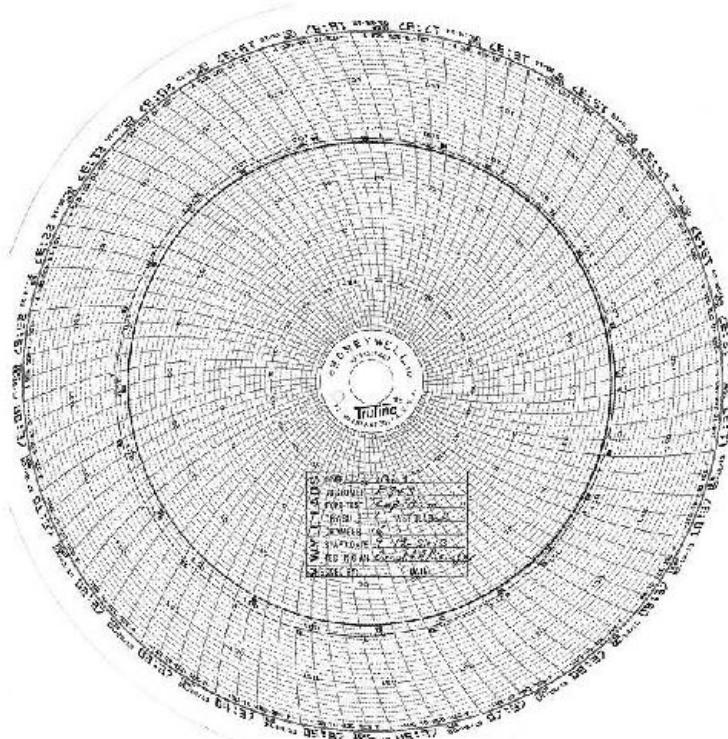
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-17 of 27
Test Report No. T71013.02-01
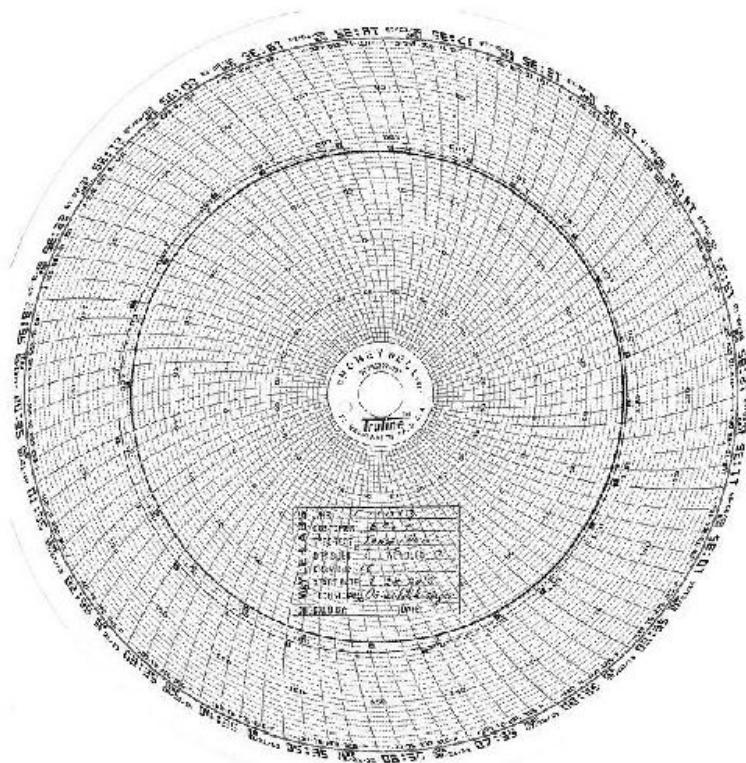
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-18 of 27
Test Report No. T71013.03-01
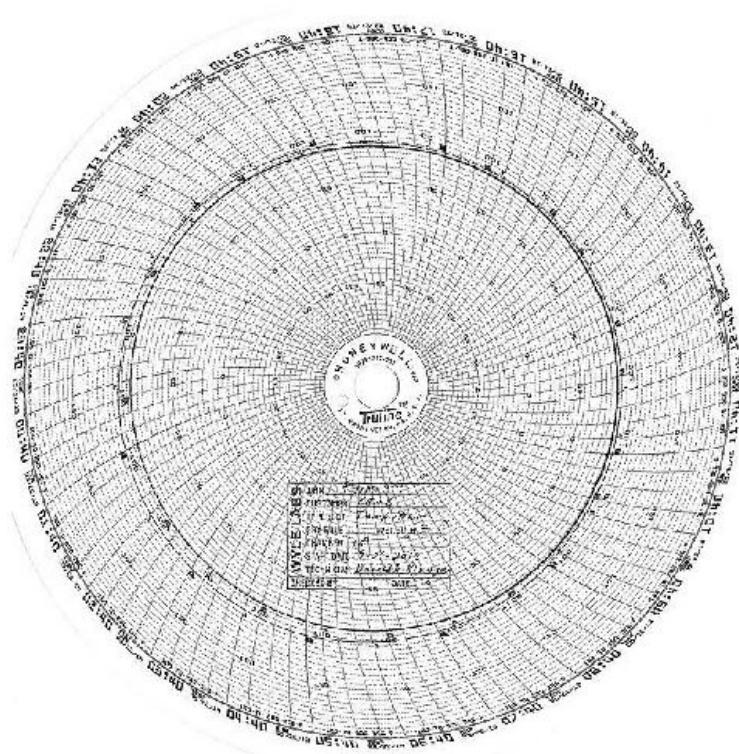
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 77 of 129
Certification Test Plan T71379.01

Page No. C-19 of 27
Test Report No. I71013.03-01
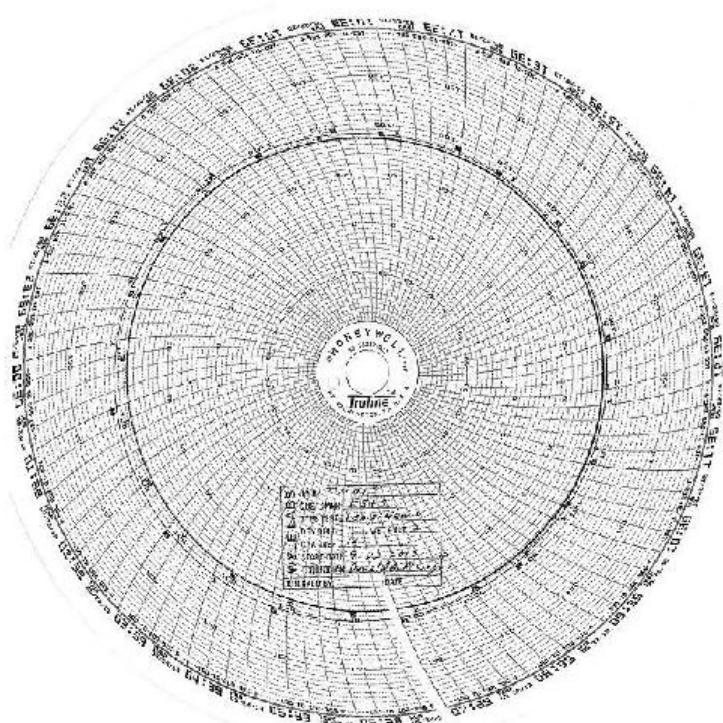
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 78 of 129
Certification Test Plan 171379.01

Page No. C-20 of 27
Test Report No. T71013.00-01
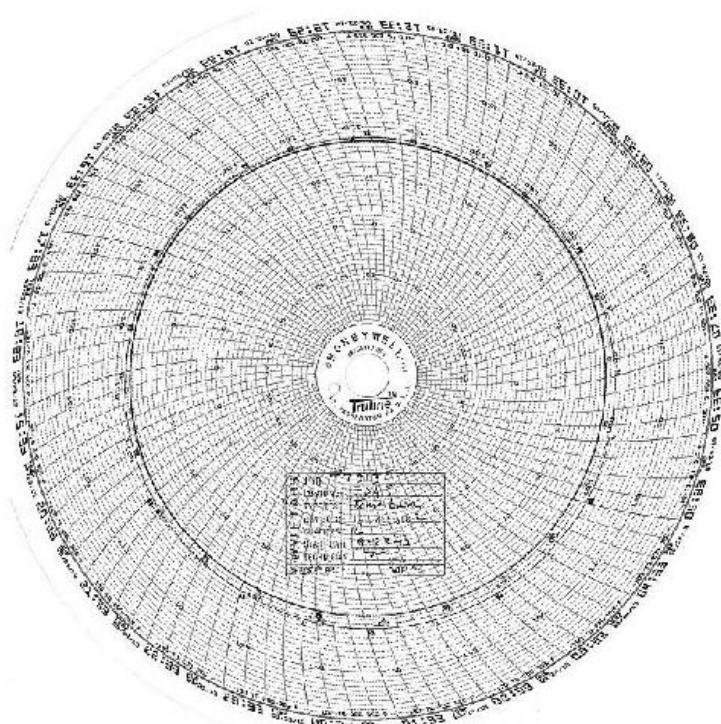
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-31 of 27
Test Report No. T71013.02-01
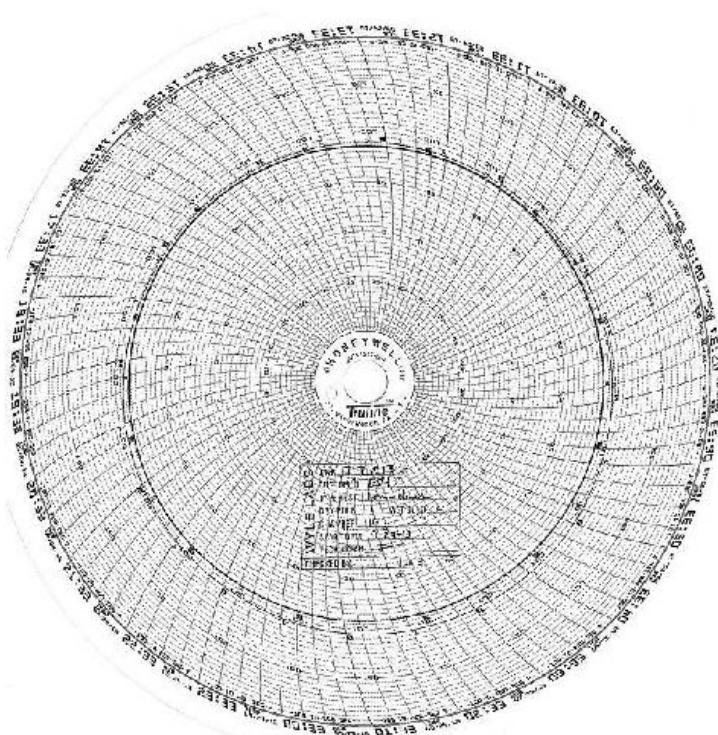
WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-22 of 27
Test Report No. T71013.02-01
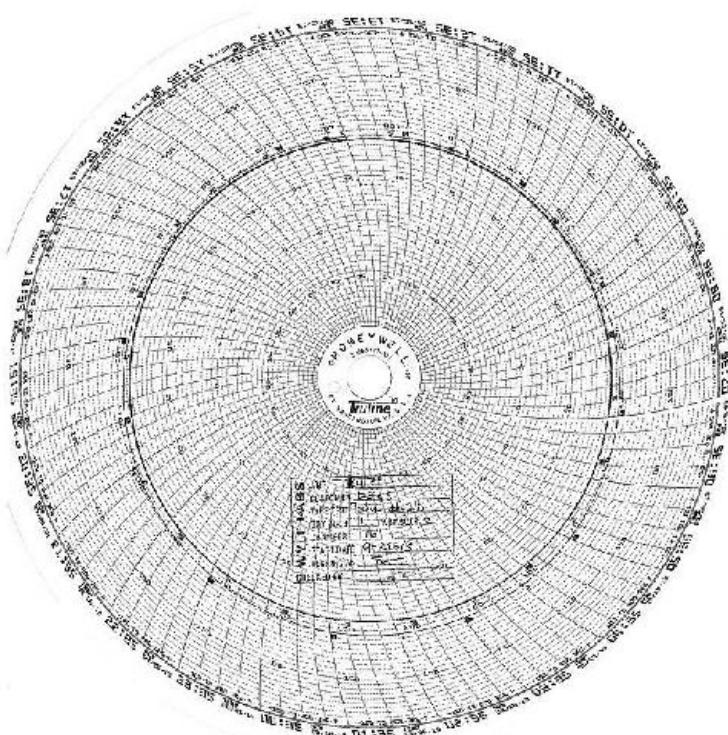
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix E, Page No. 81 of 129
Certification Test Plan T71379.01

Page No. C-23 of 27
Test Report No. T71013.02-01
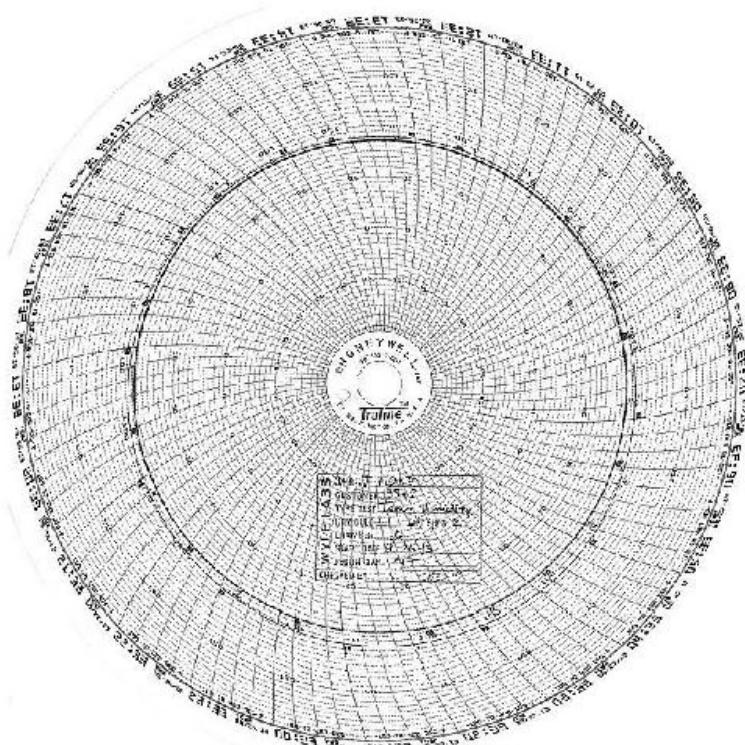

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 82 of 129
Certification Test Plan T71379.01

Page No. C-24 of 27
Test Report No. T71013.03-01

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. C-25 of 27
Test Report No. T71013.72-01

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 84 of 129
Certification Test Plan T71379.01

Page No. C 26 of 27
Test Report No. T71013.02-01

DUST TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-27 of 27
Test Report No. T71013.02-01

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. D-1 of 20
Test Report No. T71013.02-01

ATTACHMENT D

ELECTRICAL TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-2 of 20
Test Report No. T71013.02-01

ELECTROSTATIC DISRUPTION

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 88 of 129
Certification Test Plan T71379.01

Page No. D-3 of 20
Test Report No. T71013.02-01

wyle
Laboratories

DATA SHEET

Job No.: T71013.02
Start Date: 30 Sep 2013
Humidity: 46.2%

Customer: ES&S (page 1 of 2)
EUT: FL EVS 4500
Model No.: ExpressVote
Serial No.: EV0113350020
Test Title: Electrostatic Disruption

Temperature: 19.5°C
Measurement Point: See Test Points Below
Interference Signal: See Applied Signal
Frequency Range: N/A

Test Points	Meets Limit		Applied Level (kV)	Discharge Type	Times Tested	Comments
	Yes	No				
TP001: Vertical Coupling Plane			±2, 4, 9	Contact	10	Back Side of EUT
TP001: Touch Screen			±2, 4, 8	Contact	10	
TP003: Touch Screen			±2, 4, 8	Contact	10	
TP004: Touch Screen			±2, 4, 8	Contact	10	
TP005: Touch Screen			±2, 4, 8	Contact	10	
TP006: Touch Screen			±2, 4, 8	Contact	10	
TP007: Touch Screen			±2, 4, 8	Contact	10	
TP008: Touch Screen			±2, 4, 8	Contact	10	
TP009: Touch Screen			±2, 4, 8	Contact	10	
TP010: Touch Screen			±2, 4, 8	Contact	10	
TP011: Touch Screen			±2, 4, 8	Contact	10	
TP012: Touch Screen			±2, 4, 8	Contact	10	
TP013: Handset Jack			±2, 4, 8	Contact	10	
TP014: Hand Switch Access Port (HSA)			±2, 4, 8, 15	Air	10	
TP015: Bottom Left Paper Path Door			±2, 4, 8, 15	Air	10	
TP016: Bottom Middle Paper Path Door			±2, 4, 8, 15	Air	10	
TP017: Bottom Right Paper Path Door			±2, 4, 8, 15	Air	10	
TP018: Top Right Paper Path Door			±2, 4, 8, 15	Air	10	
TP019: Paper Path Door Lock			±2, 4, 8, 15	Air	10	
TP020: (Middle) Handle Top Screw			±2, 4, 8, 15	Air	10	
TP021: Left side Handle Middle Screw			±2, 4, 8, 15	Air	10	

Notice of Anomaly: NOA 1 & 2

Witness: N/A

WH 1538 Rev Dec, 2001

Tested By: _(signature)_ Date: 09/30/13
Electrician

Approved: _(signature)_ Date: 09/30/2013
Project Engineer

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 89 of 129
Certification Test Plan T71379.01

Page No. D-4 of 20
Test Report No. T71013.02-01

wyle
Laboratories

DATA SHEET

Job No.: T71013.02
Start Date: 30 Sep 2013
Humidity: 46.2%

Customer: ES&S (Page 2 of 2)
EUT: EL EVS 4503
Model No.: ExpressVote
Serial No.: EVS1123SU029
Test Title: Electrostatic Discharge

Temperature: 19.5 C
Measurement Point: See Test Points Below
Interference Signal: See Applied Signal
Frequency Range: N/A

Test Points	Meets Limit Yes	Meets Limit No	Applied Level (KV)	Discharge Type	Times Tested	Comments
TP022: Middle Right Pipe Flap Door			±2, 4, 8, 15	Air	10	
TP023: Left Inside Handle Bottom Sensor			±2, 4, 8, 15	Air	10	
TP024: Top Left Side of EUT			±2, 4, 8, 15	Air	10	
TP025: Top Right Side of EUT			±2, 4, 8, 15	Air	10	
TP026: Middle Left Side of EUT			±2, 4, 8, 15	Air	10	
TP027: Top Right Screw on Back of EUT			±2, 4, 8, 15	Air	10	
TP028: Bottom Right on Back of EUT			±2, 4, 8, 15	Air	10	
TP029: Bottom Middle on Back of EUT			±2, 4, 8, 15	Air	10	
TP030: Exposed Metal by portion of EUT Released for Table Top Use			±2, 4, 8, 15	Air	10	
TP031: Metal Standoff, housing AC to DC adapter plug			±2, 4, 8, 15	Air	10	
TP032: Center Middle Screw on Back of EUT			±2, 4, 8, 15	Air	10	
TP033: Top Middle Screw on Back on EUT			±2, 4, 8, 15	Air	10	
TP034: Top Left Screw on Back of EUT			±2, 4, 8, 15	Air	10	
TP035: Bottom Left on Back of EUT			±2, 4, 8, 15	Air	10	
TP036: Top Right Side of EUT			±2, 4, 8, 15	Air	10	
TP037: Back on Right Side of EUT			±2, 4, 8, 15	Air	10	
TP038: Bottom Right Side of EUT			±2, 4, 8, 15	Air	10	
TP039: Right Inside Handle Top Screw			±2, 4, 8, 15	Air	10	
TP040: Right Inside Handle Middle Screw			±2, 4, 8, 15	Air	10	
TP041: Right Inside Handle Bottom Screw			±2, 4, 8, 15	Air	10	

Notice of Anomaly: NOA 1 & 2

Witness: N/A
W0-143C, Rev Dec 2008

Tested By: _[signature]_ Date: 09/30/13
Technician
Approved: _[signature]_ Date: 09/30/2013
Project Engineer

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 90 of 129
Certification Test Plan T71379.01

Page No. D 5 of 20
Test Report No. T71013.02-01

ELECTRICAL POWER DISTURBANCE TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-6 of 20
Test Report No. T71013.03-01

California Instruments Corp.
Data entry mode: Absolute

No.	Type	Time(s)	Volt
1	V Step	60.000	120.0
2	V Step	0.020	84.0
3	V Step	60.000	120.0
4	V Step	0.100	48.0
5	V Step	60.000	120.0
6	V Step	1.000	48.0
7	V Step	60.000	120.0
8	V Step	5.000	6.0
9	V Step	60.000	120.0
10	V Step	1.000	102.0
11	V Step	60.000	120.0
12	V Step	1.000	138.0
13	V Step	60.000	120.0
14	V Step	600.000	126.0
15	V Step	60.000	120.0
16	V Step	14400.000	105.0
17	V Step	60.000	120.0
18	Empty		

Transient List: sk E/7-
Printed on: Thursday, September 19, 2013 4:40:05 PM

Page #1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 92 of 129
Certification Test Plan T71379.01

Page No. D 7 of 20
Test Report No. T71013.02-01
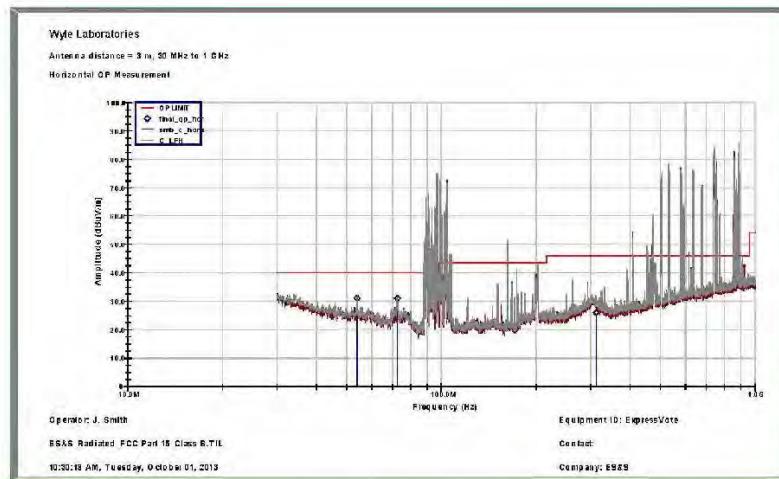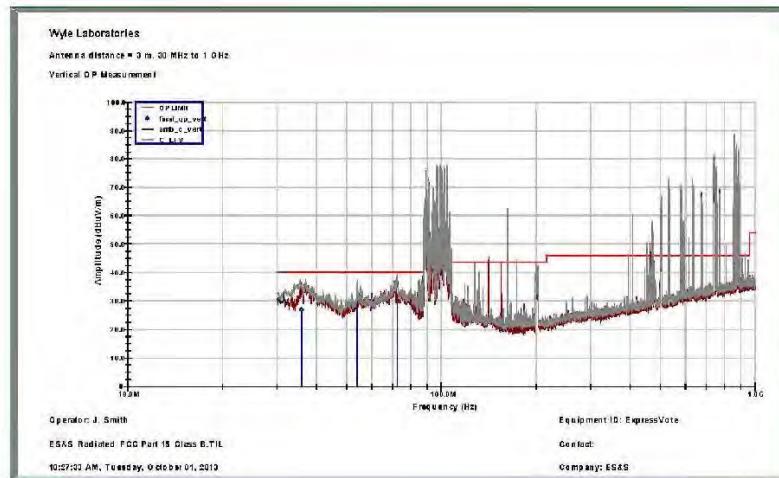
ELECTROMAGNETIC RADIATION TEST: RADIATED EMISSIONS TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-8 of 20
Test Report No. T71013.02-01

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 94 of 129
Certification Test Plan T71379.01

Page No. D-9 of 20
Test Report No. T71013.02-01
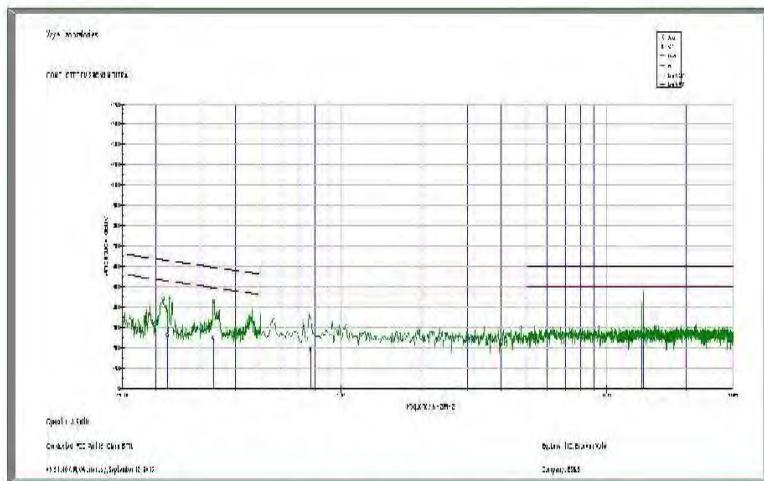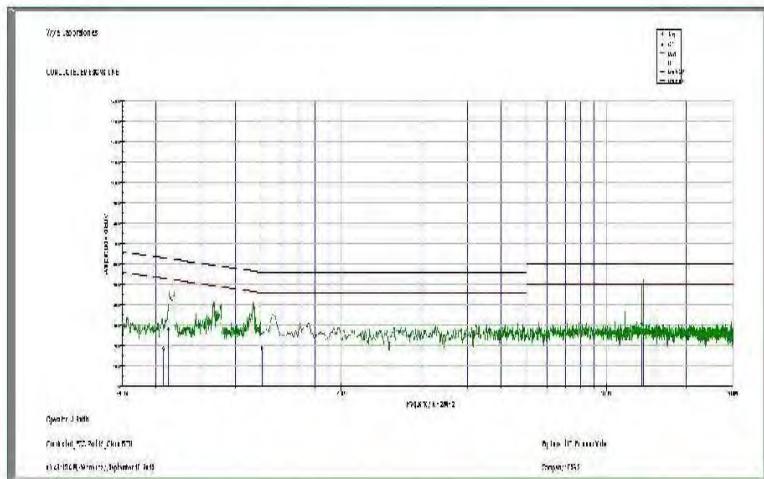
ELECTROMAGNETIC RADIATION TEST: CONDUCTED EMISSIONS TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D 10 of 20
Test Report No. T71013.02 01

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 96 of 129
Certification Test Plan T71379.01

Page No. D 11 of 20
Test Report No. T71013.02-01

ELECTROMAGNETIC SUSCEPTIBILITY TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-12 of 20
Test Report No. T71013.02-01

wyle
laboratories

DATA SHEET

Job No.: T71013.02

Start Date: 28 Oct 13

Customer:	ES&S	Temperature:	21.6°C	Humidity:	43.9%
EUT:	EXPRESSVOTE	Measurement Points:	EUT @ All Four Sides		
Model No.:	EXPRESSVOTE	Interference Signal:	1Khz @ 80% AM		
Serial No.:	EV0113250129	Frequency Range:	80Mhz to 1Ghz		

Test Title: IEC 61000-4-3 (Electromagnetic Susceptibility)

Test Frequency () kHz (X) MHz () GHz	Meets Limit		Susceptibility Threshold Level () A () V () V (X) V/m () V/m () dBµA () dBµV () dBµV/m () dBpT	Maximum Signal Applied	Comments
	Yes	No			
80	X		>10	10	Vertical and Horizontal
↓	↓		↓	↓	↓
1000	X		>10	10	Vertical and Horizontal

Notes of Anomaly: N/A

Witness: N/A

Tested By: [signature] Technician Date: 10-28-2013

Approved: [signature] Project Engineer Date: 10/28/13

Page 1 of 1

WH-1133, Rev Dec, 8/01

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 98 of 129
Certification Test Plan T71379.01

Page No. D 13 of 20
Test Report No. T71013 02-01

ELECTRICAL FAST TRANSIENT TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-14 of 20
Test Report No. T71013.02-01

wyle

DATA SHEET

Job No.: T71013.02
Start Date: 03 Oct 13

Customer:	ES&S	Temperature:	21.0° C Humidity: 47.7%
EUT:	Express Vote	Measurement Point:	See Comments Below
Model No.:	Express Vote	Interference Signal:	Test Signal Applied @ SSInS
Serial No.:	EV0113350029	Frequency Range:	See Test Frequencies Below

Test Title: IEC 61000-4-4 (Electrical Fast Transient)

Test Frequency	Meets Limit		Susceptibility Threshold Level	Maximum Signal Applied	Comments
(X)kHz ( )MHz ( )GHz	Yes	No	( )A ( )V (X)kV ( )MHz ( )V/m ( )V/m ( )dBµV ( )dBµV/m ( )dBµT		
.060	X		=1	1	Line to Neutral
.060	X		1	1	Line to Ground
.060	X		>1	1	Neutral to Ground

Notice of Anomaly: N/A

Witness: N/A

Tested By: _____ Date: 10/03/13

Approved: _____ Date: 10/25/2013
Project Engineer

Page 1 of 1

wtl 0152 Rev Dec 200

Appendix F, Page No. 100 of 129
Certification Test Plan T71379.01

Page No. D 15 of 20
Test Report No. T71013.02-01

LIGHTNING SURGE TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 101 of 129
Certification Test Plan T71379.01

Page No. D-16 of 20
Test Report No. T71013.02-01

wyle
Laboratories

DATA SHEET

Job No.: T71013.02
Start Date: 02 Oct 13

Customer:	D&S	Temperature:	22.7° C	Humidity: 41.9%
EUT:	ExpressVote	Measurement Point:	See Comments Below	
Model No.:	ExpressVote	Interference Signals:	Test Signal Applied @ 1.2/50 uS	
Serial No.:	BVC115350029	Frequency Range:	See Test Frequencies Below	

Test Title: EN 61000-4-5 (Lightning Surge Test)

Test Frequency	Meas Limit		Susceptibility Threshold Level	Maximum Signal Applied	Comments
(X)kHz ( )MHz ( )GHz	Yes	No	( )A ( )V (X)kV ( )Vm ( )V/m ( )dBuA ( )dBuV ( )dBuV/m ( )dBpT		
.060	X		>.5	.5	Line to Neutral @ 0°, 90°, 183°, and 270°
.060	↓		↓	↓	Line to Ground @ 0°, 90°, 183°, and 270°
.060	X		>.5	.5	Neutral to Ground @ 0°, 90°, 183°, and 270°
.060	X		>1	1	Line to Neutral @ 0°, 90°, 183°, and 270°
.060	↓		↓	↓	Line to Ground @ 0°, 90°, 183°, and 270°
.060	X		>1	1	Neutral to Ground @ 0°, 90°, 183°, and 270°
.060	X		>2	2	Line to Neutral @ 0°, 90°, 183°, and 270°
.060	↓		↓	↓	Line to Ground @ 0°, 90°, 183°, and 270°
.060	X		>2	2	Neutral to Ground @ 0°, 90°, 183°, and 270°

Notes of Anomaly: N/A

Witness: N/P

Tested By: _[signature]_ Date: 10/03/13
Technician

Approved: _[signature]_ Date: 10/03/2013
Project Engineer

Page 1 of 1

WYLE-1483 Rev. Dec 2004

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. D 17 of 20
Test Report No. T71013.02-01

CONDUCTED RF IMMUNITY TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. D-18 of 20
Test Report No. T71013.02-01

wyle
laboratories

DATA SHEET

Job No.:	T71013.02	
Start Date:	24 Sep 13	

Customer:	ENSS	Temperature:	23.5° C	Humidity: 42.5%
EUT:	Express Vote	Measurement Point:	See Comments Below	
Model No.:	Express Vote	Interference Signal:	1 KHz @ 80%, AM	
Serial No.:	EV0113450/29	Frequency Range:	150 KHz to 80 MHz	

Test Title _____ EN 61000-4-6 (Conducted RF Immunity)

Tst Frequency	Meets Limit		Susceptibility Threshold Level	Maximum Signal Applied	Comments
( )kHz (X)MHz ( )GHz	Yes	No	( )A (X)V ( )W ( )Wm ( )Vrms ( )dBµA ( )dBµV ( )dBµVm ( )dBµT		
150	X		>10	10	AC Input
↓	↓		↓	↓	↓
80	X		>10	10	AC Input

Notes of Anomaly: ____ N/A ____   Tested By: _____ Date: _____

Witness: ____ N/A ____   Approved: _____ Date: 09/24/2013

Technician

Project Engineer

Page 1 of 1

WT-1032 Rev 002/204

Appendix F, Page No. 104 of 129
Certification Test Plan T71379.01

Page No. D-19 of 20
Test Report No. T71013.02-01

MAGNETIC FIELDS IMMUNITY TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 105 of 129
Certification Test Plan T71379.01

Page No. D-20 of 20
Test Report No. T71013.02-01

wyle
laboratories

DATA SHEET

Job No.: T71013.02
Start Date: 18 Sept 13

Customer:	ES&S	Temperature:	22.1° C	Humidity:	19.9%
EUT:	ExpressVote	Measurement Point:	See Comments Below		
Model No.:	ExpressVote	Interference Signal:	CW for a Period of 5 Minutes		
Serial No.:	EV0113350C29	Frequency Range:	See Test Frequencies Below		

Test Title: EN 61000-4-8 (Magnetic Field Immunity)

Test Frequency	Meets Limit		Susceptibility Threshold Level	Maximum Signal Applied	Comments
(X)kHz ( )MHz ( )GHz	Yes	No	(X)A ( )V ( )kV ( )A/m ( )Vrms ( )dBµA ( )dBµV ( )dBµV/m ( )dBµT		
/60	X		>30 A/m	30 A/m	EUT on X, Y, and Z Axis

Notice of Anomaly: N/A

Witness: N/A

Tested By: _____ Date: 09/18/13
Technician

Approved: _____ Date: 09/18/2015
Project Engineer

Page 1 of 1

WH-1012, Rev. Doc. X.00

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. E 1 of 5
Test Report No. T71013.02-01

ATTACHMENT E

OPERATING ENVIRONMENTAL TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 107 of 129
Certification Test Plan T71379.01
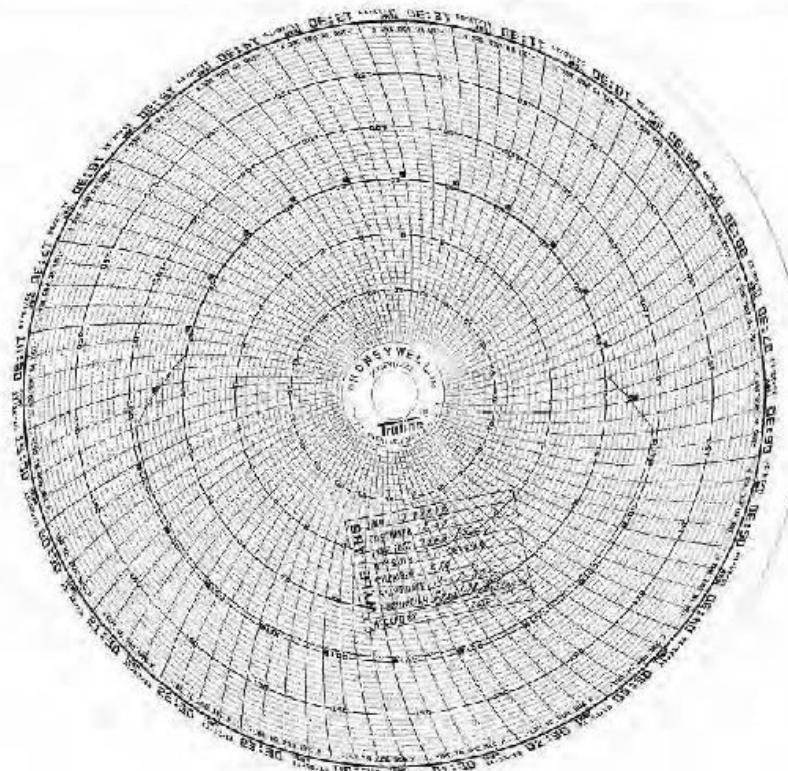
Page No. E 2 of 5
Test Report No. T71013.02-01

TEMPERATURE/POWER VARIATION TEST DATA

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Appendix F, Page No. 108 of 129
Certification Test Plan 171379.01

Page No. K 3 of 5
Test Report No. T71013.02-01
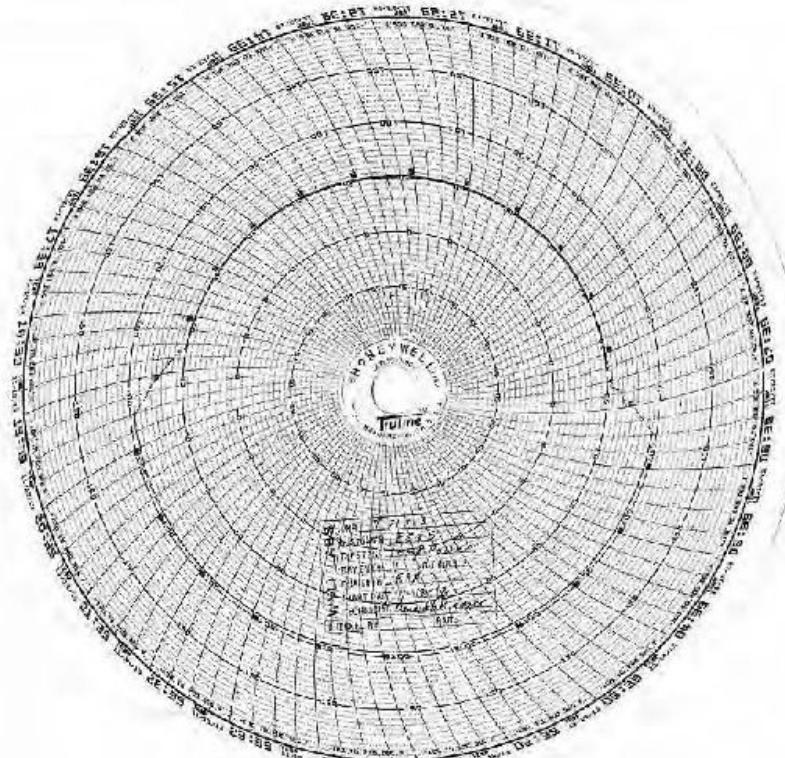
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems

Page No. II-4 of 5
Test Report No. T71013.03-01
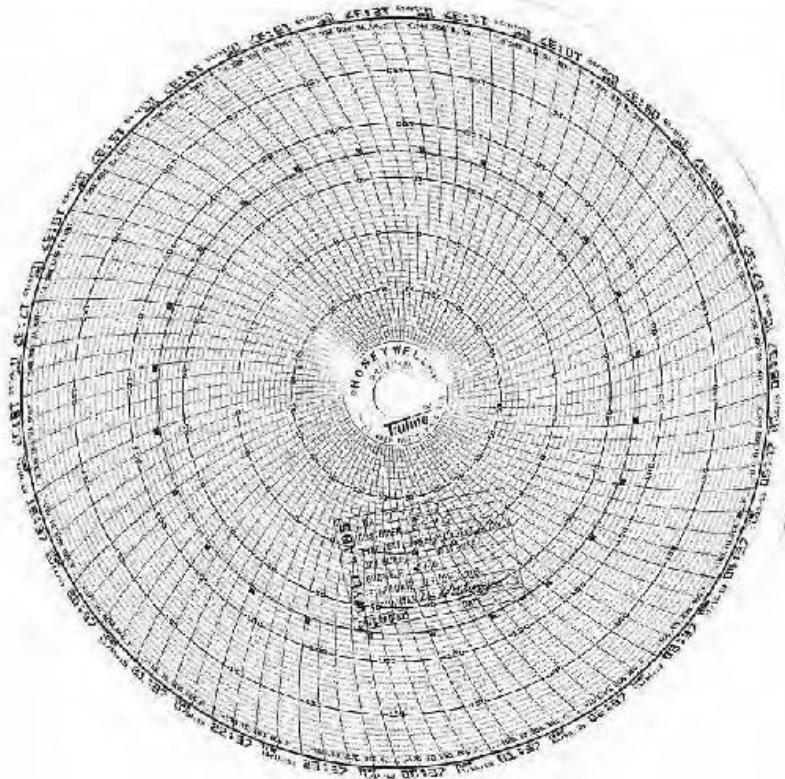
WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. K 5 of 5
Test Report No. T71013.02-01

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 111 of 129
Certification Test Plan T71379.01

Page No. F-1 of 2
Test Report No. T71013.02-01

ATTACHMENT F

PRODUCT SAFETY CERTIFICATE OF CONFORMANCE

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. F-2 of 2
Test Report No. T71013.02-01

wyle
laboratories

7800 Highway 20 West
Huntsville, Alabama 35806
Phone (256) 837-4411
Fax (256) 721-0144
www.wyle.com

CERTIFICATE OF CONFORMANCE

Product Safety Review

Wyle Project No.   T71013-06
Customer PO   ES&S-MSA-TA029
Issue Date   22 October 2013

The device identified below has been reviewed in accordance with the specific requirements of applicable sections of UL60950-1, Standard for Safety for Information Technology Equipment, Second Edition, and the Recommended Practice for Unlabeled Electrical Equipment Evaluation, First Edition, (developed by the American Council for Electrical Safety), and has been found to be in compliance with these requirements.

Product Identification	
Device Description	Voting Device
Manufacturer	Election Systems & Software
Device Model No.	ExpressVote
Device Serial No.	EV0113350037
Electrical Ratings	Input 110-240 VAC – 3A
Hardware Revision	1.0
Power Supply	
Power Supply Description	ITE Power Supply
Manufacturer	Mega Electronics, Inc.
Model No.	PW080A2-1Y24AP
Part No.	MD-24066
Serial No.	MD-24066-ES
Input	100-240 VAC (50-60 Hz) – 2.2A Max.
Output	24 VDC – 6.6A
UL Listed ITE PS	UL File No. E308433

This report is valid for the equipment model and serial numbers indicated in the product identification table above. Wyle makes no endorsement of the equipment reviewed, nor does this evaluation constitute approval of similar equipment. This evaluation does not constitute a product listing.

Brian Coppock NCT, Product Safety Supervisor   10/22/13
iNARTE Certified Product Safety Technician No. PS-00438-NCT

Robert D. Hardy, Department Manager   10/22/13
EMI/EMC/FCC, Product Safety, Election Systems, & Packaging

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. G 1 of 17
Test Report No. T71013.02-01

ATTACHMENT G

INSTRUMENTATION EQUIPMENT SHEETS

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. G-2 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| DATE: | 10/1/2013 | JOB NUMBER: T71013 | | TYPE OF TEST: FCC PART 15 |
| TECHNICIAN: | J. SMITH | CUSTOMER: ES&S | | TEST AREA: OATS 2 |

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	ANTENNA	ELECTROMETRIC	EM-6917A-1	24106	114115	30MHZ - 2GHZ	SEE DATA	9/11/2013	9/11/2015
2	ATTENUATOR	NARDA	766-20	740580	01443	DC-4 GHz	MFG	3/25/2012	3/25/2014
3	EMI TEST RCVR	ROHDE SCHWARZ	ESCI	100586	117803	MULTI	MFG	4/1/2013	4/1/2014
4	LISN	SOLAR	2-107-50-TS-50-N	1125262	01682	MFG	MFG	8/7/2012	8/6/2014
5	LISN	SOLAR	2-107-50-TS-50-N	1125263	01683	MFG	MFG	8/5/2012	8/7/2014
6	TAPE MEASURER	LUFKIN	834SSI	116893	116893	1.5meter	±1mm	7/11/2013	7/12/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 10-1-13   CHECKED & RECEIVED BY: _____ 10/1/2013

Q.A.: _____ 10/01/2013

WH-1029A.REV.APR99   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-3 of 17
Test Report No. T71013.02-01

wyle laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 9/18/2013 JOB NUMBER: T71013 TYPE OF TEST: VVSG 4.1.2.12 MFI

TECHNICIAN: R.CHAMBERS CUSTOMER: ES&S TEST AREA: EMI EXT CHAMBER#3

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	AMPLIFIER	TECHRON	7560	013075	04566 *	600W	NCR	7/8/2008	7/8/2020
2	DATALOGGER	EXTECH	42280	9051859	04926 *	-4°F to 144°F/0-	±1°F / ±3%RH	5/14/2013	5/14/2014
3	DMM	FLUKE	87	78770390	11663D *	MULTI	±0.1%+1	7/16/2013	7/16/2014
4	METER	HOLADAY	HOL-HI5604	76285	11754911	30-2KHz	MFG	2/24/2012	2/24/2014
5	STOP WATCH	HANHART	STRATOS1	110131	110131 r	10HR	5 sec/day	6/26/2013	6/26/2014
6	TAPE MEASURER	LUFKIN	HV1048CME	NSN	02710 *	25/8meters	±1in / ±1mm	5/30/2013	5/30/2015
7	WAVE GEN	AGILENT	33250A	SG40000026	01418 *	MULTI	CERT	12/18/2012	12/28/2013

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ CHECKED & RECEIVED BY: _____ 09/18/2013

9/18/13 QA: _____ 9/18/13

WH-1029A,REV,APR99 Page 1 of 1

Page No. G-4 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE:	10/2/2013	JOB NUMBER:	T71013		TYPE OF TEST:	VVSG SEC. 4.1.2.5 (EPD)
TECHNICIAN:	R.CHAMBERS	CUSTOMER:	ES&S		TEST AREA:	EXT EMI CHAMBER #3

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	DATALOGGER	EXTECH	42280	9051859	04926	-4°F to 144°F/0-	±1°F/±2%RH	5/14/2013	5/14/2014
2	DMM	FLUKE	87	18290044	01472	4VDC	±0.1%+1	12/6/2012	12/6/2013
3	POWER SOURCE	CALIFORNIA INST	1251P/232	L06527	115806	100-240VAC @	±2% FS	2/6/2013	2/6/2014
4	TAPE MEASURER	LUFKIN	HV1048CME	NSN	02708	8 meters	±1mm	4/24/2012	4/24/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 10/2/13   CHECKED & RECEIVED BY: _____ 10/02/2013

WH-1039A,REV.APR'99   QA: _____ 10/2/13   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 117 of 129
Certification Test Plan T71379.01

Page No. G-5 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| DATE: | 19/18/2013 | JOB NUMBER: | 771013 | | TYPE OF TEST: | WYSG 4.1.2.10 EMS WOP11 |
| TECHNICIAN | R.CHAMBERS | CUSTOMER: | ES&S | | TEST AREA | EMI LAB CHAMBERS 5 |

No.	Description	Manufacturer	Model	serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	AMPLIFIER	AMP RESEARCH	500W100A	23268	03841	80MHz-1GHz	MCR	8/29/2013	8/29/2014
2	ANTENNA	AR	AT5080	0030839	03747	30-6000MHz	MCR	3/28/2013	3/28/2014
3	DATA LOGGER	EXTECH	42280	9051889	04126	-4°F to 140°F	±1°F/±1%RH	5/14/2013	5/14/2014
4	DIR COUPLER	AR	DC3001A	311591	RT 464	100MHz-1GHz	MFC	9/9/2013	9/9/2014
5	DVM	FLUKE	87V	8293846	04474	4VDC	±0.15+1	12/5/2012	12/5/2013
6	ISOTROPIC PROBE	AMP RESEARCH	FP2000	7657	L17657	10 KHz - 1 GHz	±0.7 dB	11/9/2012	11/9/2013
7	SIG GEN	AEROFLEX	2023A	223306068	IO30296	9K-1.2G Hz	MFC	10/23/2012	10/23/2013
8	SPEC ANAL	AGILENT	E4446A	MY46183401	R00410	3Hz-44GHz	MFC	4/15/2013	4/16/2014
9	STOP WATCH	HANHART	STRATOS1	10133	10133	10MR	5 sec/sec	9/11/2013	9/11/2014
10	TAPE MEASURE	LUFKIN	HV1048CME	NSN	09746	25' Seamless	±1 at inches	3/19/2013	3/20/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _[signature]_ CHECKED & RECEIVED BY: _[signature]_ 10/08/2013

QA _[signature]_ 10/10/13

WH-1029A REV APR99

Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-6 of 17
Test Report No. T71013.02-01

wyle laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE:	9/23/2013	JOB NUMBER: T71013			TYPE OF TEST: VVSG 4.2.11 (CRFI)	
TECHNICIAN:	R.CHAMBERS	CUSTOMER: ES&S			TEST AREA: EMI CHAMBER#3	

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	AMPLIFIER	AMP RESEARCH	500A100A	0324951	04816	10kHz-100MHz	NCR	8/12/2013	8/12/2014
2	ATTEN	BIRD	23-T-MN	0129	03142	50 OHMS 25 W.	MFG	6/24/2013	6/24/2014
3	ATTENUATOR	NARDA	769-6	03180	04860	DC to 6GHz	MFG	5/25/2013	5/25/2014
4	DATALOGGER	EXTECH	42280	5051859	04926	-4°F to 144°F/0-	±1°F / ±3%RH	5/14/2013	5/14/2014
5	DIR COUPLER	AR	DC3010A	311894	R11894	10MHZ-1GHZ	MFG	9/5/2013	9/5/2014
6	PASSIVE	FISHER CC	FCC-801-150-50-CDN	04049/04050	110405	150KHZ - 230M	MFG	7/20/2012	7/20/2014
7	SIG GEN	AEROFLEX	2073A	202305/068	R70230	9KHz-1.2GHz	MFG	10/23/2012	10/23/2013
8	SPEC ANAL	AGILENT	E4446A	MY46180335	R80335	MFG	MFG	6/19/2013	6/19/2014
9	SPEC ANAL	ROHDE SCHWARZ	FSP30	100882	117004	9kHz to 30GHz	MFG	10/3/2012	10/3/2013
10	STOP WATCH	HANHART	STRATOS1	110131	110131	10HR	5 sec/day	6/24/2013	6/24/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 9/22/13 CHECKED & RECEIVED BY: _____ 09/23/2013 QA: _____ 9/23/13

WH-1029A,REV,APR 99   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. G-7 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 10/1/2013 JOB NUMBER: T71013 TYPE OF TEST: VVSG SECTION 4.1.2.7 (LST)

TECHNICIAN: R.CHAMBERS CUSTOMER: ES&S TEST AREA: EXT EMI CHAMBER#1

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	COUPL NETWK	HAEFELY TRENCH	PCD100	119261	R90540	MFG	MFG	7/10/2013	7/10/2015
2	DATALOGGER	GE TECH	4225D	9651859	04976	-4°F to 144°F/0~	±1°F/±5%RH	2/14/2013	5/14/2014
3	IMPULSE MODULE	HAEFELY TRENCH	PIM100	1103	R90538	0kV	MFG	7/10/2013	7/10/2015
4	OSCILLOSCOPE	TEKTRONIX	DPO5104	C012091	01737	MFG	MFG	10/23/2012	10/23/2013
5	STOP WATCH	HANHART	STRATOS1	1.0131	11013.1	10Hz	5 sec/day	8/24/2013	8/24/2014
6	SURGE TSTR	HAEFELY TRENCH	PSURGE8.00	139210	R90527	MULTI	MFG	7/10/2013	7/10/2015

This is to certify that the above instruments were calibrated using state of the art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ CHECKED & RECEIVED BY: _____ 10/01/2013

WH-1029A.REV.APR99   10/1/13 QA: Brenda Moore 10/1/13

Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. C-8 of 17
Test Report No. T71013.02-01

wyle laboratories

INSTRUMENTATION EQUIPMENT SHEET

| DATE: | 10/11/2013 | JOB NUMBER: | T71013 | | TYPE OF TEST: | VVSG SEC 4.7.1 |
| TECHNICIAN: | R.CHAMBERS | CUSTOMER: | ES&S | | TEST AREA: | CHAMBER 51 |

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	DMM	FLUKE	87V	18290046	01474	4VDC	±0.1%+1	12/6/2012	12/6/2013
2	POWER SOURCE	CALIFORNIA INST	1251RP/IE	L06361	117347	0-420VAC RMS	1%	3/20/2013	3/20/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ CHECKED & RECEIVED BY: _____ 10/11/12

W04-1029A.REV.APR'03 Q.A.: Brenda Musco 10/11/13

Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. G-9 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| DATE: | 10/11/2013 | JOB NUMBER: | T71013 | | TYPE OF TEST: | TEMP/ POWER |
| TECHNICIAN: | T. FURNER | CUSTOMER: | ES&S | | TEST AREA: | CHAMBER 51 A |

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	TEMP	MICRISTAR	828-011	10603	148418	-400-200°F	.PSIG	12/5/2012	12/5/2013
2	TEMP IND	NEWPORT	Q2001TC	N/A	116533	TYPE T	±1.5%	12/5/2012	12/5/2013
3	TEMP RECORDER	HONEYWELL	DR4307	02N48805009	109030	-200-600°F	4°F	12/5/2012	12/5/2013

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _(signature)_ 10/11/13   CHECKED & RECEIVED BY: _(signature)_ 10/11/13

QA: _Brenda Mirra_ 10/11/13

WH-1029A,REV.APR99   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. G-10 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| DATE: | 10/15/2012 | ICP NUMBER: | T1517 | TYPE OF TEST: | RECORDING DUST |
| TECHNICIAN: | T TURNER | CT STAMPER: | FS25 | TEST AREA: | CHAMBER 96 |

S/N	Equipment	Manufacturer	Model	Serial #	WO ID	Range	Accuracy	Cal Date	Cal Due
1	TRANSMITTER	RYCAL	CT-82VAR	112.55	110/65	0-10.58 IN	1.5u	9/X/2015	2(22/15)14
2	INC 2	DAVIS CLEVELAND	2GP140/40-15	26.208	110/16	0-19.75	45/GPS	1/25/2012	1/2/2214
3	5-20 WATCH	EXTECH	3655W	N-N	99/50	MPO	7.9MHV	1/15/2002	1/13/2014
4	TEMP COUNTER	WATLOW	-FR1	NA	12.775	-200 TO 660 F	10.1%	1/22/2003	1/23/2014
5	TEMP	WATLOW	LIMIT SE	128.56	-822C	MULTI	MEI	1/10/7/2017	1/13/2015
6	TEMP RECORDER	HOBE-1211	DR15AE	420Y110/1110	112/72	210-313F~	1%	1/22/2013	10/22/14

We do hereby certify that the above instruments used in this testing process present accuracies with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION _____ 10/15/13   CHECKED & RECEIVED BY: _____ 10/15/13

WIL 1029A REV A 9/90   QA _____ 9/8/2015

Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. G-11 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 10/4/2013   JOB NUMBER: T71013   TYPE OF TEST: RAIN EXPOSURE
TECHNICIAN: T.TURNER   CUSTOMER: ISAS   TEST AREA: ENV LAB

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	STOPWATCH	USTECH	X3515	NSN	912 X	.01s	5 miles	1/15/2013	1/15/2014
2	TAPE MEASURE	LUFKIN	11-706	NSN	9145	25'	±1/32"	12/1/2012	12/1/2013

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____   CHECKED & RECEIVED BY: _____

WYLE-180WA REV 4/2006   QA: _____

Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. G-12 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| DATE: | 1/27/2011 | JOB NUMBER: | T71013.01 | TYPE OF TEST: | VIBRATION |
| TECHNICIAN: | GLENNON | CUSTOMER: | ES&S VOTING SYSTEMS | TEST AREA: | DYN LAB |

No.	Description	Manufacturer	Model	Serial #	WYLE#	RANGE	ACCURACY	Cal. Date	Cal Due
1	ACCELEROMETER	ENDEVCO	7704A-50	31/72	03700	±) pc/g (70°F)	±2%	9/16/2013	9/16/2014
2	CHARGE	ENDEVCO	2775	ALEX	00700	GAIN	±1.5%	4/16/2013	10/16/2013
3	DMM	FLUKE	45	56521.78	11429?	mV	1.00%	6/25/2013	6/2/2014
4	VIB CONTROL	SPECTRAL DYN	2632-6700-1	2400-1256	115298	N/A	N/G	1/4/2013	1/04/2014

This is to certify that the above instruments were calibrated using standards whose accuracies are traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _[signature]_ 9/5/13   CHECKED & RECEIVED BY: _[signature]_ 9/6/13

(TR-1000A, REV A, F/99)   QA: _[signature]_ 9/6/13   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 123 of 129
Certification Test Plan T71379.01

Page No. G-13 of 17
Test Report No. T70013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 9/9/2013   JOB NUMBER: T71379.01   TYPE OF TEST: HOT/COLD TEMP
TECHNICIAN: LARRY IVEY   CUSTOMER: ESES   TEST AREA: ENV CHAMBER 11

No.	Description	Manufacturer	Model	Serial	WYLE ID	RANGE	ACCURACY	CAL DUE	Cal Due
1	TEMP ALARM	THERMOLYNE	THERMALARM	900176	77040	TYPE T	+1°C	123.102.2	12/11/2013
2	TEMP	THERMOTRON	8200	100529	77048	1250 2°F	3.TS	121.102.1	12/11/2013
3	TEMP RECORDER	HONEYWELL	TR4002	06D761837007	67780	250&00°F	+1%	121.102.2	12/11/2013

This is to certify that the above instruments were calibrated using standards whose accuracy is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _[signature]_   CHECKED & RECEIVED BY: _[signature]_ 4/5/2013

9/H-1083A REV APR 93   CAL: _[signature]_ 9/9/13

Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

National Technical Systems
Huntsville Facility

Page No. G-14 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 12/1/2013   JOB NUMBER: T71013   TYPE OF TEST: Low Temp

TECHNICIAN: T. HARDMAN   CUSTOMER: USAS   TEST AREA: C1131

No.	Identification	Manufacturer	Model	Serial #	Wyle #	Range	Accuracy	Cal Due	Cal Date
1	TEMP AL ARM	TESTER TYPE 76	THERMALARM	98594	0362	TYPE T	1°C	3/11/2013	12/1/2013
2	TEMP	CI TRANSTRON	4660	94579	03681	125-325°	2°C	01/2013	12/1/2013
3	TEMP RECORDER 4	TRONIA WELL	LR-02	1YYH189701	12259	300 to 107	2°C	12/11/2013	12/1/2013

This is to certify that the above instruments were calibrated using master reference standards traceable to the standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _[signature]_ 10-1-15   CHECKED & REVIEWED BY: _[signature]_ 10/1/5

WELL REGARDING AT 050   QA: _[initials]_   Page 1 of 1

WYLE LABORATORIES, INC.
Huntsville Facility

Appendix F, Page No. 123 of 129
Certification Test Plan T71379.01

Page No. G-15 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

| DATE: | WE/2013 | JOB NUMBER: T71013.01 | YOU 440 TYPE: TEMPHUM |
| TECHNICIAN: | LARRY IVEY | CUSTOMER: BSA2 | TEST AREA: ENV CHAMBER 19 |

IP	Descript.	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	CAL JAN	Cal Due
	CHART RECORDER	HONEYWELL	DPR180-III	RSV9 SERVA	11847	32.75 MPH	1.5%-FS	3-1-2013	3/1/2014
2	TEMP ALARM	THERMOTRON	THERM-ALARM	820	4423-1	TYPE T	±1°C	1/8/2013	1/8/2014
3	TEMP	THERMOTRON	820	820	2 SPC1	-217.303°F	28%	8/1/2013	8/8/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards of accuracy traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 9-5-13   CHECKED & RECEIVED BY: _____ 9/5/13

QA: _____   Exordo   _____   5/5/13

Rev 1 of 1

WYLE LABORATORIES. INC.
Huntsville Facility

Page No. G-16 of 17
Test Report No. T71015.12-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

No.	Description	Manufacturer	Model	Serial #	Wyle #	Range	Accuracy	Cal Date	Cal Due

This is to certify that the above instruments were tested using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

WYLE LABORATORIES, INC.
Huntsville Facility

Page No. G-17 of 17
Test Report No. T71013.02-01

wyle
laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 11/8/29C   SO NUMBER: T71013   TYPE OF TEST: VVSPSEC4.T1
TECHNICIAN: ALAN SIMMONS   CUSTOMER: ESAS   TEST AREA: CHAMBER S1

No.	Description	Manufacturer	Model	Serial	Wyle #	Range	Accuracy	Cal Date	Cal Due
	OHM	F. INC.	B/N	12XQ096	1.074	1VDC	+/- 1%	12/5/2012	12/5/2013
	POWER SOURCE	CALIFORNIA INST	25 K700	1666	049	0-300V,RMS	1%	12/28/	12/30.014

This is to certify that the above instruments were calibrated using standard of the art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTS CAL. BY: _Alan Simmons_   CHECKED & RECEIVED BY: _Alan Simmons_ 11-11-13
                      11-11-13
WH FORM REV. 2/10/2?   _[signature]_ Nov 11, 2013

                                                                (Pg. 1 of 1)

WYLE LABORATORIES, INC.
Huntsville Facility

APPENDIX D

FUNCTIONAL CONFIGURATION AUDIT (FCA) ISSUES REPORT

ID	Category	Status	Summary
107	FCA	closed	Message displayed when attempting to generate hash of Firmware/OS/Bootloader with Include Graphics Option checked. "ExpressVote General Error. Unknown Error occurred. Please Contact an Election Official. An Error has occurred."
126	FCA	closed	Open Primary: Voting in more than one party's contests caused candidates to display as selected, but not print.
134	FCA	closed	When attempting to print a ballot image in ElectionWare, if a new printer is selected when attempting to print ballot images, the image will print to the previously selected printer.
139	FCA	closed	When attempting to print a ballot image in ElectionWare, pressing the "X" button to close the printer window causes the image to be printed anyways.
140	FCA	closed	Enable/Disable BOL Scanning option is stated incorrectly in the system log as "Bypass Graphics/Audio Check Option Enabled/Disabled."
141	FCA	closed	For DS200 tabulation in ERM, the option "Update DS200 Results from SFTP" is not greyed out.
142	FCA	closed	The DS200 was incorrectly displaying the ballot counts for the ExpressVote cards on the QR Status Code screen. The ExpressVote cards were being counted as DS200 ballots after the polls were closed.

APPENDIX E

TECHNICAL DATA PACKAGE (TDP) ISSUES REPORT

ID	Category	Status	Summary
89	TDP	closed	EVS5200_SMM00_DS200
90	TDP	closed	EVS5200_SMM00_DS200, Chapter 7, pg. 30 & pg. 31
91	TDP	closed	EVS5200_DOC_D_1200_ChangeNotes
92	TDP	closed	EVS5200_SOP00_ExpressVote, pg. 241 & 242
93	TDP	closed	EVS5200_SSS00
94	TDP	closed	EVS5200_SOP00_ELS
95	TDP	closed	EVS5200_SOP00_ElectionWare04_Deliver
96	TDP	closed	EVS5200_SDS00_ERM
97	TDP	closed	EVS5200_SDS00_ERM01_Appendices
98	TDP	closed	EVS5200_P_D_0500_UsabilityTestReports
99	TDP	closed	EVS5200_SMM00_ExpressVote, To Set the Serial Number, pg. 25-26
100	TDP	closed	EVS5200_SMM00_ExpressVote, Chapter 3: System Maintenance Menu
101	TDP	closed	EVS5200_SMM00_ExpressVote, Changing Battery, pg. 70
102	TDP	closed	EVS5200_SMM00_ExpressVote, pg. 70-71
103	TDP	closed	EVS5200_SMM00_ExpressVote, Front Cover
104	TDP	closed	EVS5200_C_D_0100_SysOvr: Attachment 2, Voting System Summary: page "1" (pdf page 54)
105	TDP	closed	EVS5200_C_D_0100_SysOvr: Attachment 2, Voting System Summary: page "6" (pdf page 59)
106	TDP	closed	EVS5200_C_D_0100_SysOvr: Attachment 2, Voting System Summary: Voting System Equipment.
108	TDP	closed	EVS5200_DOC_SOP_ExpressVote, (for example, pgs. 23,112)
109	TDP	closed	EVS5200_DOC_SOP_ExpressVote, Chapter 12: User Acceptance Checklist, pg. 30
110	TDP	closed	EVS5200_DOC_SOP_ExpressVote, TABLE 27, Placement of ExpressVote Security Seals, pg. 77
111	TDP	closed	EVS5200_DOC_SOP_ExpressVote, Ballot Boxes, pg. 76
112	TDP	closed	EVS5200_CM_SPC00_SysSecuritySpec
113	TDP	closed	EVS5200_CM_SPC00_SysSecuritySpec, sections 1.2.5, 1.4.6, 3.3.2.2, & 3.3.4.2
114	TDP	closed	EVS5200_CM_SPC00_SysSecuritySpec, Section 3.3.2.2 pg. 48
115	TDP	closed	EVS5200_DOC_SOP_ExpressVote, Securing the ExpressVote Unit, Reference, pg. 75
116	TDP	closed	EVS5200_DOC_SOP_ExpressVote, Securing the ExpressVote Unit, pg. 75
117	TDP	closed	EVS5200_DOC_SOP_ExpressVote, Securing the ExpressVote Unit, pg. 75
118	TDP	closed	EVS5200_DOC_SOP_ExpressVote, throughout document
119	TDP	closed	EVS5200_DOC_SOP_ExpressVote, TABLE 32: Glossary, pg. 122
120	TDP	closed	Multiple documents. There are several references to a lockable "rear" paper chute access door on the ExpressVote.
121	TDP	closed	EVS5200_DOC_SOP_ExpressVote, Election Day Security, pg. 230 & EVS5200_CM_SPC00_SysSecuritySpec, ExpressVote Spec Sheet
122	TDP	closed	ExpressVoteHW_M_SPC_0310_HWSpec, I.4.1.4.1.a (pg. 12)
123	TDP	closed	EVS5200_DOC_SOP_12_EW04Deliver, Chapter 3: DS/ExpressVote Security, pg. 10
124	TDP	closed	EVS5200_DOC_SOP_ExpressVote, Chapter 6, Setting the Maintenance Security Code, pg. 54
125	TDP	closed	EVS5200_DOC_SOP_12_EW04Deliver, Chapter 3: DS/ExpressVote Security, pg. 10
127	TDP	closed	EVS5200_DOC_SOP_11_EW01Admin Set User Password Policies pgs. 49 & 111
128	TDP	closed	EVS5200_DOC_SOP_ExpressVote, Clear and Initialize ExpressVote, Step 7, pg. 89
129	TDP	closed	EVS5200_DOC_SOP_ExpressVote, Installing & Removing the Election Media Device, pg. 123
130	TDP	closed	EVS5200_C_D_0100_SysOvr, SpecSheet_ExpressVote_HWv.1.0, (pdf pg. 60)
131	TDP	closed	EVS5200_DOC_SOP_ExpressVote, Firmware/OS/Bootloader - Export to Media, pg. 67
132	TDP	closed	EVS5200_DOC_SOP_ExpressVote
133	TDP	closed	EVS5200_DOC_SOP_EW01Admin, Chapter 9: Getting Started, Start ElectionWare, pg. 23
135	TDP	closed	EVS5200_DOC_SOP_ExpressVote
136	TDP	closed	ExpressVoteHW_M_SPC_0310_HWSpec
137	TDP	closed	EVS5200_DOC_SOP_EW04Deliver, Chapter 4: AutoMARK Security, pg. 13
138	TDP	Closed	Remove all references to M100 and M650 in multiple docs

APPENDIX F

NOTICES OF ANOMALY

wyle
laboratories

NOTICE OF ANOMALY	DATE: 02/18/2014	ORIGINAL

Notice No: 1	P.O. Number: TA037	Contact No: N/A

Customer: ES&S	Wyle Job Number: T71379.01

Notification Made To: Sue McKay	Notification Date: 2/18/14

Notification Made By: Stephen Han	Via: Email

Category: ☒Specimen ☐Procedure ☐Test Equipment	Date of Anomaly: 01/28/14
Part Name: ExpressVote	Part Number:
Test: Usability and Accessibility	Serial/ID Number: EV0113350025
Specification: 2005 VVSG Volume I	Paragraph/Section Number: 3.1.6 d i

REQUIREMENTS: 2005 VVSG Volume I section 3.1.6.d i

The voting process shall be designed to minimize interaction difficulties for the voter.
    d. Input mechanisms shall be designed to minimize accidental activation.
        i. On touch screens, the sensitive touch areas shall have a minimum height of 0.5 inches and minimum width of 0.7 inches. The vertical distance between the centers of adjacent areas shall be at least 0.6 inches, and the horizontal distance at least 0.8 inches.

DESCRIPTION OF ANOMALY:

The horizontal distance between the centers of the keys on touch screen keyboard was less than 0.8 inches.

DISPOSITION * COMMENTS * RECOMMENDATIONS:

The final disposition is pending a root cause analysis to be presented by the client.

Potential 10 CFR Part 21	☐Yes	☒No
Responsibility to analyze anomalies and comply with 10 CFR PART 21	☐ Customer	☒ Wyle
CAR Required: ☐Yes ☒No	CAR Number:	

VERFICATION	
Test Witness:	Project Engineer: _Stephen H_ 2/18/14
Representing:	Project Manager: _Fred Parks_ 2/18/14
Quality Assurance: Brenda Moss 2/18/14	

WH-1066, Rev. MAR '09   Page 1 of 1

wyle laboratories

NOTICE OF ANOMALY		DATE: 02/18/2014	ORIGINAL

Notice No: 2	P.O. Number: TA037		Contact No: N/A
Customer: ES&S		Wyle Job Number: T71379.01	
Notification Made To: Sue McKay		Notification Date: 2/18/14	
Notification Made By: Stephen Han		Via: Email	

Category: ☒Specimen ☐Procedure ☐Test Equipment	Date of Anomaly: 01/29/14
Part Name: ExpressVote	Part Number:
Test: Acoustic Noise Level and Hearing Aid Compatibility	Serial/ID Number: EV0113350052
Specification: 2005 VVSG Volume I	Paragraph/Section Number: 3.2.2.2 c vi

REQUIREMENTS: 2005 VVSG Volume I section 3.1.6.d i

The accessible voting station shall be accessible to voters who are blind.
   c. All voting stations that provide audio presentation of the ballot shall conform to the following requirements:
      vi. The voting machine shall provide a volume control with an adjustable volume from a minimum of 20dB SPL up to a maximum of 100 dB SPL, in increments no greater than 10 dB.

DESCRIPTION OF ANOMALY:

The ExpressVote would not allow the user to decrease the volume at the start of each voting session.

DISPOSITION * COMMENTS * RECOMMENDATIONS:

The final disposition is pending a root cause analysis to be presented by the client.

Potential 10 CFR Part 21	☐Yes	☒No		
Responsibility to analyze anomalies and comply with 10 CFR PART 21			☐ Customer	☒Wyle
CAR Required: ☐Yes ☒No		CAR Number:		

VERFICATION	
Test Witness:	Project Engineer: _Stephen H_ 2/18/14
Representing:	Project Manager: _Fred Pald_ 2/18/14
Quality Assurance: _Bonda Moore 2/18/14_	

WH-1066, Rev. MAR '09   Page 1 of 1

NTS
WE ENGINEER SUCCESS
HUNTSVILLE OPERATIONS

NOTICE OF ANOMALY		DATE: 04/09/2014	
Notice No: 3	P.O. Number: TA037		Contact No: N/A
Customer: Election Systems and Software (ES&S)		Wyle Job Number: T71379.01	
Notification Made To: Sue McKay		Notification Date: 04/09/2014	
Notification Made By: Stephen Han		Via: Email	
Category: ☒Specimen ☐Procedure ☐Test Equipment		Date of Anomaly: 04/09/2014	
Part Name: EVS 5.2.0.0		Part Number: N/A	
Test: TDP Review		Serial/ID Number: N/A	
Specification: 2005 VVSG Volume I		Paragraph/Section Number: Section 2	

REQUIREMENTS:

The EVS 5.2.0.0 Voting System Technical Data Package (TDP) shall be reviewed for accuracy, completeness, and compliance to the EAC 2005 VVSG.
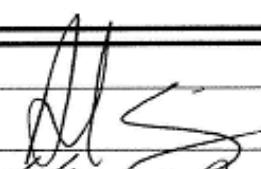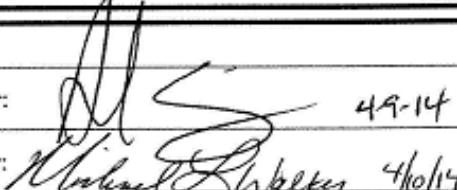
DESCRIPTION OF ANOMALY:

Review of the summited documentation revealed discrepancies between the TDP and the EAC 2005 VVSG requirements. Functional testing also identified text in the TDP that conflicted with the actual operations of the system. Each noted discrepancy was documented in detail in the Wyle generated TDP issues matrix that is on file as raw data.

DISPOSITION * COMMENTS * RECOMMENDATIONS:

EVS 5.2.0.0 is a Modification of a previously certified system. As such the TDP was only reviewed where modified or where impacted by system modification. ES&S corrected each nonconformance observation and resubmitted the associated documents for review. This process continued until it appeared that the TDP complied with all applicable requirements.

Potential 10 CFR Part 21	☐Yes	☒No	
Responsibility to analyze anomalies and comply with 10 CFR PART 21		☐ Customer	☐ Wyle
CAR Required: ☐Yes ☒No	CAR Number:		

VERFICATION	
Test Witness: None	Project Engineer: _[signature]_ 4-9-14
Representing: N/A	Project Manager: _[signature]_ 4/10/14
Quality Assurance: Brenda Moore 4/10/14	

WH-1066, Rev. MAR '09   Page 1 of 1

⬤NTS
WE ENGINEER SUCCESS
HUNTSVILLE OPERATIONS

NOTICE OF ANOMALY			DATE:	04/09/2014	
Notice No: 4		P.O. Number: TA037		Contact No: N/A	
Customer: Election Systems and Software (ES&S)			Wyle Job Number: T71379.01		
Notification Made To: Sue McKay			Notification Date: 04/09/2014		
Notification Made By: Stephen Han			Via: Email		
Category: ☒Specimen ☐Procedure ☐Test Equipment			Date of Anomaly: 04/09/2014		
Part Name: EVS 5.2.0.0			Part Number: N/A		
Test: Source Code Review			Serial/ID Number: N/A		
Specification: 2005 VVSG Volume I			Paragraph/Section Number: 5		

REQUIREMENTS:

2005 VVSG Volume I section 5

Software used in voting systems shall meet the essential design and performance characteristics detailed in Section 5 of the EAC 2005 VVSG.

DESCRIPTION OF ANOMALY:

Review of the submitted source code modules comprising the EVS 5.2.0.0 system revealed deviations from the standard. These anomalies are documented in detail in the Wyle generated review reports on file as raw data.

DISPOSITION * COMMENTS * RECOMMENDATIONS:

Upon completion of the review for each source code submission, a technical summary report of all identified standards violations was sent to ES&S for resolution. ES&S then corrected the reported violations and re-submitted the source code for re-review. This process was repeated as many times as necessary until all identified standards violations were corrected.

Potential 10 CFR Part 21	☐Yes	☒No			
Responsibility to analyze anomalies and comply with 10 CFR PART 21			☐ Customer	☐ Wyle	
CAR Required: ☐Yes ☒No			CAR Number:		

VERFICATION		
Test Witness: None	Project Engineer: *[signature]* 4/9/2014	
Representing: N/A	Project Manager: *[signature]* 4/10/14	
Quality Assurance: Brenda Mena 4/10/14		

WH-1066, Rev. MAR '09   Page 1 of 1

NTS
HUNTSVILLE OPERATIONS

NOTICE OF ANOMALY		DATE: 04/14/2014	ORIGINAL

Notice No: 5 Rev A	P.O. Number: TA037		Contact No: N/A
Customer: Election Systems and Software (ES&S)		Wyle Job Number: T71379.01	
Notification Made To: Sue McKay		Notification Date: 04/14/2014	
Notification Made By: Stephen Han		Via: Email	

Category: ☒Specimen ☐Procedure ☐Test Equipment	Date of Anomaly: 04/09/2014
Part Name: EVS 5.2.0.0	Part Number: N/A
Test: FCA	Serial/ID Number: N/A
Specification: 2005 VVSG Volume II	Paragraph/Section Number: 6.7

REQUIREMENTS:

A Functional Configuration Audit (FCA) of the EVS 5.2.0.0 system shall be performed in accordance with Section 6.7 of Volume II of the VVSG. The purpose of the FCA is to verify that the system performs as documented in the ES&S-supplied technical documentation during the EVS 5.2.0.0 test campaign.

DESCRIPTION OF ANOMALY:

During performance of the FCA of EVS 5.2.0.0, Wyle discovered 7 discrepancies related to system functionality.

1. Message displayed when attempting to generate hash of Firmware/OS/Bootloader with Include Graphics Option checked. "ExpressVote General Error. Unknown Error occurred. Please Contact an Election Official. An Error has occurred."
2. Open Primary on the ExpressVote: Voting in more than one party's contests causes candidates to display as selected, but not print.
3. When attempting to print a ballot image in ElectionWare, if a new printer is selected when attempting to print ballot images, the image will print to the previously selected printer.
4. When attempting to print a ballot image in ElectionWare, pressing the "X" button to close the printer window causes the image to be printed anyways.
5. Enable/Disable BOL Scanning option is stated incorrectly in the system log as "Bypass Graphics/Audio Check Option Enabled/Disabled."
6. For DS200 tabulation in ERM, the option "Update DS200 Results from SFTP" is not greyed out.
7. The DS200 was incorrectly displaying the ballot counts for the ExpressVote cards on the QR Status Code screen. The ExpressVote cards were being counted as DS200 ballots after the polls were closed.

DISPOSITION * COMMENTS * RECOMMENDATIONS:

Upon completion of the review for each source code submission, a technical summary report of all identified standards violations was sent to ES&S for resolution. ES&S then corrected the reported violations and re-submitted the source code for re-review. This process was repeated as many times as necessary until all identified standards violations were corrected.

Potential 10 CFR Part 21	☐Yes	☒No	
Responsibility to analyze anomalies and comply with 10 CFR PART 21	☐ Customer	☐ Wyle	
CAR Required: ☐Yes ☒No	CAR Number:		

VERFICATION	
Test Witness: None	Project Engineer: _(signature)_ 4/14/14
Representing: N/A	For Project Manager: _(signature)_ Wallen 4/14/14
Quality Assurance: Brenda Mouse 4/22/14	

WH-1066, Rev. MAR '09   Page 1 of 1

APPENDIX G

WARRANT OF ACCEPTING CHANGE CONTROL RESPONSIBILITY

Warrant of Accepting Change Control Responsibility

Election Systems & Software, Inc. (ES&S) understands its responsibility to ensure that any system bearing the U.S Election Assistance Commission (EAC) mark of certification, or otherwise represented as EAC certified, is configured consistent with the system certified by the EAC and EAC certification documentation. Specifically, it is warranted that any EVS 5.2.0.0 voting systems subsequently delivered to a customer after receiving EAC certification (as an EAC Certified System) will meet all configuration requirements at the time of delivery as set forth by EAC's certified documentation. It is further warranted that any fielded system modified by ES&S for the purposes of becoming an EAC certified system will also meet the configuration requirements as set forth by the same certification documentation. Voting system configurations tested and certified by the EAC may contain alternative configurations composed of varying, approved components.

Modifications inconsistent with the EAC's Certification documentation shall not be made by ES&S, unless authorized by the EAC as a de minimis change (per Section 3.5 of the Voting System Testing and Certification Program Manual) or a certified modification (per section 3.4.3 of the Voting System Testing and Certification Program Manual).

Attested by: Election Systems & Software, Inc.

Signed _Sue McKay_   Date: _4/4/14_

Printed _Sue McKay_   Date: _4/4/14_

Page 1 of 1

"Maintaining Voter Confidence. Enhancing the Voting Experience."
11208 John Galt Boulevard • Omaha, NE 68137 USA • Phone: 402.593.0101 • Toll-Free: 1.800.247.8683 • Fax: 402.593.8107
• www.essvote.com

APPENDIX H

ES&S ATTESTATION OF DURABILITY

Election Systems & Software

December 19, 2013

Mr. Frank Padilla
Wyle Laboratories
7800 Madison Blvd
Huntsville, AL 35806

Dear Mr. Padilla:

This letter is the attestation of Election Systems & Software (ES&S) relative to 2005 VVSG Volume I – Section 4.3.2, regarding the durability of the voting system in keeping with the conclusion of EAC RFI 2008-05.

ES&S attest that the EVS 5.2.0.0 system under test was designed to withstand normal use without deterioration and without excessive maintenance costs for a period of ten years.

Do not hesitate to contact me if you have any question regarding this attestation.

Sincerely,

Sue McKay
Director of Certification

"Maintaining Voter Confidence. Enhancing the Voting Experience."
11200 John Galt Boulevard – Omaha, NE 68137 USA – Phone: 402.593.0101 – Toll Free: 1.800.247.8683 – Fax: 402.593.8107 – www.essvote.com

National Technical Systems
Huntsville Facility

APPENDIX I

INSTRUMENTATION SHEETS

---

wyle laboratories

INSTRUMENTATION EQUIPMENT SHEET

| DATE: | 1/8/2014 | JOB NUMBER: | T71379.01 | TYPE OF TEST | ELECTRICAL SUPPLY |
| TECHNICIAN: | A. STEWART | CUSTOMER: | ES&S | TEST AREA: | VSTL LAB |

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	STOP WATCH	HANHART	STRATOS1	110132	110132	10HR	5 sec/day	9/11/2013	9/11/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _____ 1/8/14   CHECKED & RECEIVED BY: _____ 1/8/14

WH-1029A,REV,APR'99   Q.A.: _____ 1/8/14

Page 1 of 1

wyle laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE:	1/27/2014	JOB NUMBER: T71379.01		TYPE OF TEST	USABILITY ACCESSIBILITY
TECHNICIAN:	A STEWART	CUSTOMER: ES&S		TEST AREA:	VSTL LAB

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	PUSH-PULL GAGE	CHATILLON	DPP-50	NSN	102211	50 LBS	± 0.5%	1/24/2014	7/24/2014
2	STEEL RULER	STARRETT	22551510	N/A	115571	900mm	±0.1mm	1/24/2014	1/24/2019

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _Adam Stewart_ 1/27/2014   CHECKED & RECEIVED BY: _____ 1/27/14

Q.A.: _Patrick Brewington_ 1/27/14

WH-1029A,REV,APR'99

Page 1 of 1

wyle laboratories

INSTRUMENTATION EQUIPMENT SHEET

DATE: 1/29/2014   JOB NUMBER: T71379.01   TYPE OF TEST ACOUSTIC

TECHNICIAN: D. LEE   CUSTOMER: ES&S   TEST AREA: EMI CHAMBER 1

No.	Description	Manufacturer	Model	Serial #	WYLE #	RANGE	ACCURACY	Cal Date	Cal Due
1	SOUND LVL MTR	BRUEL & KJAER	2236	2054711	114356	10 - 140dB	.5dB	9/25/2013	9/25/2014
2	TAPE MEASURER	LUFKIN	HV1048CME	NSN	02708	8meters	±1mm	4/24/2012	4/24/2014

This is to certify that the above instruments were calibrated using state-of-the-art techniques with standards whose calibration is traceable to the National Institute of Standards and Technology.

INSTRUMENTATION: _Davinder_ 01/29/14   CHECKED & RECEIVED BY: _Steph b_ 1/29/14

Q.A.: _Michael Cooper_ 1/29/14

WH-1029A,REV,APR'99

Page 1 of 1

APPENDIX J

TESTING TO REFLECT ADDITIONAL CAPABILITIES

1.0   Introduction

The Voluntary Voting System Guidelines (VVSG) allows for vendors to provide additional system capabilities in order to respond to the requirements of individual states. The scope of testing for these additional capabilities is pre-defined prior to the start of the test campaign.

2.0   Scope of Testing

Testing was conducted on the following additional components of the EVS 5.2.0.0 Voting System:

- ExpressPass Application – A standalone application that interfaces with Voter Registration (electronic Pollbook) systems and the ExpressPass printer to print the ballot activation code on an ExpressVote activation card. This code on the activation card activates the correct ballot the voter is authorized to vote.

- ExpressPass Printer – A small, thermal, on demand printer used to print the ballot activation code on the ExpressVote activation card.

Table J2-1 lists the equipment used for the additional testing.

Table J2-1

Equipment	Model Number	Manufacturer	Description	Serial Number
ExpressPass Printer	4200	Microcom	Thermal bar code printer	01901042505

2.1   Source code review

The Source Code Review for the ExpressPass Application version 1.1.0.0 was conducted in accordance with all EAC 2005 VVSG requirements.

- Selection of programming languages
- Software integrity
- Software modularity and programming
- Control constructs
- Naming conventions
- Coding conventions
- Comment conventions

2.2   Technical Data Package Review

- ExpressPass Application Operator's Guide

2.3   Functionality Testing

- Installation and Uninstallation of the ExpressPass Application version 1.1.0.0.
- Proper activation of ballots using ExpressPass printed bar codes created on the ExpressVote cards generated in the Manual Mode of the ExpressPass Application version 1.1.0.0.

2.4   Trusted Build

A Trusted Build of the ExpressPass Application was created using ES&S's Trusted Build documentation. The build was conducted in accordance with all EAC 2005 VVSG requirements, and was performed according to the following steps:

- Clear hard drive of existing data
- Retrieve the compliant source code
- Retrieve the installation media for OS, compilers, and build software
- Construct the build environment
- Create digital signatures of the pre-source build environment
- Create a disk image of the pre-source build environment
- Load the compliant source code into the build environment
- Create a digital signature of the post-source build environment
- Create a disk image of the post-source build environment
- Build the executable code
- Create the installation media
- Create a digital signature of the final build environment
- Create a disk image of the final build environment
- Create a digital signature of the installation media
- Install executable code onto the hardware and validate the software/firmware
- Deliver source code with digital signature, disk image of pre-build environment with digital signatures, disk image of post-build environment with digital signatures, executable code with digital signatures, and installation media to the EAC Repository.

The "Trusted Builds" for the EVS 5.2.0.0 Voting System included source code, data, and script files in clear text form. Additionally, ES&S provided commercially available media and download links for the required COTS software. NTS verified all COTS software by generating and subsequently verifying hash values from each software supplier. Prior to performing each build, a commercially-available software tool was used to clear each sector of the disk drives of any existing data. Afterwards, the designated Operating System was loaded, and the application was built using the previously verified source code and COTS software. The final step in the process included verifying the ExpressPass Application by installing it onto the EMS hardware.

3.0   Testing Results

3.1   Source Code Review

- ExpressPass Application

  o All EAC 2005 VVSG requirements violations were resolved prior to the commencement of the Trusted Build process.

  o The Trusted Build process was successfully completed for ExpressPass Application version 1.1.0.0.

3.2   Technical Data Package Review

The following documents submitted were reviewed to the EAC 2005 VVSG requirements. The processes and procedures contained in the ExpressPass and ExpressVote documents were confirmed to successfully install, configure, and test the ExpressPass Application and the QR code scanner tethered to the ExpressVote. The procedures contained in the build document were followed to successfully build the ExpressPass application.

Table J3-1

EVS 5.2.0.0 ExpressPass and ExpressVote TDP Documents	Version	Date	Document Number
System Overview	9.0	04/11/2014	01-01
ExpressPass Operators Guide	4.0	03/20/2014	07-12
Build Procedure, ExpressPass v 1.1.0.0	1.1	04/03/2014	N/A

3.3   Functionality Testing

NTS personnel successfully printed activation bar codes on 200 ExpressVote cards used during the ExpressVote Accuracy Test detailed in the section 4.5.5 of this Test Report. The ExpressPass Application and the ExpressPass Printer were used for this test. The ExpressVote successfully read all of activation bar codes on the cards. No issues were noted during the execution of this test.

APPENDIX K

EXPRESSVOTE SUMMATIVE USABILITY REPORT

2014
Clemson University and ES&S
04/07/2014

ExpressVote Usability Report
ES&S Voting System 5.2.0.0

Tamirat Abegaz | Edward Dillon, Ph.D. | Wanda Eugene, Ph.D. | Pascal Lola |
Aqueasha M. Martin | Juan E. Gilbert, Ph.D.

Clemson University
Human-Centered Computing Lab

A usability test of ES&S ExpressVote Universal Voting System version 1.0 was conducted during February and March of 2014 at Clemson University. The purpose of this test was to fulfill requirements for EAC certification of the ES&S Voting System 5.2.0.0 based on the Voluntary Voting Systems Guidelines (VVSG Version 1.0).

CLEMS�N
HUMAN-CENTERED COMPUTING

ELECTION
Systems & Software

DATE OF USABILITY TEST: 02/28/2014 – 03/10/2014
DATE OF REPORT: 04/07/2014
REPORT PREPARED BY: Clemson University, Human-Centered Computing Lab
  Juan E. Gilbert, Ph.D.
  864.656.4846
  juan@clemson.edu
  100 McAdams Hall, Clemson University, Clemson, SC 29634
REPORT PREPARED FOR: Election Systems & Software

2

TABLE OF CONTENTS

I. Executive Summary

The Human Centered Computing Lab (HCCL) conducted a usability test of the ExpressVote Universal Voting System version 1.0 during the months of February and March 2014 at Clemson University. The purpose of this test was to fulfill requirements for EAC Certification of the ES&S Voting System 5.2.0.0 (EVS 5200) in compliance with the 2005 Voluntary Voting System Guidelines (VVSG version 1.0).

During the usability test, 68 voters from the general population used the ExpressVote in a simulated election. The election consisted of 1 test ballot with 11 contests, including:

- Federal, state and local contests

- Partisan and nonpartisan contests

3

- Single member and multimember contests
- Retention contests
- Constitutional amendments
- Referenda and ballot initiatives

The test ballot developed by ES&S and approved by the HCCL was used to simulate the tasks that users will be asked to perform during the usability tests.
This ballot includes tasks that model typical ballots from around the country, including:

- Voting for names at various locations within a list of names
- Voting a partial slate in a multimember contest
- Skipping elements of a ballot
- Write-in votes

During the usability test, participants worked alone and were only provided assistance or help by the test administrators as requested. Following the conclusion of the testing, the results were analyzed to determine participants' effectiveness, efficiency and satisfaction using the ExpressVote.

Based on data collected and analyzed, the following summary results indicate that the ExpressVote usability is better than average, performs accurately, and is well received by voters:

- 100% of ballots were successfully submitted/completed
- 92.14% of the requested tasks were completed without any issues
- 110 assists were provided, the majority related to voter understanding of the task instructions
- 5.8 minutes was the average time to complete the voting session
- A Likert Scale rating of 3.9 out of 5 indicated confidence by voters that they had used the system correctly
- A System Usability Score (SUS) of 72.09 indicated that voter satisfaction with the system is above average
- The Holistic Usability Measure (HUM) further indicates that the ExpressVote provides above average usability for the majority of participant groups.

4

II. Introduction

The primary purpose of this study was to examine the usability of the ExpressVote EVS5200 voting machine. The EVS5200 voting system includes a touch-screen display, an audio-tactile interface, and an integrated card reader and printer. The audio-tactile interface includes three assistive technologies-- two position switches and a keypad. The ExpressVote system was designed to accommodate voters in the general voting population, including voters with cognitive, dexterity, auditory, and visual impairments. For this study, participants in each of those populations tested either the visual/touchscreen or the audio-tactile modality and observational data were collected to compute effectiveness, efficiency, and voter satisfaction in the human-voting system interaction.

III. Planning the Study

Timeline

The study was conducted over a period of 5 months (See Figure 1). Five to six usability researchers met to discuss usability requirement material provided by ES&S, draft a study protocol and data collection forms, and complete required documents for Institutional Review Board (IRB) submission. After obtaining IRB approval, the research team spent about 3 months recruiting participants, conducting a pilot study, amending the original IRB documents, conducting the usability tests, collecting data, analyzing the data, and drafting the usability report.

Figure 1. Study Timeline

	November	December	January	February	March
ExpressVote Training					
Study Design/Planning					
Institutional Review Board					
Recruitment					

5

Pilot					
Amendment to Original Study Design					
Conduct Testing					
Drafting Report					

Research Team

The research team consisted of 5 people (3 mid to senior level Ph.D. students and 2 postdoctoral researchers). The research team underwent a one-day training session provided by the machine vendors. The session included a presentation on the machine, a demonstration, and a hands-on training session. The training included instructions on voting, using the voting machine's accessories, and troubleshooting technical issues. In addition to the aforementioned training provided by the vendor, the research team conducted its own informal training on the machines' setup and use before the pilot study.

Usability Protocol Design

The protocol was designed to allow the usability team to primarily collect quantitative data on participants' interactions with the system's visual/touchscreen and audio-tactile interaction modalities, their subjective ratings of satisfaction and confidence in using the system, and other qualitative observational data. The usability testing protocol was developed using guidance from information provided by the National Institute for Standards and Technology (NIST) and the vendor. The researchers met to develop the initial set of testing materials including a demographic survey, pre-testing survey, voting instructions, visual and audio voting tasks, and post-questionnaire. Observational coding sheets were also developed to aid in the collection of observational data during the study. All materials, in addition to an informed consent form and recruitment materials were submitted to the Clemson University Institutional Review Board (IRB) for approval.

While awaiting IRB approval, a review meeting was conducted with a larger team of Human-Computer Interaction researchers to identify any additional elements that could improve the study. From that meeting, several tasks were added to the audio and visual instructions task list. In addition to the review, a pilot was conducted with the larger

6

research team to refine the protocol and study materials. Nine participants from the researchers' lab participated in the pilot study. From this pilot, several changes were made to the data collection materials and updates were made to the protocol. The protocol and all study materials were then submitted to the IRB for an amendment to the previously approved application. Approval for the IRB amendment was obtained before beginning the study with participants.

IV. Methods

Recruitment and Participants

Recruitment was conducted by word-of-mouth or by email through local organizations in the local community. Seventy-one participants were recruited, however 3 participants were excluded due to incomplete or inconsistent data. Therefore, the final report includes data analysis for 68 participants. Approximately 48.5 % (n=33) of the participants were 30-64 years old, 79.4% (n=54) were Caucasian, and 66.2% (n=45) had a Graduate Degree (See Tables 1 - 3).

Table 1. Participants' Age Ranges

Age	Number of Participants	Percent
Under 18	0	0.0%
18 to 29	6	8.8%
30 to 64	33	48.5%
65 and older	29	42.6%

Table 2. Participants' Races

Race	Number of Participants	Percent
African American	12	17.6%
Caucasian	54	79.4%
Hispanic	0	0.0%
Asian	1	1.5%
American Indian	0	0.0%

7

Others	1	1.5%

Table 3. Participants' Education Levels

Education	Number of Participants	Percent
Did not Finish High School	2	2.9%
High School	0	0.0%
Some College	9	13.2%
College Degree	12	17.6%
Graduate Degree	45	66.2%

Participants were recruited from the general voting population; however, participants were purposefully recruited from the following groups: blind, low-vision, and dexterity. Five of the participants recruited identified as having vision impairments and 3 participants identified as having dexterity impairments. In addition, 5 participants identified as having cognitive impairments and 6 identified as having hearing impairments.

Environment and Equipment

The usability tests were held in rooms suitable for a voting activity. Conference rooms at each of the three locations were rearranged to fit this purpose. Each conference room included a large table with chairs that were used to administer the pre and post-test. Research team members rearranged the furniture in the room to provide easy unobstructed access to the voting stations. Voting stations were arranged along the wall of each room to remove any screen glare from external or internal lights and to provide ease accessibility for persons with disabilities.

One or two ExpressVote EVS5200 voting machines were set up in the voting locations. One machine sat on a table and the other inside a voting booth stand--both supporting structures were provided by the manufacturers. The supporting structures were not variables observed in the study. The table was designed to accommodate voters in wheelchairs or similar ambulatory devices. The table was used in all three studies; the booth was only used in two. Since the voting machine that sat on the table was designed for those in wheelchairs, a chair was set up near the machine so that voters without a wheelchair could still use the same machine.

8

Each voting machine included assistive peripherals included by the manufacturer, including a keypad, a two-position switch, and a set of headphones. The keypad remained connected to the machine throughout the testing, however the headphones and two-position switch were only connected for those who requested/needed them.

Experiment

Upon arrival each participant was greeted and provided with an informed consent form. The informed consent form explained the purpose of the study, risks, benefits, and that the study was voluntary and could be ended at any time. If the participant agreed to continue, he/she was provided with a demographic questionnaire. The demographic questionnaire included questions about the participant's personal characteristics (e.g. age, gender, race), disabilities, and familiarity with voting technologies (See Appendix – Pre-Questionnaire). After completing the demographic survey, the participant was then escorted to the voting machines. The participant was then provided with voting instructions and a set of audio or visual voting tasks, depending on what voting modality the participant requested. The participant was provided with time to read the voting instructions and voting tasks and ask questions. In the case where the participant was blind, instructions were read to him/her. Low-vision participants had a choice of reading the instructions alone or having someone read them. An observer then provided additional instructions and reminded the participants to follow the instructions on the voting tasks list in the order they appeared. In the case of blind participants, tasks from the audio task list were read to the participant by one of the observers. An observer then provided the participant with a ballot card and asked the participant to begin when ready.

During the testing, two researchers acting as observers timed the participant's interactions with the voting machine. Timing began when the participant entered his or her ballot card and ended once the participant printed the card or cancelled the voting session. The observers also noted any assists (task, technical, or instructional) given to the participant during the testing session and any error that were made (See Appendix – Observational Coding Sheet). Errors were marked when participant selections did not match instructions provided on the voting instruction list. At the end of the testing session, the participant was led to another researcher to complete a post-test questionnaire. The two observers compared observation notes and prepared for the next participant.

At the end of the testing session, the participant was asked to complete a post-test that collected data on their experiences and satisfaction with the voting machine (See Appendix – Post-Test). The questionnaire included 16 statements. For each statement, the participant

9

was asked to rate their agreement with a 5-point Likert scale (1 strongly-disagree to 5 strongly-agree) rating. Afterward, the participant was thanked and provided with a $50 gift card for their participation in the study.

V. Usability Test Results

The voting machine was evaluated for effectiveness, efficiency, and voter satisfaction. A total of 1 participant chose to use the audio interface and 67 used the visual interface. Self-reported participant data and observational data from the usability team was collected and analyzed. After the study, observational data collected by each of the two observers was compared for validity and discrepancy removal. In addition, descriptive statistics (e.g. averages, frequency) were performed on quantitative data.

Effectiveness

Four metrics were used to measure effectiveness including a task completion score, the percentage of tasks completed without errors, the number of assists provided, and a perfect ballot index.

Number of Ballots Cast Successfully

All participants were able to cast their ballots successfully. A ballot was considered successfully cast when the voter completed the voting task and cast their voting card. In the case of this study, a successfully cast ballot was one that was printed. The voter completion rate was 68/68 or 100%. The voter completion rate is the percentage of test participants who were able to complete the voting and balloting casting tasks.

Perfect Ballot Index & Percent of Tasks Completed

The perfect ballot index is the ratio of the number of cast ballots containing no erroneous votes to the number of cast ballots containing one or more erroneous votes. Erroneous votes included voting for the wrong candidate or voting for the wrong number of candidates. The perfect Ballot Index for this study was 37:31. Thirty-seven ballots were cast with no erroneous votes and 31 of the ballots cast contained one or more erroneous votes.

Observation data revealed that participants voted erroneously a total of 75 times (See Table 4). Twelve participants had trouble inserting the voting card correctly. When tasked to verify their voting selections and make a change to the ballot from the verification screen, twenty-seven participants failed to do so or had trouble

10

completing this task. Seven participants did not write-in a candidate when instructed to do so and twenty-four participants voted for an additional candidate when instructed to vote for only two candidates. Finally, five participants were unable to print their voting card without assistance. The five that needed assistance attempted to print the voting card by selecting the icon on the ExpressVote instruction panel (See Figure 1). In total, 68 participants completed 954 tasks. Therefore, 92.14% of the tasks were completed correctly. Our summary observation is that in general the vast majority of erroneous task voting was attributable to voter confusion or misunderstanding of the voting instructions provided and was not a result of usability issues on the ExpressVote.

Table 4.Task Deviations

Type	Number
Inserted card incorrectly	12
Did not follow instructions correctly to verify their voting selection and make changes to ballot	27
Did not complete write-in task as instructed	7
Voted for the wrong number of candidates as specified in the voting instructions	24
Selected print icon on instruction panel (See Figure 1)	5

Figure 1. ExpressVote Instruction Panel

11

Number of Assists Provided

A total of 118 assists were provided to participants during the voting task (See Table 5). Three types of assists were recorded: instructional, task, and technical. Instructional assists were provided for clarification on the test or task instructions. Task assists were provided to help voters complete a task on the voting task list. Technical assists were provided to help voters recover from a system error or bug. Table 6 provides the average technical, instructional, and task assist per participant in each respective group.

Efficiency

Efficiency was measured as the average voting session time or mean time taken per voter to complete the process of activating, filling out, and casting the ballot. The average session time was 5.8 minutes amongst all participants. For each group, Table 7 provides the average voting session times.

Table 5. Count of Assists Provided

Type of Assist	Number
Instructional Assists	83
Task Assists	35
Technical Assists	0

Table 6. Average Assist per Participant Group

	Technical Assist	Instructional Assist	Task Assist
Blind/Low Vision	0	6.2	1
Deaf/Hearing	0	0.17	0.16
Dexterity/ Motoric	0	1.33	1.33
Cognitive	0	0.6	0
General	0	0.71	0.27

12

Table 7. Average time to complete the voting session in minutes

Voter Type	Average session time
Blind/Low Vision	9
Deaf/Hearing	4.82
Dexterity/Motoric	6.34
Cognitive	7.97
General	5.11

Voter Satisfaction

The System Usability Scale (SUS) was used to measure voter satisfaction. The system usability scale is a well-known and validated metric for evaluating the usability of a system. SUS includes 10 questions, five of those questions are positive and five are negative. The participant rated each question on a scale of 1-5 (Strongly Disagree - Strongly Agree). A SUS score is calculated and the score can be interpreted using a grading scale of A-F where A is perfect usability and F is terrible usability. The average SUS score ranges between >=60 and <=69. The SUS average score amongst all participants for ExpressVote was **72.09**. Table 7 provides the mean SUS score for each categorized group of participants.

Voter Confidence

As part of the Post Questionnaire, a question regarding voter confidence was included. The participants provided their level of confidence for using ExpressVote based on a 5-point Likert Scale (*1=Strongly Disagree* AND *5=Strongly Agree*). Table 8 provides the mean score from the Likert Scale for each categorized group of participants.

Table 8: Voter Satisfaction Ratings

Voter Type	Mean SUS Score
Blind/Low Vision	68.50
Deaf/Hearing	70.42
Dexterity/Motoric	65.00
Cognitive	62.50
General	73.88

13

Table 9. Voter Confidence - Mean Score (using a 5-point Likert Scale)

Voter Type	Mean Score
Blind/Low Vision	3.4
Deaf/Hearing	4.0
Dexterity/Motoric	3.3
Cognitive	3.2
General	3.8

HUM

The Holistic Usability Measure (HUM) evaluates the usability of a system based on different metrics that are defined by the designer. For this study, 9 metrics were used and the usability team assigned weights to each metric according to their understanding of the importance of each metric in the voting process (See Table 10). For example, since the goal of an election is for a voter to successfully cast a ballot, completion rate was given a higher weight followed by ballot error rate and efficiency. In other words, this particular assignment of weight values prioritizes successful ballot casting, error-free ballot completion, and efficient ballot marking by assigning higher HUM weight values to completion rate, ballot error rate, and efficiency or completion time. All other metrics (e.g. satisfaction, confidence, assists, etc.) were given an equal distribution of weight values in the HUM calculation.

14

Table 10: HUM Scores and Weights

Metric	Weight	Blind/Low Vision	Deaf/Hearing	Dexterity/ Motoric	Cognitive	General
SUS Satisfaction	0.04	0.75	1	0.75	0.75	1
SUS Confidence	0.04	0.75	1	0.75	0.75	1
Efficiency	0.21	0	0.5	0.25	0.25	0.5
Effectiveness (Completion Rate)	0.3	1	1	1	1	1
Effectiveness (Ballot Error Rate)	0.25	0.75	0.75	0.75	0.75	0.75
Effectiveness (Task Error Rate)	0.04	0.75	0.75	0.5	0.75	1
Effectiveness (Task Assists)	0.04	0.75	1	0.75	1	1
Effectiveness (Instructional Assists)	0.04	1	1	1	1	1
Effectiveness (Technical Assists)	0.04	1	1	1	1	1
HUM score		0.6875	0.8225	0.73	0.75	0.8325

The HUM metrics for the different groups of participants show that ExpressVote was more usable among the General Population (83.25%) followed by the Deaf/Hearing (82.25%) and Cognitive (75%). The HUM score is calculated as follows:

HUM = W1*Metric1 + W2*Metric2 + ... + Wn*Metric n
where W1 + W2 + ... + Wn = 1
and 0 ≤ W1, W2, ..., Wn ≤ 1

For this study, the HUM score was calculated by multiplying each metric with the weight defined by the usability team. For example, for the Blind/Low Vision HUM was calculated as follows: HUM = 0.3(1) + 0.25(0.75)+...+0.4(1).

Observational Notes

In addition to the above metrics, observers also collected notes during the study pertaining to issues participants encountered with the system. These notes are provided below:

- When asked to print the ballot (see Figure 1), five participants attempted to select the print icon provided to the right of the panel (the voting instruction panel) of the ExpressVote machine.

15

- Some participants had trouble inserting the card into the machine. This was particularly a challenge for the voters with visual or dexterity impairments.
- Participants were most confused with what to do when alerted that they had not fully voted one of the contests. Participants were most confused with the voter instruction advisory such as the undervote alert. For example, they were confused with what to do when alerted that they had not fully voted one of the contests and this may have increased the number of erroneous votes and the amount of time taken to vote.

VI. Discussion

It is important to note that based on observations of the usability team, two factors may have played a role in some of the outcomes outlined in the results section. On both the audio and visual task lists, the first task was placed out of order on purpose as to evaluate whether or not a person wishing to only vote for a certain candidate could easily navigate through the ballot interface. Despite being asked to vote based on the order and instructions that appeared on the task list, nearly every participant skipped this step. In addition, because the task was not in order as the other tasks in the list, it was observed that some participants did not pay close attention to the instructions and therefore voted for the wrong candidate for the rest of the study.

Second, one task was included to evaluate the voter instruction advisory provided by ExpressVote. It was observed that oftentimes, because the instructions on the ballot (vote for 3 candidates) were not consistent with the instructions on the task list (vote for 2 candidates), participants would either ask for clarification resulting in an instructional assist or simply vote for 3 candidates which resulted in a deviation from the task.

In addition, for the Blind/Low Vision and Cognitive participant groups, researchers read the voting task list to the participants. This may have increased the number of instructional assists for these groups. Similarly, because the tasks were read to the participants, it may have also impacted the number of task deviations and the overall task completion time.

Our conclusion is that the voting assists and task deviations identified above may have been related to voters not understanding and correctly following the written test instructions.

16

Summary

Overall, all participants (n = 68) were able to cast their ballot successfully. Approximately, 92.14% of the voting tasks were completed without error. Of the 118 assists provided, 83 (67.47%) were instructional or to clarify instructions provided on the voting task list. On average, Blind/Low Vision voters received the most instructional assists (mean = 6.2). Thirty-seven ballots were cast with no errors and 31 of the ballots cast contained one or more errors. The highest average session time was among the Blind/Low-Vision group (mean = 9) and lowest among the Deaf/Hearing (mean = 4.82). The system usability score for the ExpressVote system was 72.09 which indicates a higher than average level of user satisfaction among participants. The lowest mean SUS score (mean = 62.50) was among the Cognitive participants. Most voters were neutral or confident they could use the system in a real election. Finally, the HUM metrics for the different groups of participants show that that ExpressVote was more usable among the General Population (83.25%) followed by the Deaf/Hearing (82.25%) and Cognitive (75%). Overall, these results suggest that the ExpressVote is a usable and accessible voting technology.

17

VII. Appendix

Informed Consent Form

RESEARCH DESCRIPTION for Usability Benchmarks for Voting Systems

PRINCIPAL INVESTIGATOR: Dr. Sharon Laskowski, 301-975-4535

The National Institute of Standards and Technology (NIST) is developing guidelines for the usability of voting systems under the directives in the Help America Vote Act (HAVA). This study is being performed to determine how easy or difficult it is for voters to use voting machines. Usability will be measured by determining the time it takes a voter to vote, the number of errors when the vote is cast, and voter satisfaction. The results of this study will be used to develop usability test methods and benchmarks for voting machines. The research is funded by the Election Assistance Commission (EAC) and NIST and conducted by User-Centered Design, Inc. and NIST.

We collected your demographic data at the time your appointment was set up. This includes age, gender, education level, race, location, reading ability, experiences related to voting, and any disabilities. We will use this data in our analysis. For this study, you will be given written or audio instructions on how you as a voter "want to vote" in a mock election. You will be asked to vote as instructed on a specific voting machine. In addition to collecting your votes, there may be a camera focused on the machine and your hands, but your face will not be photographed. After you cast your ballot, you will be asked for your opinion about the voting machine. This process should take you no more than 30-60 minutes.

CONFIDENTIALITY: All of your voting time and error data, demographic data, and voter experience and satisfaction/confidence data will be recorded without identifiers. When you were recruited, we were given your name and demographic data. If you agree to participate in this study, we will assign you a number. Your data will only be identified and linked together by a number, and will not be linked back to your name or other identifier in any way. We will not use your name in any of the data or the reporting. The original list containing your name will be destroyed after the testing is completed.
Your identity will be protected to the extent permitted by law, including the Freedom of Information Act. Members of the NIST Institutional Review Board (IRB), appropriate NIST researchers and contractors, EAC members and staff, and other appropriate Federal employees may review the records of this study. The data will be used by NIST researchers to create usability performance benchmarks and test methods for voting machines.

You are free to withdraw from the study at any time during the experiment. In total, we expect to have approximately 1000 subjects complete the experiment.

[Continue on other side]

18

There are no risks involved in participating in this study, nor are there any immediate benefits to you as a subject. The long-term benefits of this study should be improved voting systems.
COMPENSATION: You will be paid $50 in cash for your participation in this study before you leave.

CONTACT INFORMATION: For questions regarding this study, please contact Dr. Sharon Laskowski at (301) 975-4535, sharon.laskowski@nist.gov. For questions regarding your rights as a human subject, please contact Lisa Karam, Acting NIST IRB Chairperson, at (301) 975-5561 or (301) 975-3190 or lisa.karam@nist.gov.

"I have read the above description of this research project. I have also spoken to the project researcher, who answered any questions I had about this project. I acknowledge that I have received a personal copy of this form. I agree to participate in this research and I understand that I may withdraw at any time."

Signature: _____ Date: _____

Project researcher name: _____

Project researcher signature: _____ Date: _____

19

Observational Coding Sheet

Participant # _____   Video ____ Audio ____ (Check one)

Session Start Time _____   Session End Time _____

Task #	Error(s)	No Assist	Instructional Assist	Task Assist	Technical Assist
Task 1					
Task 2					
Task 3					
Task 4					
Task 5					
Task 6					
Task 7					
Task 8					
Task 9					
Task 10					
Task 11					
Task 12					
Task 13					

Voting Successfully Completed
Was the voter able to complete the process of voting and casting their ballot (i.e. print ballot)?
Yes   No

Notes:
What is an Error?
Was the voter able to complete each task without error?
- Example(s) of an Error
  - The voter selected the wrong candidate.
  - The voter was unable to write-in a candidate.

What is an Assist?
How many times did the voter request or require assistance from a research team member? What type of assistance was requested?
- Technical Assist – help voter recover from a system error or bug
- Instructional Assist – provide clarification on the test or task instructions
- Task Assist – help voter complete a task

20

Voter Instructions

In our mock election, we will be using fictitious names for candidates. Colors will designate the political parties. Any similarity between names of candidates and real people is purely coincidental. For example, you might see or hear this:

GEORGE BENDER / PURPLE

Or

DIANNE HILSWORTH / SILVER

Please attempt to vote as described and follow the instructions that are available. There are written and audio voting instructions available on the ExpressVote that will help you understand how to vote. You will move through the ballot from contest to contest until you get to the end. There will then be a summary of your selections so you can verify your choices. When you are satisfied that you have voted correctly, you may print the card with your vote selections and cast your votes. If you don't wish to cast your votes, then you may choose to have the card returned to you.

Once you start, the assistance we can give you is limited.

Please do the best you can. If you are stuck and cannot continue, inform one of your researchers.

Now, follow the instructions to begin voting.

Thank you.

21

Visual Voting Instructions

Please vote exactly as described on this page.

1. *Insert the card to activate the ballot and begin voting*

2. Vote for STATE SENATOR DISTRICT 36

3. For PRESIDENT/ VICE-PRESIDENT, vote for candidate:
   GEORGE BENDER

4. For GOVERNOR, vote for a Write-In candidate by entering:
   BOB SIMMS

5. For UNITED STATES SENATOR, vote for candidate:
   DIANNE HILLSWORTH

6. Vote for a candidate for UNITED STATES REPRESENTATIVE DISTRICT 49

7. Vote for a candidate for the MEMBER OF STATE ASSEMBLY DISTRICT 66

8. Vote for two candidates for City Council- Lemon Grove

9. Vote for Retention of Judges – Moreno - **YES**

10. Vote for Retention of Judges – Baxter - **YES**

11. For CONSTITUIONAL AMENDMENT D:
    DO NOT VOTE

12. For BALLOT MEASURE 106, vote for:
    NO

13. On the Summary Page, Change Vote for Retention of Judges – Moreno to NO

14. Verify your selections from the summary page

Print your card

22

Audio Voting Instructions

Please vote based on my instructions.
1. To begin, put on the headphones and follow the instructions to insert the card.

2. Adjust the Speed or Volume of the audio

3. Vote for STATE SENATOR DISTRICT 36

4. For PRESIDENT/ VICE-PRESIDENT, vote for candidate:
   GEORGE BENDER

5. For GOVERNOR, vote for a Write-In candidate by entering:
   BOB SIMMS

6. For UNITED STATES SENATOR, vote for candidate:
   DIANNE HILLSWORTH

7. Vote for a candidate for UNITED STATES REPRESENTATIVE DISTRICT 49

8. Vote for a candidate for the MEMBER OF STATE ASSEMBLY DISTRICT 66

9. Vote for two candidates for City Council- Lemon Grove

10. Vote for Retention of Judges – Moreno - **YES**

11. Vote for Retention of Judges – Baxter - **YES**

12. For CONSTITUIONAL AMENDMENT D:
    DO NOT VOTE

13. For BALLOT MEASURE 106, vote for:
    NO

14. On the Summary Page, Change Vote for Retention of Judges – Moreno to **NO**

15. Verify your selections from the summary page

Print your card

23

Pre-Questionnaire

1. Are you a United States citizen?
   - [ ] Yes
   - [ ] No

2. Have you ever participated in a usability test of a voting system before?
   - [ ] Yes
   - [ ] No

3. What is your education?
   - [ ] Did not finish High School
   - [ ] High School
   - [ ] Some College
   - [ ] College Degree
   - [ ] Graduate Degree

4. What is your Race or Ethnicity?
   - [ ] African American
   - [ ] Caucasian
   - [ ] Hispanic
   - [ ] Asian
   - [ ] American Indian

5. Do you consider yourself fluent in the English language?
   - [ ] Yes
   - [ ] No

   Are you eligible to vote in the United States?
   - [ ] Yes
   - [ ] No

6. Do you or anyone in your household or immediate family work in any of the following situations:
   - [ ] Information technology or software development
   - [ ] Usability or market research
   - [ ] Poll worker
   - [ ] Work for or have a financial interest in a voting machine manufacturing, development, marketing, evaluation or sales business or organization
   - [ ] Any other position that is part of the voting process

7. What is your gender?
   - [ ] Male
   - [ ] Female

8. How old are you?
   - [ ] Under 18
   - [ ] 18 to 29 years
   - [ ] 30 to 64 years
   - [ ] 65 years or older

9. Is English your primary language (the one you speak most regularly)?
   - [ ] Yes
   - [ ] No

24

10. Do you have a cognitive, language, or learning disability?
    Yes
    No

11. Are you deaf or do you have serious difficulty hearing?
    Yes
    No

12. Which of the following best describes your vision?
    I have normal or corrected to normal vision. "Corrected to normal" means that if you wear glasses or contacts, they allow you to read newspapers, magazines, or books without trouble
    I have no vision at all; I cannot see light
    I can only see light and dark, and cannot read or see details under any circumstances
    I can only read large-print, high contrast text (I cannot read normal-sized text, even when wearing glasses or contacts, unless it is held very close to my face)

13. Do you have serious difficulty concentrating, remembering or making decisions?
    Yes
    No

14. Do you have problems with any of the following:
    Following instructions with multiple steps
    Understanding what you read or hear
    Identifying the main idea
    Reading or gathering information from tables or charts

15. When reading, do you often:
    Reverse letters, numbers, words, or phrases
    Confuse similar words
    See letters/numbers out of order
    Add, skip, or omit letters
    Not applicable

16. Which of the following best describes your use of your hands or arms?
    I have full strength and use of my hands and arms
    I have no use of my hands and arms
    I have limited strength and use of my hands and arms

(We're referring to the arm/hand that you primarily use, or would use when voting on an electronic system. Minor hand tremors are considered "full strength" unless accompanied by additional weakness or issues. Major uncontrolled tremors are included under "limited strength and use.")

17. Can you reach your arms straight out in front of you and keep them there for at least 10 seconds without any pain?
    Yes
    No

18. Can you perform delicate tasks with your hands (such as writing the alphabet with a pen) for extended periods of time without pain?
    Yes
    No

25

[If you need clarification, see note under #12]

19. Do you have any other significant physical or mental disabilities or conditions that may prevent you from using an electronic voting system?
- [ ] Yes
- [ ] No

20. Do you regularly use any of the following?
- [ ] Non-motorized wheelchair
- [ ] Motorized wheelchair
- [ ] Walker or cane
- [ ] Motorized scooter

21. What types of voting systems have you used in the past?
- [ ] None
- [ ] Mechanical lever (voter sets switches and pulls a lever)
- [ ] Punch Card (voter punches holes in a card)
- [ ] Touch Screen (voter touches a screen to record a vote)
- [ ] Optical Scan (voter fills in an oval or arrow on paper and the vote is checked by a machine)
- [ ] Paper and pencil (voter fills in an oval or arrow on paper and the vote is checked by a human)
- [ ] Internet (voter makes selection online and cast the ballots)
- [ ] Telephone (voter uses a phone to make selection and cast the ballot)

22. Which of the following items do you regularly use?
- [ ] ATM Machines
- [ ] Computer
- [ ] Device to record from TV (DVD, VHS, etc)
- [ ] Digital Camera
- [ ] Cell Phone
- [ ] Self-checkout at store

23. Do you rely on audio (that is, sound) to use computers or ATMs?
- [ ] Yes, I use audio in addition to reading the screen
- [ ] Yes, I only use audio and don't look at the screen
- [ ] No, I don't use audio at all
- [ ] Don't use computers or ATMs often

24. Do any disabilities interfere with your voting independently?
- [ ] Yes
- [ ] No
- [ ] N/A

25. Which of the following devices do you use often and without difficulties?
- [ ] Pen and paper
- [ ] Keyboard
- [ ] Computer mouse
- [ ] Computer trackball
- [ ] Touch-screen
- [ ] Keypad
- [ ] Mini-keyboard
- [ ] Joystick
- [ ] Light-pen
- [ ] Rotary input knob
- [ ] Speech recognition system

26

- Jelly switches
- Screen reader
- Other (please describe)

27

Post Test Questionnaire

Please complete the following questions:

1. To the best of my ability, I followed the instructions that told me the names of individuals to vote for and how to vote on the issues
___ Yes
___ No

2.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
I felt comfortable using the voting system.					

3.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
I would like to use this voting system in a real election.					

4.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
I found the voting system difficult to use					

5.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
I would need the support of a poll worker to be able to use this system					

6.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5

28

The instructions for interacting with this voting system (how to use the machine, not for who to vote for) were easy to understand.					

7.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
I would imagine that most people would learn to use this voting system very quickly					

8.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
I felt very confident using the system					

9.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
I needed to learn a lot of things before I could get going with this system					

--
10.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
The ballot text was easy to read or hear.					

11.

	Strongly	Disagree	Neutral	Agree	Strongly

29

	Disagree				Agree
	1	2	3	4	5
I was able to use the voting system without major problems.					

12.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
Writing-in a candidate was easy.					

13.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
This voting system was easy to use.					

14.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
The buttons on the touch screen were easy to use.					

15.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
It was hard to move around the ballot with this system.					

16.

	Strongly Disagree	Disagree	Neutral	Agree	Strongly Agree
	1	2	3	4	5
Correcting my mistakes					

30

was easy.					

31

APPENDIX L

SECURITY TEST MATRIX

EVS 5.2.0.0 Security Test Matrix

Tests	To be Tested					Results				
TESTS	ExpressVote	DS200	DS850	EMS	Ballot Boxes	ExpressVote	DS200	DS850	EMS	Ballot Boxes
Ports, Protocols, Services Scan	X	X	X	X		Pass	Previous	Previous	Previous	
Vulnerability Scan	X	X	X	X		Pass	Previous	Previous	Previous	
File permission checks on critical files/apps/directories	X	X	X	X		Pass	Previous	Previous	Previous	
Account checks (*privileges, Password*)	X	X	X	X		Pass	Previous	Previous	Previous	
Test Verification Process	X	X	X	X		Pass	Previous	Previous	Previous	
Attacks from key - TM	X	X	X	X		Pass	Previous	Previous	Previous	
TDP Review	X	X	X	X		Pass	Previous	Previous	Previous	
File Manipulation	X	X	X	X		Pass	Previous	Previous	Previous	
Operating System Tests										
BIOS - order change, backdoor, potential mbr attack on crypto	X	X	X	X		Pass	Previous	Previous	Previous	
Xwindows - bypass/short cut desktop				X					Previous	
Password policy enforcement	X	X	X	X		Pass	Previous	Previous	Previous	
Hardware connections (usb, lan)	X	X	X	X		Pass	Previous	Previous	Previous	
Event Log	X	X	X	X		Pass	Previous	Previous	Previous	
Application Tests										
Check installed software	X	X	X	X		Pass	Previous	Previous	Previous	

Tests	To be Tested					Results				
TESTS	ExpressVote	DS200	DS850	EMS	Ballot Boxes	ExpressVote	DS200	DS850	EMS	Ballot Boxes
Check "timeout"	X	X	X	X		Pass	Previous	Previous	Previous	
Password Aging		X	X	X			Previous	Previous	Previous	
Verify user name and Password	X	X	X	X		Pass	Previous	Previous	Previous	
Verify user roles	X	X	X	X		Pass	Previous	Previous	Previous	
Transport Media Tests										
ES&S Approved Compact Flash	X	X	X	X		Pass	Previous	Previous	Previous	
Compact Flash Clean or Cleared	X	X	X	X		Pass	Previous	Previous	Previous	
Physical Security										
Machine disposables can be replaced without gaining access to internal components.	X	X	X			Pass	Previous	Previous		
Verify that ballot counter cannot be reset except by authorized persons	X	X	X			Pass	Previous	Previous		
Tamper evident tape and seals	X	X	X		X	Pass	Previous	Previous		Previous
Bypass or defeat security environment	X	X	X	X	X	Pass	Previous	Previous	Previous	Previous
Ballot storage device is secure				X	X				Previous	Previous
TDP Review	X	X	X	X		Pass	Previous	Previous	Previous	
Verify software and firmware on unit reflects the TDP	X	X	X	X		Pass	Previous	Previous	Previous	