Test Report No. PR036164-01 REV B Page 1 of 26 www.nts.com



Test Report for EAC 2005 VVSG Certification Testing Performed on Dominion Voting Systems 4.14-E

EAC CERTIFICATION NUMBER: DVS-DemSuite4.14-E

Issue Date: 06/24/2015

Prepared for: Dominion Voting Systems, Inc. 1201 18th Street, Suite 210 Denver, Colorado 80202

Prepared by: National Technical Systems Huntsville 7800 Hwy 20 West Huntsville, AL 35806





This report and the information contained herein represents the results of testing of only those articles/products identified in this document and selected by the client. The tests were performed to specifications and/or procedures approved by the client. National Technical Systems ("NTS") makes no representations expressed or implied that such testing fully demonstrates efficiency, performance, reliability, or any other characteristic of the articles being tested, or similar products. This report should not be relied upon as an endorsement or certification by NTS of the equipment tested, nor does it present any statement whatsoever as to the merchantability or fitness of the test article or similar products for a particular purpose. This document shall not be reproduced except in full without written approval from NTS.



Test Report No. PR036164-01 REV B Page 2 of 26

SIGNATURES

Prepared by:

Jon Weathers, Project Manager

Date:

6/24/2015

6/24/15

Approved by:

ames Long, Program Manager

Date:

Date:

6/24/15

al por J

Approved by:

Robert Hardy, Department Manager

and

Date:

Reviewed by:

The Rick Davis, QA Manager

Burda



REVISIONS

Revision	Reason for Revision	Date
NR	Initial Release	5/27/15
A	Revisions made based on EAC comments	6/19/15
В	Added EAC Certification Number	6/24/15



TABLE OF CONTENTS

	F	PAGE NO.
1.0 In	ntroduction	5
1.1	Description of EAC Certified System Being Modified	5
1.1.1	1 Baseline Certified System	5
1.2	References	7
1.3	Terms and Abbreviations	8
2.0 Ce	ertification Test Background	10
2.1	Revision History	10
2.2	Scope of Testing	10
2.2.1	1 Modification Overview	11
2.2.2	2 Test Materials	11
2.2.3	3 Block Diagram	12
2.2.4	4 Supported Languages	13
2.2.5	5 RFIs	13
2.2.6	6 NOCs	13
3.0 Te	est Findings	14
3.1	Summary Finding	14
3.1.1	1 Hardware Testing	14
3.1.2	2 System Level Testing	14
3.3	1.2.1 TDP Review	14
3.3	1.2.2 Functional Configuration Audit (FCA)	15
3.1.3	3 Source Code Review	15
3.2	Anomalies and Resolutions	16
3.3	Deficiencies and Resolutions	16
4.0 Re	ecommendation for Certification	16
Appendix	x A. Additional Findings	17
Appendix	x B. Deficiency report	19
Appendix	x C. Anomaly report	21
Appendix	x D. Test Plan	23
Appendix	x E. Technical Data Package	25



1.0 INTRODUCTION

The purpose of this National Certification Test Report is to document the findings from National Technical Systems, Inc. (NTS) certification testing of the Dominion Voting Systems (Dominion), herein referred to as manufacturer, Democracy Suite (D-Suite) 4.14-E voting system to the requirements set forth for Voting Systems in the U.S. Election Assistance Commission (EAC) 2005 Voluntary Voting System Guidelines (EAC 2005 VVSG). D-Suite 4.14-E is a modification to the previously 2005 VVSG certified D-Suite 4.14-D voting system (Certification number: DVS-DemSuite4.14-D), and as such, was tested by NTS Huntsville based on the "modified system" requirements set forth in section 4.4.2.3 of the EAC Testing and Certification Program Manual, Version 1.0.

1.1 Description of EAC Certified System Being Modified

The following subsection describes the EAC Certified System that is baseline for the submitted modification. All information was derived from the previous Certification Test Report and/or EAC Certificate of Conformance.

1.1.1 Baseline Certified System

The baseline system for this modification is the D-Suite 4.14-D voting system. Tables 1-1 and 1-2 describe the proprietary and commercial-off-the-shelf (COTS) hardware and software/firmware versions. For a complete description of the configuration and description of the D-Suite 4.14-D product, refer to the D-Suite 4.14-D Test Report located on the EAC's website at http://www.eac.gov.

Software Required For Testing	Software/Firmware Version			
Proprietary				
EMS Election Event Designer (EED)	4.14.37			
EMS Results Tally and Reporting (RTR)	4.14.37			
EMS File System Service (FSS)	4.14.37			
EMS Audio Studio (AS)	4.14.37			
EMS Data Center Manager (DCM)	4.14.37			
EMS Election Data Translator (EDT)	4.14.37			
EMS Application Server (APPS)	4.14.37			
EMS Adjudication	2.4.1.3201			
ImageCast Central (ICC)	4.14.17			
ImageCast Precinct (ICP)	4.14.17-US			
ImageCast Evolution (ICE)	4.14.21			
CC	DTS			
Cepstral Voices 6.2.3.801				
Microsoft Windows 7 x64	6.1			
Windows Server 2008 R2 x64	6.1			
Adobe Reader	10.1.1			
Microsoft .NET Framework 4.0 4.0				
Microsoft SQL Server 2008 R2 x64	10.0			
Microsoft SQL Server 2008 Express R2 x64	10.50.4000.0			
Microsoft SQL Server	10.50.4000.0			
2008 R2 SP2x64	10.50.4000.0			

Table 1-1. Baseline Certified Software



1.1.1 Baseline Certified System (Continued)

Table 1-1.	Baseline Certi	fied Software	(Continued)	

Software Required For Testing	Software/Firmware Version	
СО	DTS	
Microsoft Visual J# 2.0 Redistributable Package – Second Edition (x64)	- 2.0	
1-Wire Driver version 4.0.3b x64	4.0.3	
Java Runtime Environment 6.0 x64	6.0.290	
Microsoft Visual C++ 2010 SP1 Redistributable Package(x86)	10.0.40219	
Microsoft Access Database Engine 2010 Redistributable	1 (published 12/16/2010)	

Table 1-2. Baseline Certified Voting System Equipment.

Component	Make	Model		
Proprietary				
ImageCast Precinct (ICP)	Dominion	PCOS-320A and PCOS 320-C		
ImageCast Evolution (ICE)	Dominion	PCOS-410A		
ICE – Plastic ballot box	Dominion	Box-410A		
ICE – Coroplast Ballot Box	Dominion	Box-420A		
ICP – Metal ballot box	Dominion	Box-310A		
ICP – Plastic Ballot Box	Dominion	Box-330C		
ICP – Coroplast Ballot Box	Dominion	Box-340C		
ICP – Coroplast Ballot Box w/latch	Dominion	Box-341-C		
	COTS			
ImageCast Central (ICC)*	Canon	DR-G1130 and DR-X10C		
USB reader/Writer	Maxim	USB R/W: DS9490R		
iButton (SHA-1)	Maxim	DS1963S		
ICE external LCD monitor	AOC	E1649FWU		
LCD Monitor	Soyo	18.5" wide LCD		
LCD Monitor	Samsung	23" wide LCD		
LCD Monitor	Dell	1909W		
LCD Monitor	Dell	N445N		
Footswitch Pair	Kinesis	N/A		
Audio Adapter	Soundwave	USB Soundwave 7.1 Audio Adapter		
PCI Software	Soundwave	Soundwave 7.1 PCI Software		
USB Software	Soundwave	USB Soundwave 7.1 Software		
		CFC-14A		
	RiData	RDCF8G-233XMCB2-1		
	NIDala	RDCF16G-233XMCB2-1		
Compact Flash Cards		RDCF32G-233XMCB2-1		
	SanDisk Extreme	SDCFX-016G		
		SDCFX-032G		
	SanDisk	8 GB		



1.1.1 Baseline Certified System (Continued)

Component	Make	Model			
COTS					
Compact Flach Boador	SanDisk	USB			
Compact Flash Reader	GGI Gear	USB			
Notworking Switch	D-Link	D-Link DES-1105			
Networking Switch	D-LITIK	5-Port Switch			
Headphones	Cyber Acoustics	ACM-70			
Sip & Puff	Origin Instruments	Air Voter			
UPS for ICC	– APC	SMC1000			
UPS for EMS	APC	SMC1500			

1.2 References

- Election Assistance Commission 2005 Voluntary Voting System Guidelines, Volume I, Version 1.0, "Voting System Performance Guidelines," and Volume II, Version 1.0, "National Certification Testing Guidelines," dated December 2005
- Election Assistance Commission Testing and Certification Program Manual, Version 1.0
- Election Assistance Commission Voting System Test Laboratory Program Manual, Version 1.0
- National Voluntary Laboratory Accreditation Program NIST Handbook 150, 2006 Edition, "NVLAP Procedures and General Requirements (NIST Handbook 150)," dated February 2006
- National Voluntary Laboratory Accreditation Program NIST Handbook 150-22, 2008 Edition, "Voting System Testing (NIST Handbook 150-22)," dated May 2008
- United States 107th Congress Help America Vote Act (HAVA) of 2002 (Public Law 107-252), dated October 2002
- NTS Quality Assurance Program Manual, Current Revision
- ANSI/NCSL Z540-1, "Calibration Laboratories and Measuring and Test Equipment, General Requirements"
- ISO 10012-1, "Quality Assurance Requirements for Measuring Equipment"
- EAC Requests for Interpretation and Notices of Clarification (listed on www.eac.gov)
- EAC Quality Monitoring Program residing on: http://www.eac.gov/testing_and_certification/quality_monitoring_program.aspx
- Dominion Voting Systems' Democracy Suite 4.14-D Modification VSTL Certification Test Report Rev. C (listed on www.eac.gov)
- Dominion Voting Systems Democracy Suite 4.14-D Technical Data Package
- Dominion Voting Systems Democracy Suite 4.14-E Technical Data Package



1.3 Terms and Abbreviations

Table 1-3 defines all terms and abbreviations applicable to this Test Report.

Term	Abbreviation	Definition
		A result and/or event that deviates from what is
Anomaly		standard, normal, or expected in which no root cause has
		been determined.
Americans with Disabilities		ADA is a wide-ranging civil rights law that prohibits,
Act of 1990	ADA	under certain circumstances, discrimination based on
		disability.
Audio Studio	AS	EMS application used to record audio files.
Audio Tactile Interface	ATI	Voter interface designed to not require visual reading of
		a ballot. The same ATI is utilized for both the ICP and ICE.
Configuration Management	CM	
		Commercial, readily available hardware devices (such as
		card readers, printers or personal computers) or
Commercial Off-the-Shelf	COTS	software products (such as operating systems,
		programming language compilers, or database
		management systems)
Deficiency		Any repeatable test result or event that is counter to the
,		expected result or violates the specified requirements.
		An electronic voting system that utilizes electronic
		components for the functions of ballot presentation, vote
Direct Record Electronic	DRE	capture, vote recording, and tabulation which are
		logically and physically integrated into a single unit. A
		DRE produces a tabulation of the voting data stored in a
		removable memory component and in printed hardcopy.
		Commission created per the Help America Vote Act of
United States Election	EAC	2002, assigned the responsibility for setting voting
Assistance Commission		system standards and providing for the voluntary testing
		and certification of voting systems.
EMS Election Event Designer	EED	EMS application used for election definition functionality.
Election Management	EMS	An umbrella term for the software application used to
System	EIVIS	define and report election projects.
Functional Configuration		Exhaustive verification of every system function and
Audit	FCA	combination of functions cited in the manufacturer's
		documentation.
Help America Vote Act	HAVA	Act created by United States Congress in 2002.
ImageCast Precinct	ICP	Precinct-level optical scanner and tabulator with audio
		voting capabilities.
ImageCast Evolution	ICE	Precinct-level optical scanner, tabulator with audio
		voting and integrated Ballot-marking Device.
ImageCast Central	ICC	COTS High-speed central ballot scan tabulator.

Table 1-3. Terms and Abbreviations



1.3 Terms and Abbreviations (Continued)

Term	Abbreviation	Definition	
National Institute of Standards and Technology	NIST	Government organization created to promote U.S. innovation and industrial competitiveness by advancing measurement science, standards, and technology in ways that enhances economic security and improves our quality of life.	
Notice of Clarification	NOC	Provides further guidance and explanation on the requirements and procedures of the EAC's Voting System Certification or Voting System Testing Laboratory programs.	
Operating Procedure	OP	Test Method or Test Procedure.	
Relational Database Management System	RDBMS	A database management system (DBMS) that is based on the relational model.	
Physical Configuration Audit	PCA	Review by accredited test laboratory to compare voting system components submitted for certification testing to the manufacturer's technical documentation, and confirmation the documentation meets national certification requirements.	
Quality Assurance	QA		
Request for Interpretation	RFI	A means by which a registered Manufacturer or Voting System Test Laboratory (VSTL) may seek clarification on a specific Voluntary Voting System Guidelines (VVSG) standard.	
Results, Tally and Reporting	RTR	EMS application used to integrate election results and reporting.	
Technical Data Package	TDP	Manufacturer documentation related to the voting system required to be submitted as a precondition of certification testing.	
Trusted Build		Final build of source code performed by a trusted source and overseen by the manufacturer which is delivered to the EAC designated repository; also referred to as a "Witness Build".	
Voluntary Voting System Guidelines	EAC 2005 VVSG	Published by the EAC, the third iteration of national level voting system standards.	
Virtual Review Tool	VRT	Test campaign management software used by the EAC, VSTLs and vendors applying for qualification testing.	
Voting System Test Laboratory	VSTL	An independent, non-federal laboratory qualified to test voting systems to Federal standards.	

Table 1-3. Terms and Abbreviations (Continued)
--------------------------------------	------------



2.0 CERTIFICATION TEST BACKGROUND

NTS Huntsville is an independent testing laboratory for systems and components under harsh environments, including dynamic and climatic extremes as well as the testing of electronic voting systems. NTS Huntsville holds the following accreditations:

- ISO-9001:2000
- NVLAP Accredited ISO 17025:2005
- EAC Accredited VSTL, NIST 150,150-22
- A2LA Accredited (Certification No.'s 0214.40, 0214.41, and 0214.42)
- FCC Approved Contractor Test Site (Part 15, 18)

2.1 Revision History

Table 2-1 describes the version history of the submitted voting system.

System Version	Certification Type	System Modified	Certification Date	Certification Number
D-Suite 4.0	New System	Original	05/10/2012	DVS-40-G-10
D-Suite 4.14	Modification	D-Suite 4.0	07/18/2013	DemSuite-4-14
D-Suite 4.14-A	Modification	D-Suite 4.14	09/20/2013	DemSuite-4-14-A
D-Suite 4.14-A.1	Modification	D-Suite 4.14-A	06/16/2014	DVS-DemSuite-4-14-A.1
D-Suite 4.14-B	Modification	D-Suite 4.14-A	01/07/2014	DVS-DemSuite4.14-B
D-Suite 4.14-D	Modification	D-Suite 4.14-B	11/25/2014	DVS-DemSuite4.14-D
D-Suite 4.14-E	Modification	D-Suite 4.14-D	TBD	DVS-DemSuite4.14-E

Table 2-1. Voting System Revision History

2.2 Scope of Testing

The focus of the D-Suite 4.14-E test campaign was to verify functionality of modifications applied to the previously certified D-Suite 4.1.4-D voting system. This report is valid only for the system identified in section 1.1, Description of EAC Certified System Being Modified. In addition, modifications summarized herein represent the only changes that were reviewed by NTS. Any changes, revisions, or corrections not listed in this report or made to the system after this evaluation are required to be submitted to the EAC for assessment.



2.2.1 Modification Overview

Modifications outlined below transition Dominion Suite 4.14 revision D to revision E and were submitted by the manufacturer for testing.

- 1. On the ICE, captured write-in images are printed on the paper tape reports for ballot layouts at precinct using a General and a Primary election database.
- 2. On the ICE, candidate order for consolidated split precincts is printed on the paper tape report printouts in the candidate order for the ballot layouts for that precinct using a General and a Primary election database.
- 3. On the ICE, exclusive inclusion of Blank Ballot violation notice is in AuditMark image (bottom left corner) when casting a blank ballot in Open Primary election.
- 4. On the ICE, when a dynamic audio file is missing for the second language, the English audio plays as a default using a General and a Primary election database rather than playing "The audio file is missing" error message.
- 5. On the ICP, Captured write-in images are printed on the paper tape reports for ballot layouts at precinct using a General and a Primary election database. Print ability of write-in images on paper tape report printouts for ballot layouts at precinct.
- 6. On the EMS, Ballot layout file changed where term "Write-In" appears in a ballot layout, allowing for flexibility in size and layout of write-in box and position of term "Write-In relative to other elements.

All other software and documentation from the D-Suite 4.14-D system, with the exception of the ICE, ICP, and EMS application software and the MBS/DCF configuration file (and related records), is included in the D-Suite 4.14-E system.

2.2.2 Test Materials

D-Suite 4.14-E system proprietary software and hardware submitted by the manufacturer for testing is listed in Tables 2-2 and 2-3 respectively. All COTS hardware and software is unchanged from the baseline certification listed in section 1.1.1.

Software Required For Testing	Software Version
Election Event Designer (EED)	4.14.38
Results Tally and Reporting (RTR)	4.14.38
File System Service (FSS)	4.14.38
Audio Studio (AS)	4.14.38
Data Center Manager	4.14.38
Application Server	4.14.38
EMS Adjudication	2.4.1.3201
EMS Database Server	4.14.38
EMS Election Data Translator (EDT)	4.14.38
EMS NAS Server	4.14.38
ImageCast Evolution	4.14.25
ImageCast Precinct	4.14.20
ImageCast Central	4.14.17

 Table 2-2. Dominion-Suite 4.14-E Proprietary Software



2.2.2 Test Materials (Continued)

Table 2-3. Dominion -Suite 4.14-E Proprietary Hardware

Equipment	Model		
ImageCast Precinct (ICP)	PCOS-320A and PCOS 320-C		
ImageCast Evolution (ICE)	PCOS-410A		
ICE – Plastic ballot box	Box-410A		
ICE – Coroplast Ballot Box	Box-420A		
ICP – Metal ballot box	Box-310A		
ICP – Plastic Ballot Box	Box-330C		
ICP – Coroplast Ballot Box	Box-340C		
ICP – Coroplast Ballot Box w/latch	Box-341-C		

2.2.3 Block Diagram

Dominion's D-Suite 4.1.4-E is a paper-based, optical scan voting system. Figure 2-1 provides a visual system overview.

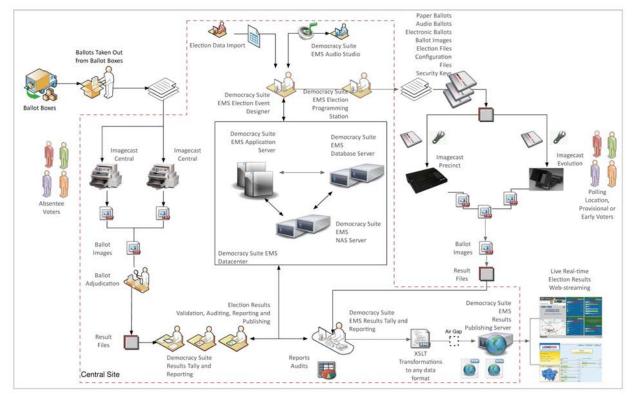


Figure 2-1. D-Suite 4.14-E System Overview



2.2.4 Supported Languages

Table 2-4 list the languages supported by the submitted D-Suite 4.14-E voting system.

System Supported Languages					
Alaska Native - Aleut	Filipino	Korean	Native American - See Below		
Athabascan	French	Spanish	Apache	Seminole	
Chinese	Hindi	Thai	Jicarilla	Towa	
English	Japanese	Vietnamese	Keres	Ute	
Eskimo	Khmer		Navajo	Yuma	

Table 2-4. D-Suite 4.14-E Supported Languages

2.2.5 RFIs

Table 2-5 lists the applicable RFIs the EAC has released as of the date of the Plan as it pertains to this test campaign.

Table 2-5.Applicable RFIs

RFI ID	Name		
2007-02	EAC Decision on Variable Names		
2009-04	EAC Decision on Audit Log Events		
2010-02	EAC Decision on Coding Conventions		
2010-03	EAC Decision on Database Coding Conventions		
2010-05	EAC Decision on Testing of Modifications to a Certified System		
2010-07	EAC Decision on Module Length		
2010-08	EAC Decision on Calling Sequence		
2012-04	EAC Decision on Software Setup Validation		
2013-03	EAC Decision on Timestamps		

2.2.6 NOCs

Table 2-6 lists the applicable NOCs the EAC has released as of the date of the Plan as it pertains to this test campaign.

Table 2-6. Applicable NOCs

NOC ID	Name		
2008-003	EAC Conformance Testing Requirements		
2009-002	Laboratory Independence Requirement		
2009-005	Development and Submission of Test Plans for Modifications to EAC Certified Systems		
2012-02	Clarification of System Identification Tool Functionality		
2013-02	Detailed Description of Changes for Modifications		



3.0 TEST FINDINGS

The Dominion Voting Systems Democracy Suite 4.14-E Voting System, as identified in Section 2.2.1 of this report, was subjected to the tests as summarized in this section.

3.1 Summary Finding

NTS Huntsville performed system level testing on ICE, ICP, and EMS software of the Dominion D-Suite 4.1.4-E Voting System due to modifications made to the Democracy Suite 4.1.4-D Voting System. There were no anomalies nor additional findings associated with this test campaign. Source Code Review deficiencies are listed in Section 3.1.3 and details of deficiencies are in the Deficiency Report located in Appendix B. There are no State Test Reports included in this test report.

3.1.1 Hardware Testing

There were no hardware configuration or design changes submitted for D-Suite 4.14-E, therefore, no hardware testing was required.

3.1.2 System Level Testing

System-level testing examines the ability of proprietary software, hardware, and peripherals in addition to the COTS software, hardware, and peripherals to operate as a complete system. NTS Huntsville utilizes test cases designed to ensure that integrated components function as specified by the manufacturer's documentation and meet the requirements of the VVSG.

3.1.2.1 TDP Review

The Democracy Suite 4.14-E Voting System TDP was reviewed to the 2005 VVSG. This review was performed as part of the testing activities. The TDP review only included the revised and new documents submitted for this testing campaign. The documents were reviewed for accuracy, completeness, and compliance to the 2005 VVSG.

The review results were recorded in a worksheet that provided the pass/fail compliance to each applicable VVSG requirement. There were nine deficiencies reported to Dominion and internally tracked by NTS Huntsville as test exceptions until verified that the applicable documents had been corrected. Dominion corrected nonconformance observations and resubmitted the associated documents for review. This process continued until the TDP complied with the applicable TDP standards in the EAC 2005 VVSG.

Summary Findings

A total of nine TDP deficiencies were discovered during testing. The deficiencies were as follows:

- Some required documents were missing.
- Some documents included were older versions.
- Some content needed to be updated to properly describe the submitted modifications.

All identified TDP deficiencies were resolved prior to the conclusion of the TDP review process.



3.1.2.2 Functional Configuration Audit (FCA)

A Functional Configuration Audit of the Democracy Suite 4.14-E was performed in accordance with Section 6.7 of Volume II of the VVSG. The purpose of the FCA was to verify that the submitted modifications listed in section 2.2.1 performed as documented in the manufacturer supplied technical documentation during pre-voting, voting, and post-voting activities and validated that the modifications meet the requirements of the EAC 2005 VVSG. The FCA for the Democracy Suite 4.14-E campaign included elements of the EMS, ICPs, and ICEs. The FCA tests were designed to ensure compatibility of voting machine functions using the referenced firmware. During the FCA, both normal and abnormal data was input into the system to attempt to introduce errors and test for error recovery.

Summary Findings

One deficiency was discovered during the FCA test. During testing, the ICP stopped responding while printing the write-in report. Full details of the deficiency can be found in Appendix B – Deficiency Report. After correcting the deficiency, the FCA was conducted without further incident or deficiencies.

3.1.3 Source Code Review

As part of testing activities, the source code submitted for the Democracy Suite 4.14-E System was compared to the baseline version included in the Democracy Suite 4.14-D System. Any code changes were reviewed by NTS to determine its compliance to the 2005 VVSG and manufacturer coding standards. Three software suites were examined during this test campaign; EMS, ICE, ICP.

Summary Findings

A total of seventy-five source code deficiencies were discovered during testing. The deficiencies were as follows:

ICP:		EMS:	
Header Return	1	No issues	
Header Purpose	3		
Header File References	7	ICE:	
Header Revision History	16	Header File References	1
Header Globals Missing	3	Header Globals Missing	1
Units Called	10	Units Called	12
Unit Size Too Large	1	Inconsistent- Indenting	1
No Parameter Validation	2	Non Enumerated Constant	9
Line Too Long	1		
Non Enumerated Constant	1		
Header or File Name Missing	6		

All identified source code deficiencies were resolved prior to the conclusion of the source code review process.



3.2 Anomalies and Resolutions

NTS Huntsville defines an anomaly as any unexpected result and/or event that deviates from what is standard, normal, or expected in which no root cause has been determined. All anomalies are logged and monitored throughout the test campaign and subsequent testing efforts. Anomalies may become deficiencies when a root cause is established.

No anomalies occurred during testing of the Democracy Suite 4.14-E System.

3.3 Deficiencies and Resolutions

NTS Huntsville defines a deficiency as any repeatable test result or event that is counter to the expected result or violates the specified requirements. Deficiencies are placed into the NTS deficiency tracking system (Mantis) and the EAC's Virtual Review Tool (VRT) for disposition and resolution.

Deficiencies encountered during testing were successfully resolved prior to test completion. Deficiencies are summarized in the summary findings of the respective test section of the test report and their resolutions are presented in their entirety in Appendix B – Deficiency Report.

4.0 **RECOMMENDATION FOR CERTIFICATION**

NTS Huntsville performed conformance testing on the Dominion Democracy Suite 4.14-E Voting System to the EAC 2005 VVSG (Version 1.0). NTS determined that the modifications met the requirements of the EAC 2005 VVSG and the manufacturer's technical documentation. Based on test findings, NTS Huntsville recommends the EAC grant the Democracy Suite 4.14-E Voting System certification to the EAC 2005 VVSG. This report is valid only for the equipment identified in Section 2.0 of this report. Due to the varying requirements of individual jurisdictions, it is recommended by the EAC 2005 VVSG that local jurisdictions perform acceptance tests on all systems prior to their implementation within their jurisdiction.



APPENDIX A. ADDITIONAL FINDINGS



This page INTENTIONALLY LEFT BLANK as there were no ADDITIONAL FINDINGS associated with this Test Campaign.



APPENDIX B. DEFICIENCY REPORT



B.1 DEFICIENCY REPORT

Table B-1 describes the functional deficiency and resolution discovered during the D-Suite 4.14-E test campaign.

EAC VRT ID ¹	Deficiency Summary	Resolutions
	During FCA testing of the ICP the unit	The deficiency was related to code
	experienced a freeze up while printing the	changes made in response to the ICP
173	write-in report. Testers were able to duplicate	source code review. A variable name had
1/5	failure multiple times with two outcomes.	been changed. The variable name was
	Either the unit would freeze up while printing	corrected and the deficiency has been
	or completely power down.	resolved.

Table B-1. Functional Deficiency Report

¹ The ID numbers may not be sequential. The deficiency tracking system (VRT) that is utilized by the EAC creates unique ID numbers based on overall entries within the database and not within individual projects.



APPENDIX C. ANOMALY REPORT



This page INTENTIONALLY LEFT BLANK as no Anomalies occurred during this Test Campaign.



APPENDIX D. TEST PLAN



D.1 AS-RUN TEST PLAN

The following change was made to the test plan as a result of testing:

• On page 14, Table 3-1 Proprietary Software Utilized for Testing, The software version for ImageCast Precinct was changed from 4.14.18 to 4.14.20.

(The remainder of this page intentionally left blank)



APPENDIX E. TECHNICAL DATA PACKAGE



E.1 DEMOCRACY SUITE 4.14-E TECHNICAL DATA PACKAGE

The documents listed in Table E-1 comprise the Democracy Suite 4.14-E Voting System TDP

Document Title	Version	Date	Document Number
System Overview	4.14.E::324	4/6/15	2.02
System Security Specification	4.14.E::436	5/13/15	2.06
Configuration Management Plan	4.14.D::205	10/22/14	2.11
Quality Assurance Program	1.2.0::80	10/16/12	2.12
System Test and Verification Plan	1.1.0::104	10/16/12	2.07
System Test and Verification Suites	4.14.D::1	8/21/14	2.07
Personnel Training and Deployment Requirements	1.1.0::53	4/9/13	2.10
EMS Functionality Description	4.14.D::251	7/22/14	2.03
ICE Functionality Description	4.14-D::80	10/2/14	2.03
ICP Functionality Description	4.14.E::136	3/31/15	2.03
ICC Functionality Description	4.14.D::88	10/17/14	2.03
ICE System Hardware Specification	1.2.0::305	10/20/14	2.04
ICP System Hardware Specification	1.1.0::98	10/20/14	2.04
ICE System Hardware Characteristics	1.2.0::95	10/20/14	2.04.1
ICP System Hardware Characteristics	1.1.0::56	10/20/14	2.04.1
EMS Software Design and Specification	4.14.D::219	7/22/14	2.05
ICE Software Design and Specification	4.14.E::121	3/31/15	2.05
ICP Software Design and Specification	4.14.E::116	3/31/15	2.05
ICC Software Design and Specification	1.0.0::34	11/30/12	2.05
Adjudication Software Design and Specification	4.14.D::25	7/22/14	2.05
ICP System Operation Procedures	4.14.E::227	5/12/15	2.08
EMS System Operation Procedures	4.14.E::629	5/13/15	2.08
ICE System Operation Procedures	4.14.E::174	5/13/15	2.08
ICC System Operation Procedures	4.14.D::122	10/16/14	2.08
ICP System Maintenance Manual	1.1.0::66	10/16/12	2.09
ICE System Maintenance Manual	1.1.0::115	10/16/12	2.09
EMS System Maintenance Manual	1.0.0::50	10/16/12	2.09
Adjudication System Maintenance Manual	4.14D::9	7/27/14	2.09
EMS Election Event Designer User's Guide	4.14.E::253	5/12/15	N/A
EMS Results Tally & Reporting User's Guide	4.14.D::153	9/23/14	N/A
EMS Audio Studio User's Manual	4.14.D::49	10/1/14	N/A
Adjudication User's Manual	4.14.D::41	7/28/14	N/A
EMS Build and Install	2.1.0::18	8/11/14	N/A
ICP Device Configuration Files	4.14.E::37	4/1/15	N/A
ImageCast Election Definition Files	3.0.13	4/9/14	N/A
ICP Firmware Build and Install	4.2.14	10/3/12	N/A
ICP Firmware Update Procedure	1.0.0::15	8/14/14	N/A
ICP Technical Guide	1.0.0::9	10/17/12	N/A
ICE Technical Guide	1.0.0::60	10/17/12	N/A
ICE Build Procedure	4.14.D::49	7/21/14	N/A
ICE Firmware Installation Procedure	4.14.E::46	3/31/15	N/A
Dominion Voting C C++ Coding Standard	1.0.0::8	7/27/12	N/A
Dominion Voting Usability Study – ICP	1.0.0::26	7/27/12	N/A
Dominion Voting Usability Study – ICE	1.0.0::36	7/13/12	N/A

Table E-1. Democracy 4.14-E Voting System TDP